




www.euromilk.pl

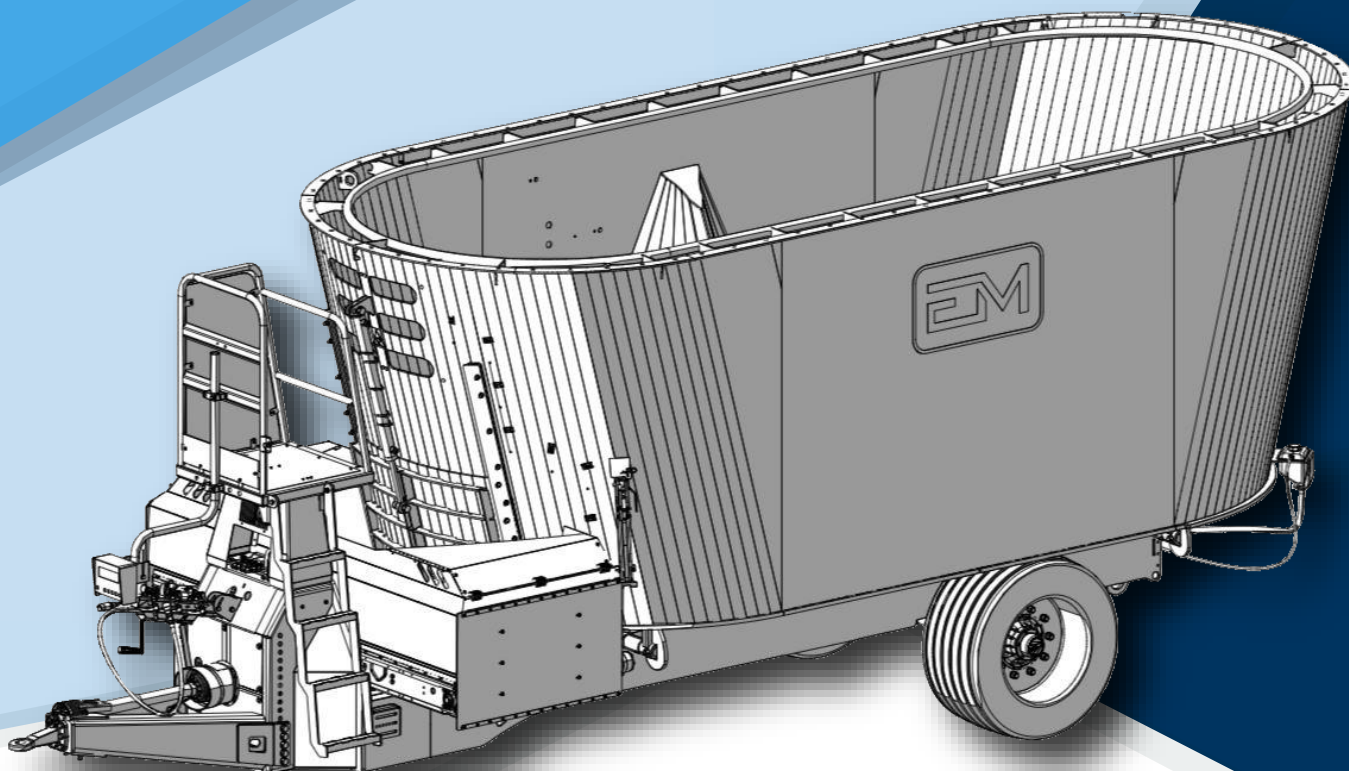

RINO

FXX 2200 HD+

SPARE PARTS CATALOG

2024
JULY
REV.I
EN



SCAN BEFORE

**INFORMATION**

The information contained in the parts catalog is current as of the date of preparation.

The manufacturer reserves the right to introduce design changes in the machines, therefore some sizes or illustrations may not correspond to the actual condition of the machine delivered to the user.

The manufacturer reserves the right to make design changes without making any changes to this catalogue.

**THE PARTS CATALOG IS VALID FOR THE
FOLLOWING FEED MIXER WAGON MODELS:**

FXX 2200 HD +

CONTENTS

1.SPARE PARTS

1.1.	MAIN COMPONENTS	8
1.2.	DRAWBAR.....	10
1.3.	MAST.....	12
1.4.	SUPPORT FOOT	14
1.5.	PLATFORM WITH INSPECTION LADDER.....	16
1.6.	COUNTER KNIFE.....	18
1.7.	INSPECTION WINDOW.....	20
1.8.	DISCHARGE WINDOW - FRONT	22
1.9.	DISCHARGE WINDOW - REAR	24
1.9.1.	ATTACHMENT TO THE CHAMBER.....	24
1.9.2.	FIXING OF THE TARPULIN.....	26
1.10.	AUGER	28
1.11.	AUGER DRIVE UNIT	30
1.11.1.	WOM SHAFT AND GEARBOX HOUSING.....	30
1.11.2.	HIGH-SPEED TRANSMISSION	32
1.11.3.	FRONT AUGER	34
1.11.4.	REAR AUGER	36
1.12.	BELT WITH HOUSING	38
1.12.1.	ATTACHMENT TO THE BASKET	38
1.12.2.	BELT FRAME.....	40
1.12.3.	HOUSING FOR BELT.....	42
1.12.4.	HYDRAULIC INSTALLATION	44
1.21.	AXLE WITH WHEELS.....	46
1.22.	WEDGES.....	48
1.23.	WEIGHT SENSOR	50
1.24.	HYDRAULIC BRAKES	52

2. HYDRAULIC HOSES

RINO


FXX 2200 HD +

SPARE
PARTS

1.


1.1.MAIN COMPONENTS

L.P.	DESCRIPTION
1	Chamber
2	Frame
3	Drawbar
4	Augers
5	Drive of augers
6	Single axle with wheels
7	Side discharge body
8	Cross belt 0.9 x 2.5 m
9	Platform with ladder

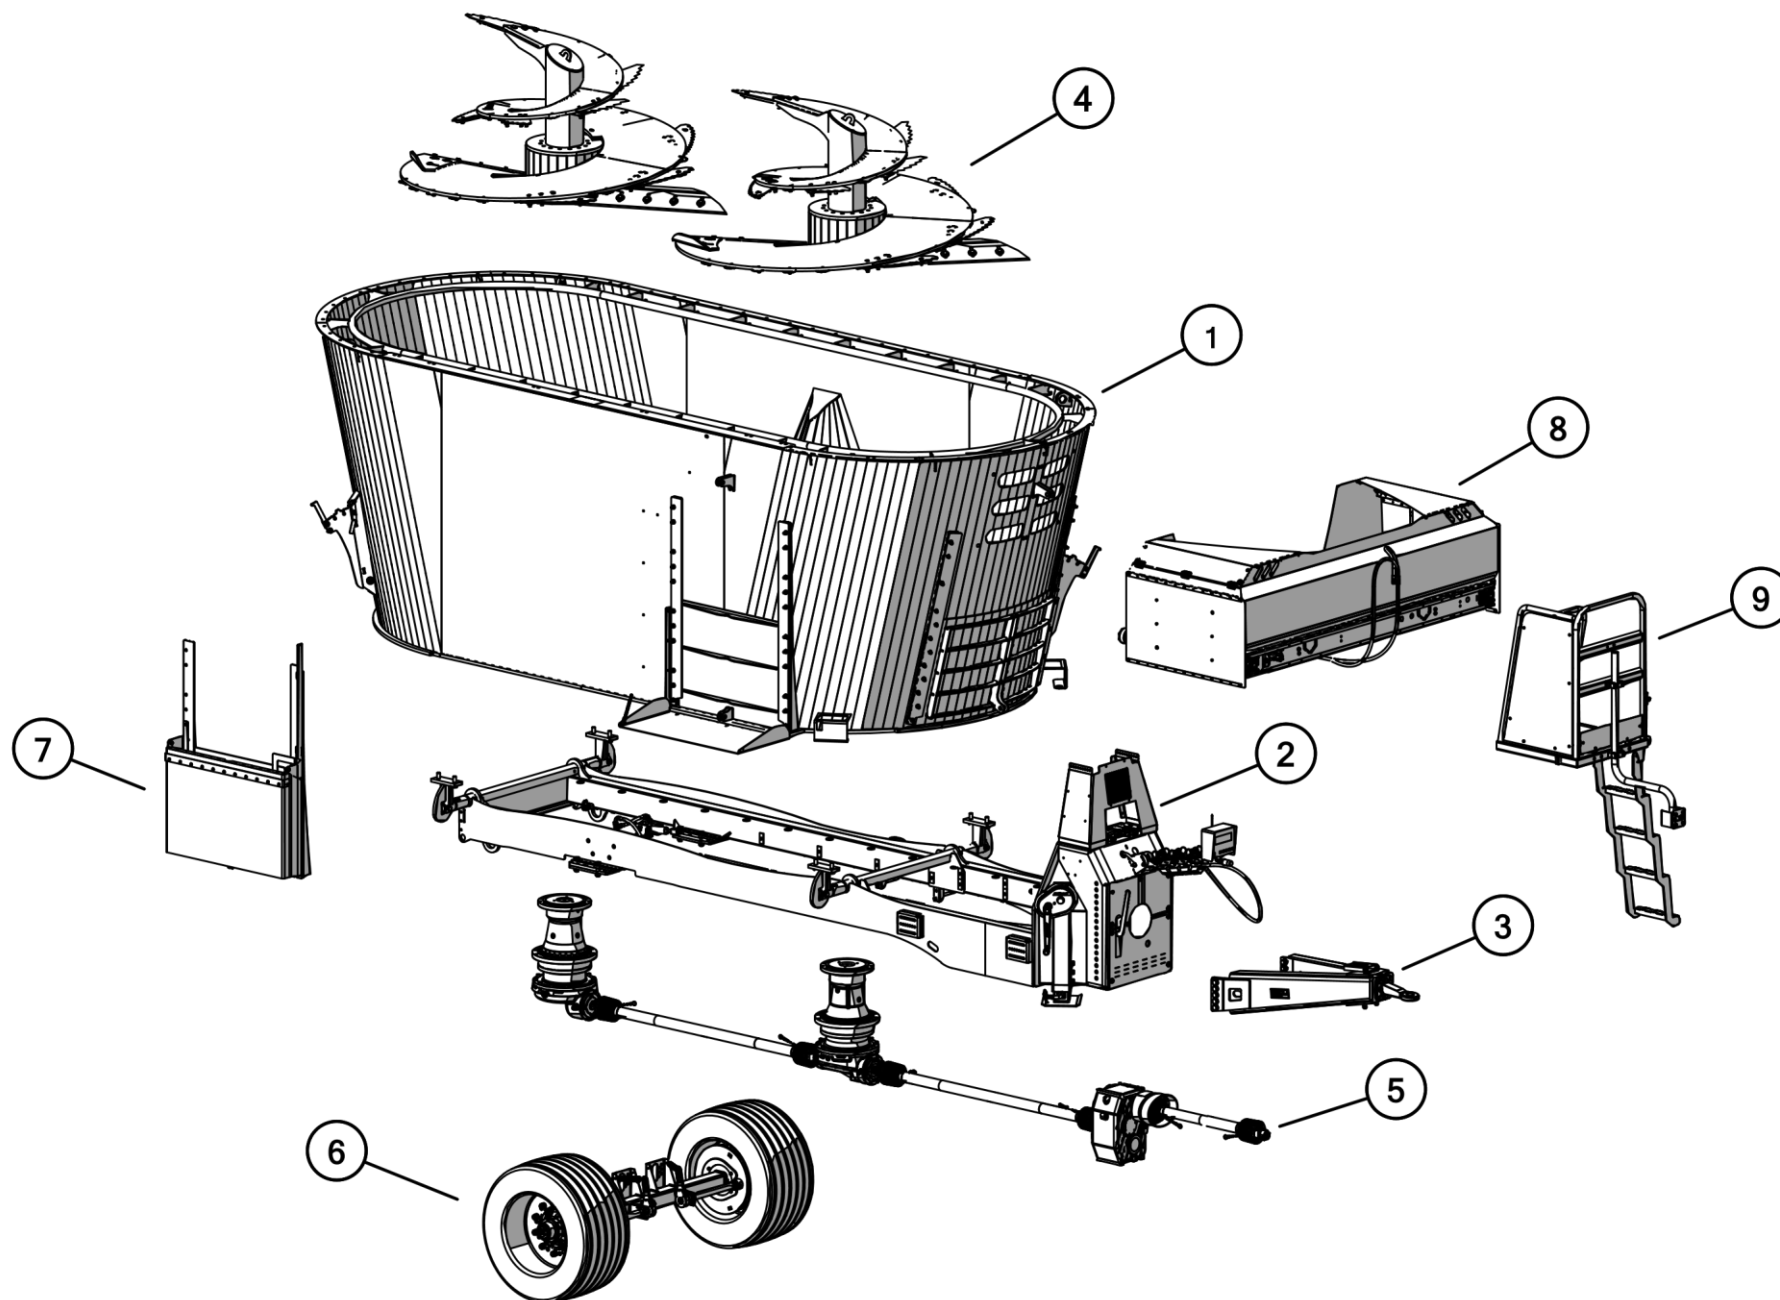


1.2. DRAWBAR

L.P.	DESCRIPTION	CODE	QUANTITY
1	FXX HD+ welded frame	EM-000531	1
2	Drawbar	EM-000535	1
3	Drawbar eye bolt 190 kN, Fi = 50, 110x100	118005	1
4	Shaft support	EM-000504	1
5	Plate - approval of drawbar 132x60 mm	110975	1
6	Flat head rivet 4x10 AL-AL ISO 15977	000993	4
7	Hex head bolt. M8x25-8.8 OC ISO 4017 PG	112037K	2
8	Hex head bolt. M16x70-8.8 OC ISO 4014 NG	112075	8
9	Screw with head six. M22x70-8.8 OC ISO 4014 NG	112513	10
10	Washer 8 OC 200HV ISO 7089	112403	4
11	Washer 16 OC 200HV ISO 7089	112410K	16
12	Washer 22 OC 200HV ISO 7089	112414	20
13	Self-counter nut. M8 - 8 OC ISO 7040	112203K	2
14	Self-contained nut. M16 - 8 OC ISO 7040	112207K	8
15	Self-constricting nut M22 - 8 OC ISO 7040	112212	10

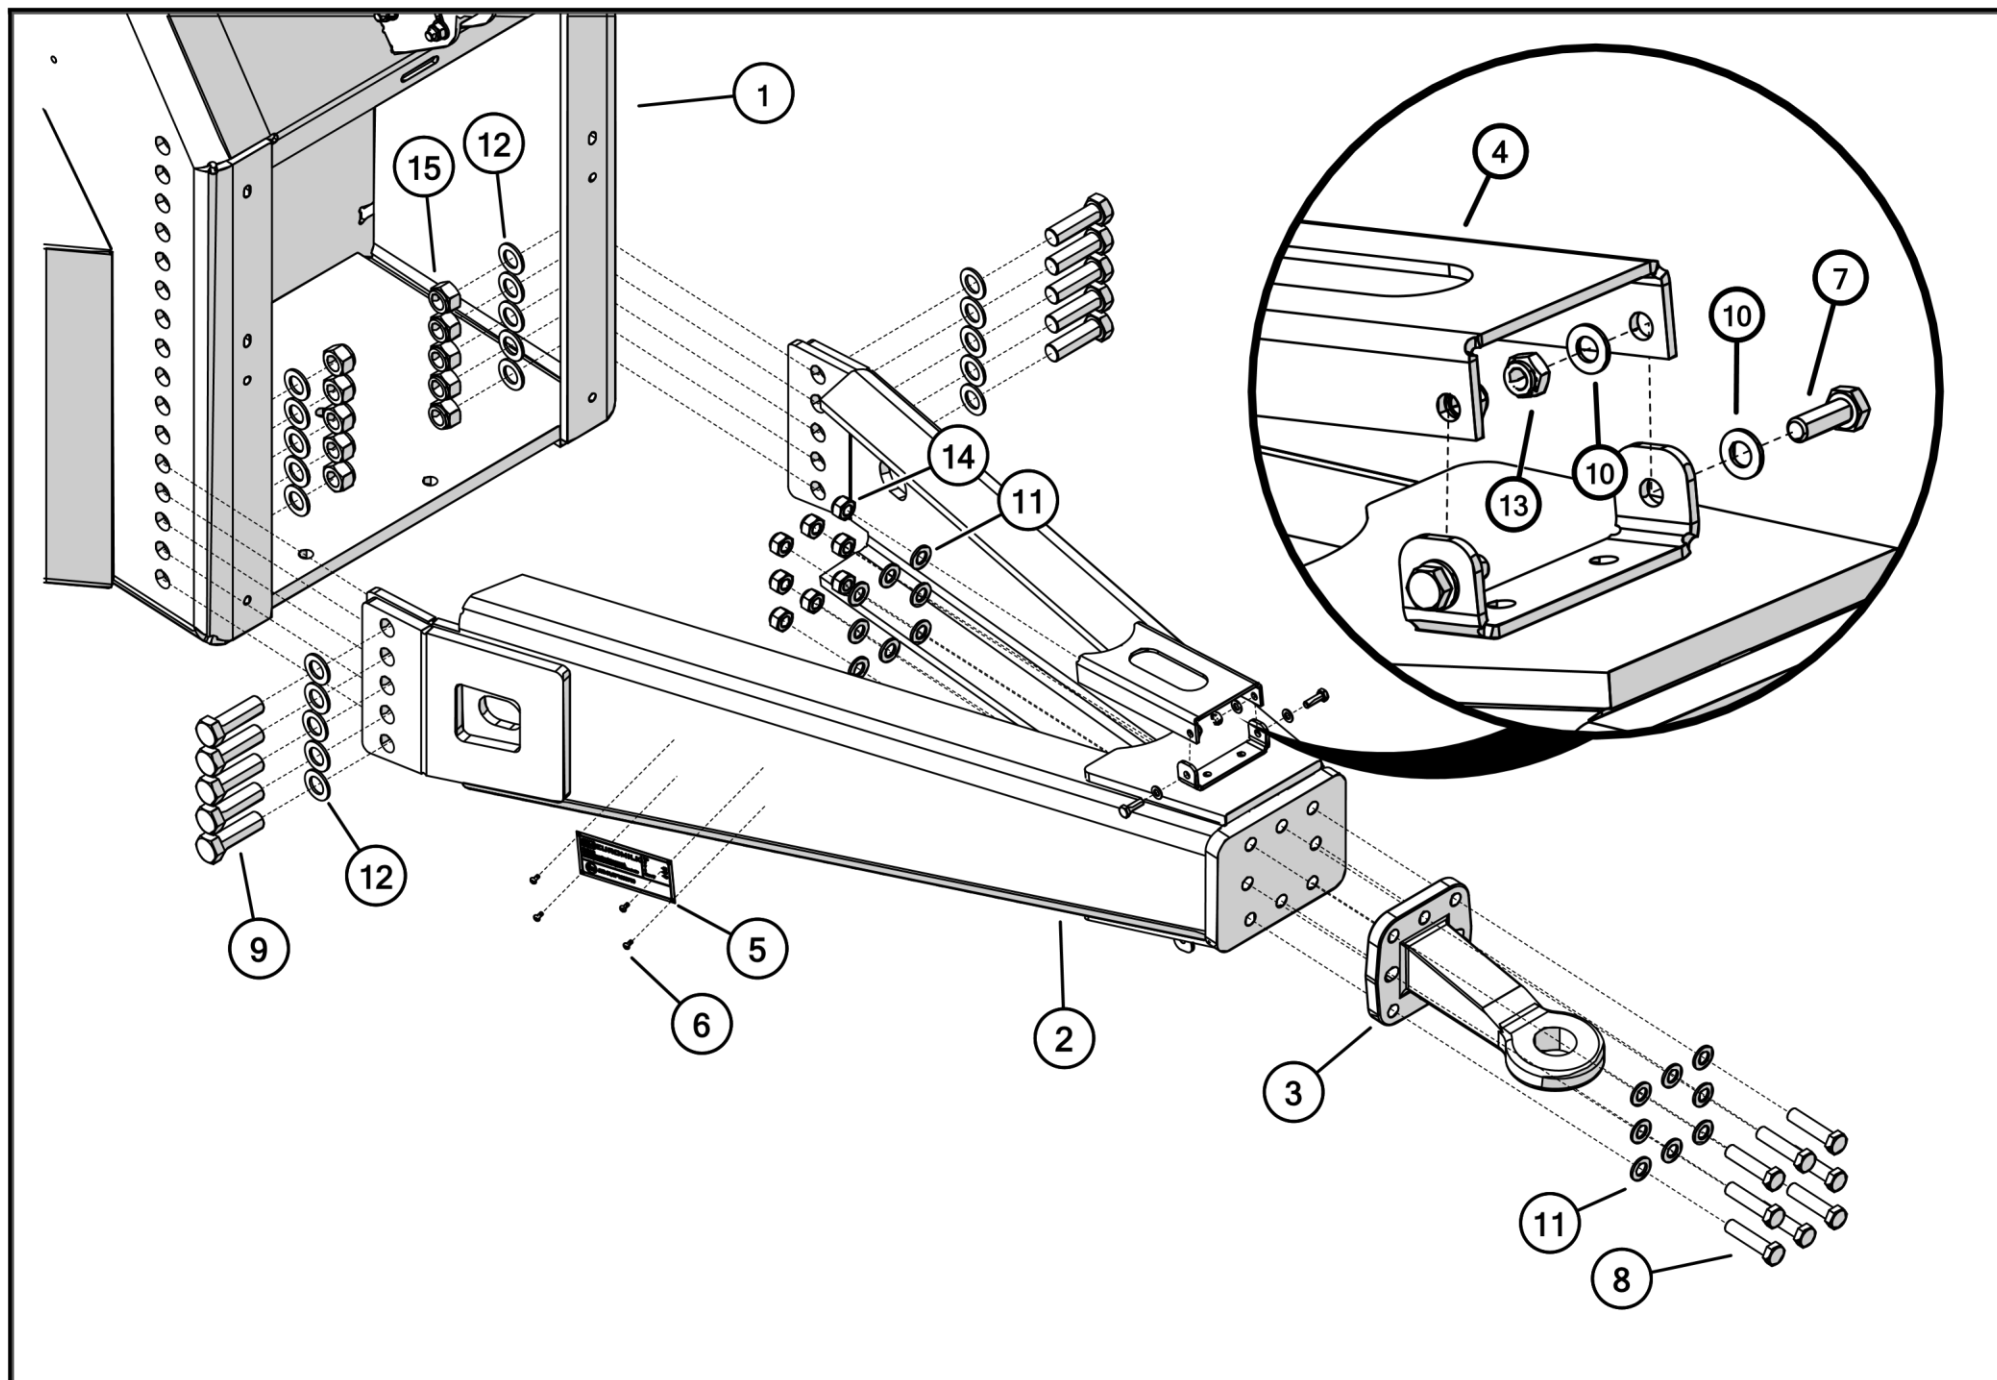


1.3.MAST

L.P.	DESCRIPTION	CODE	QUANTITY
1	FXX HD+ welded frame	EM-000531	1
2	Cable hanger	EM-002988	1
3	ZK 50/50 blanking plug	001103	1
4	Six head bolt. M12x90-8.8 OC ISO 4014 NG	112463K	2
5	Washer 12 OC 200HV ISO 7089	112406K	4
6	Self-contained nut. M12 - 8 OC ISO 7040	112205K	2

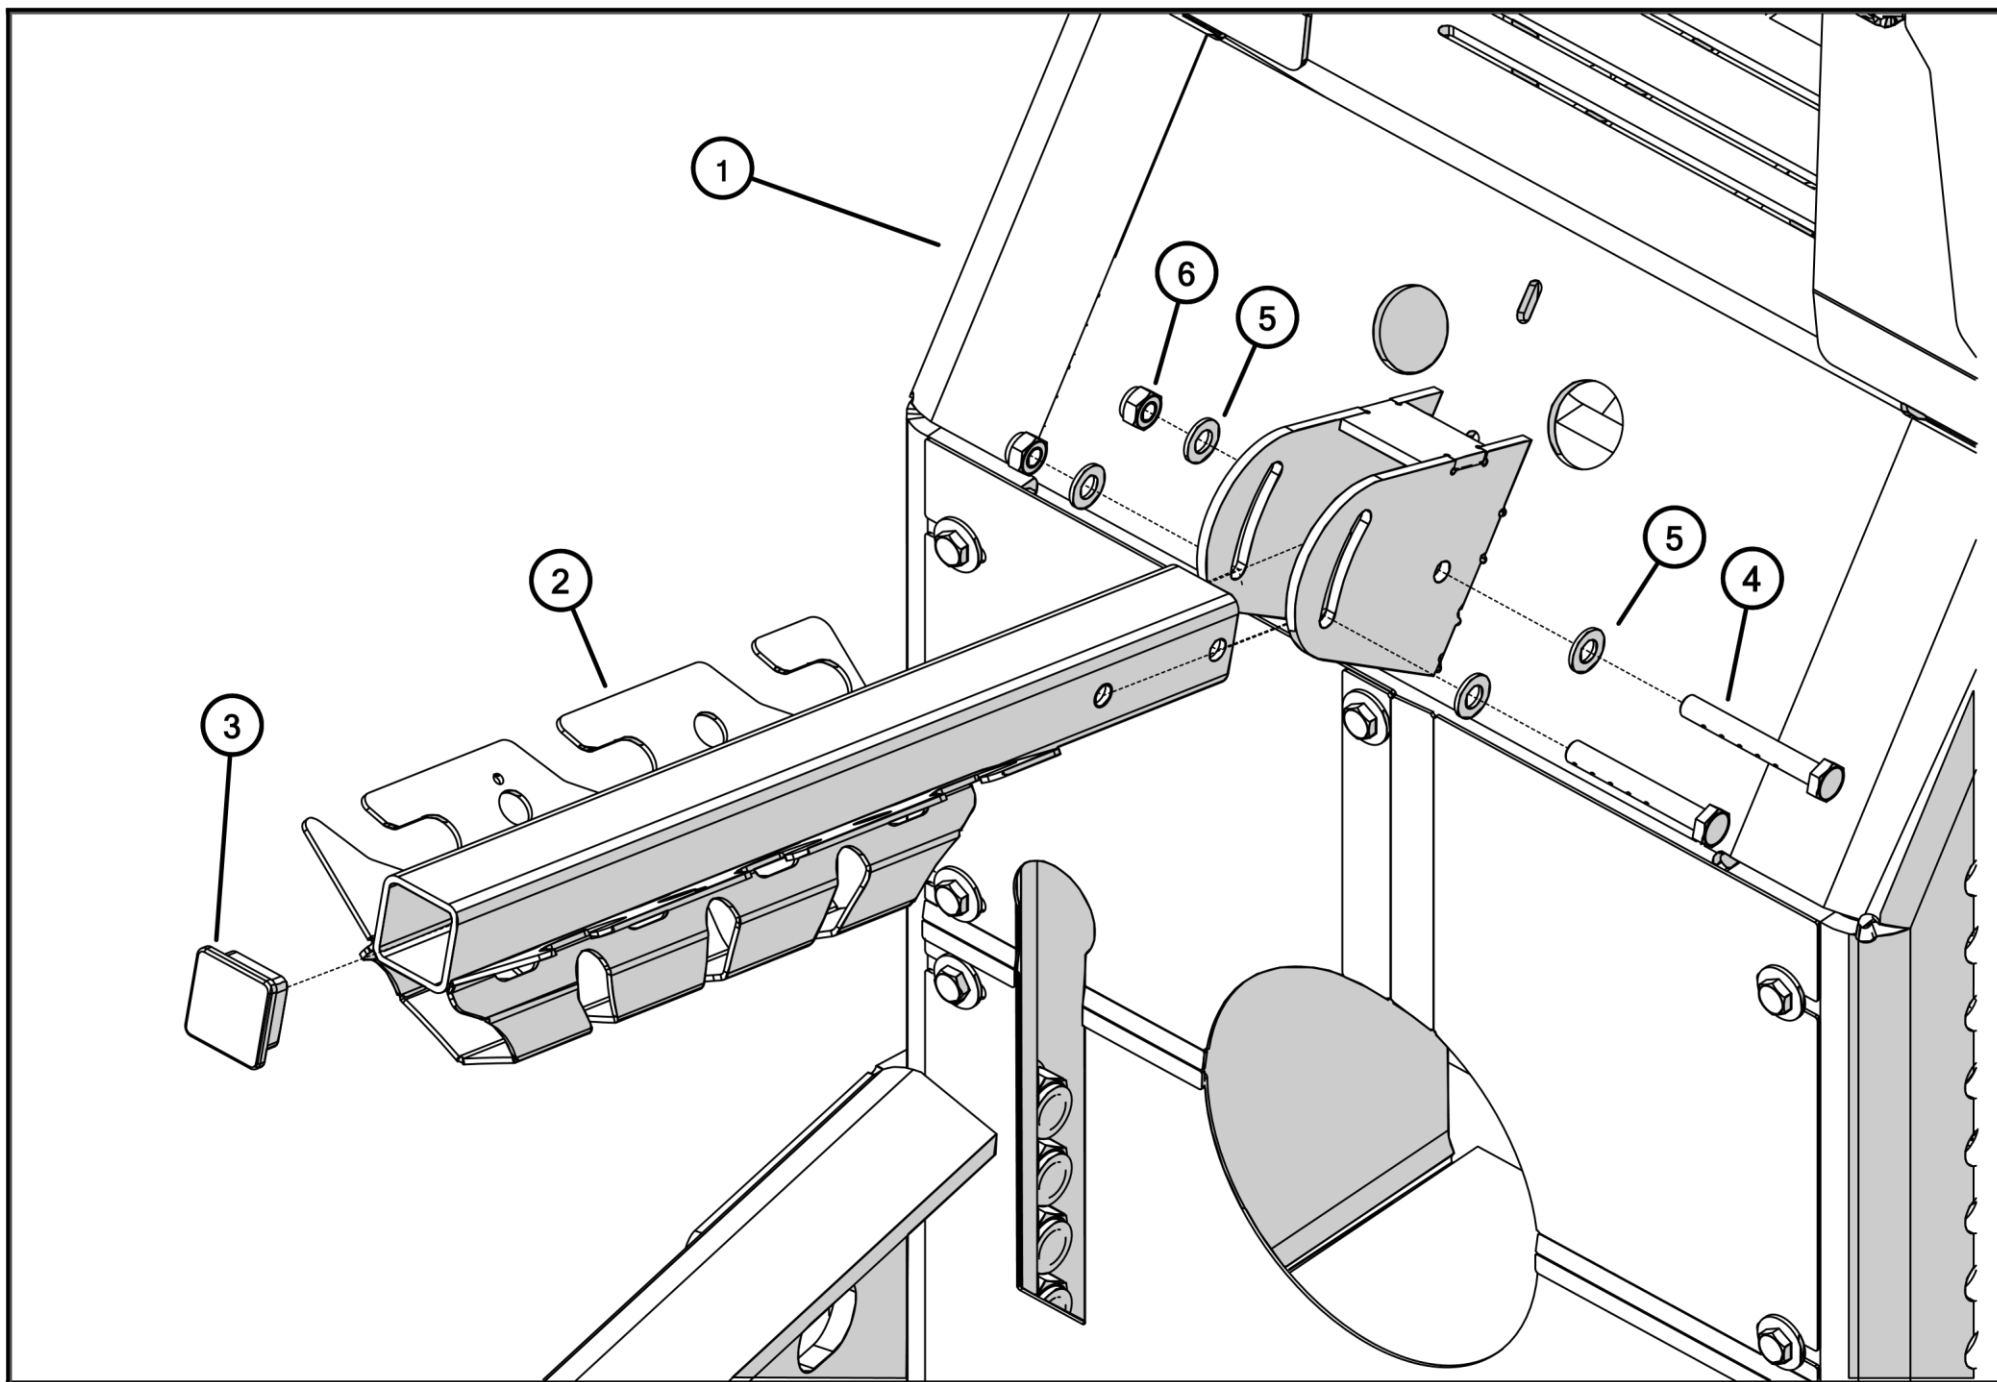


1.4. SUPPORT FOOT

L.P.	DESCRIPTION	CODE	QUANTITY
1	FXX HD+ welded frame	EM-000531	1
2	KRA 750 support foot	EM-008477	1
3	Yellow sticker - lubrication spot	120935	1
4	Hex head bolt. M16x1.5x140-10.9 OC ISO 4014 NG	112568	3
5	Washer 16 OC 200HV ISO 7089	112410K	6
6	Self-counter nut. M16 - 8 OC ISO 7040	112207K	3

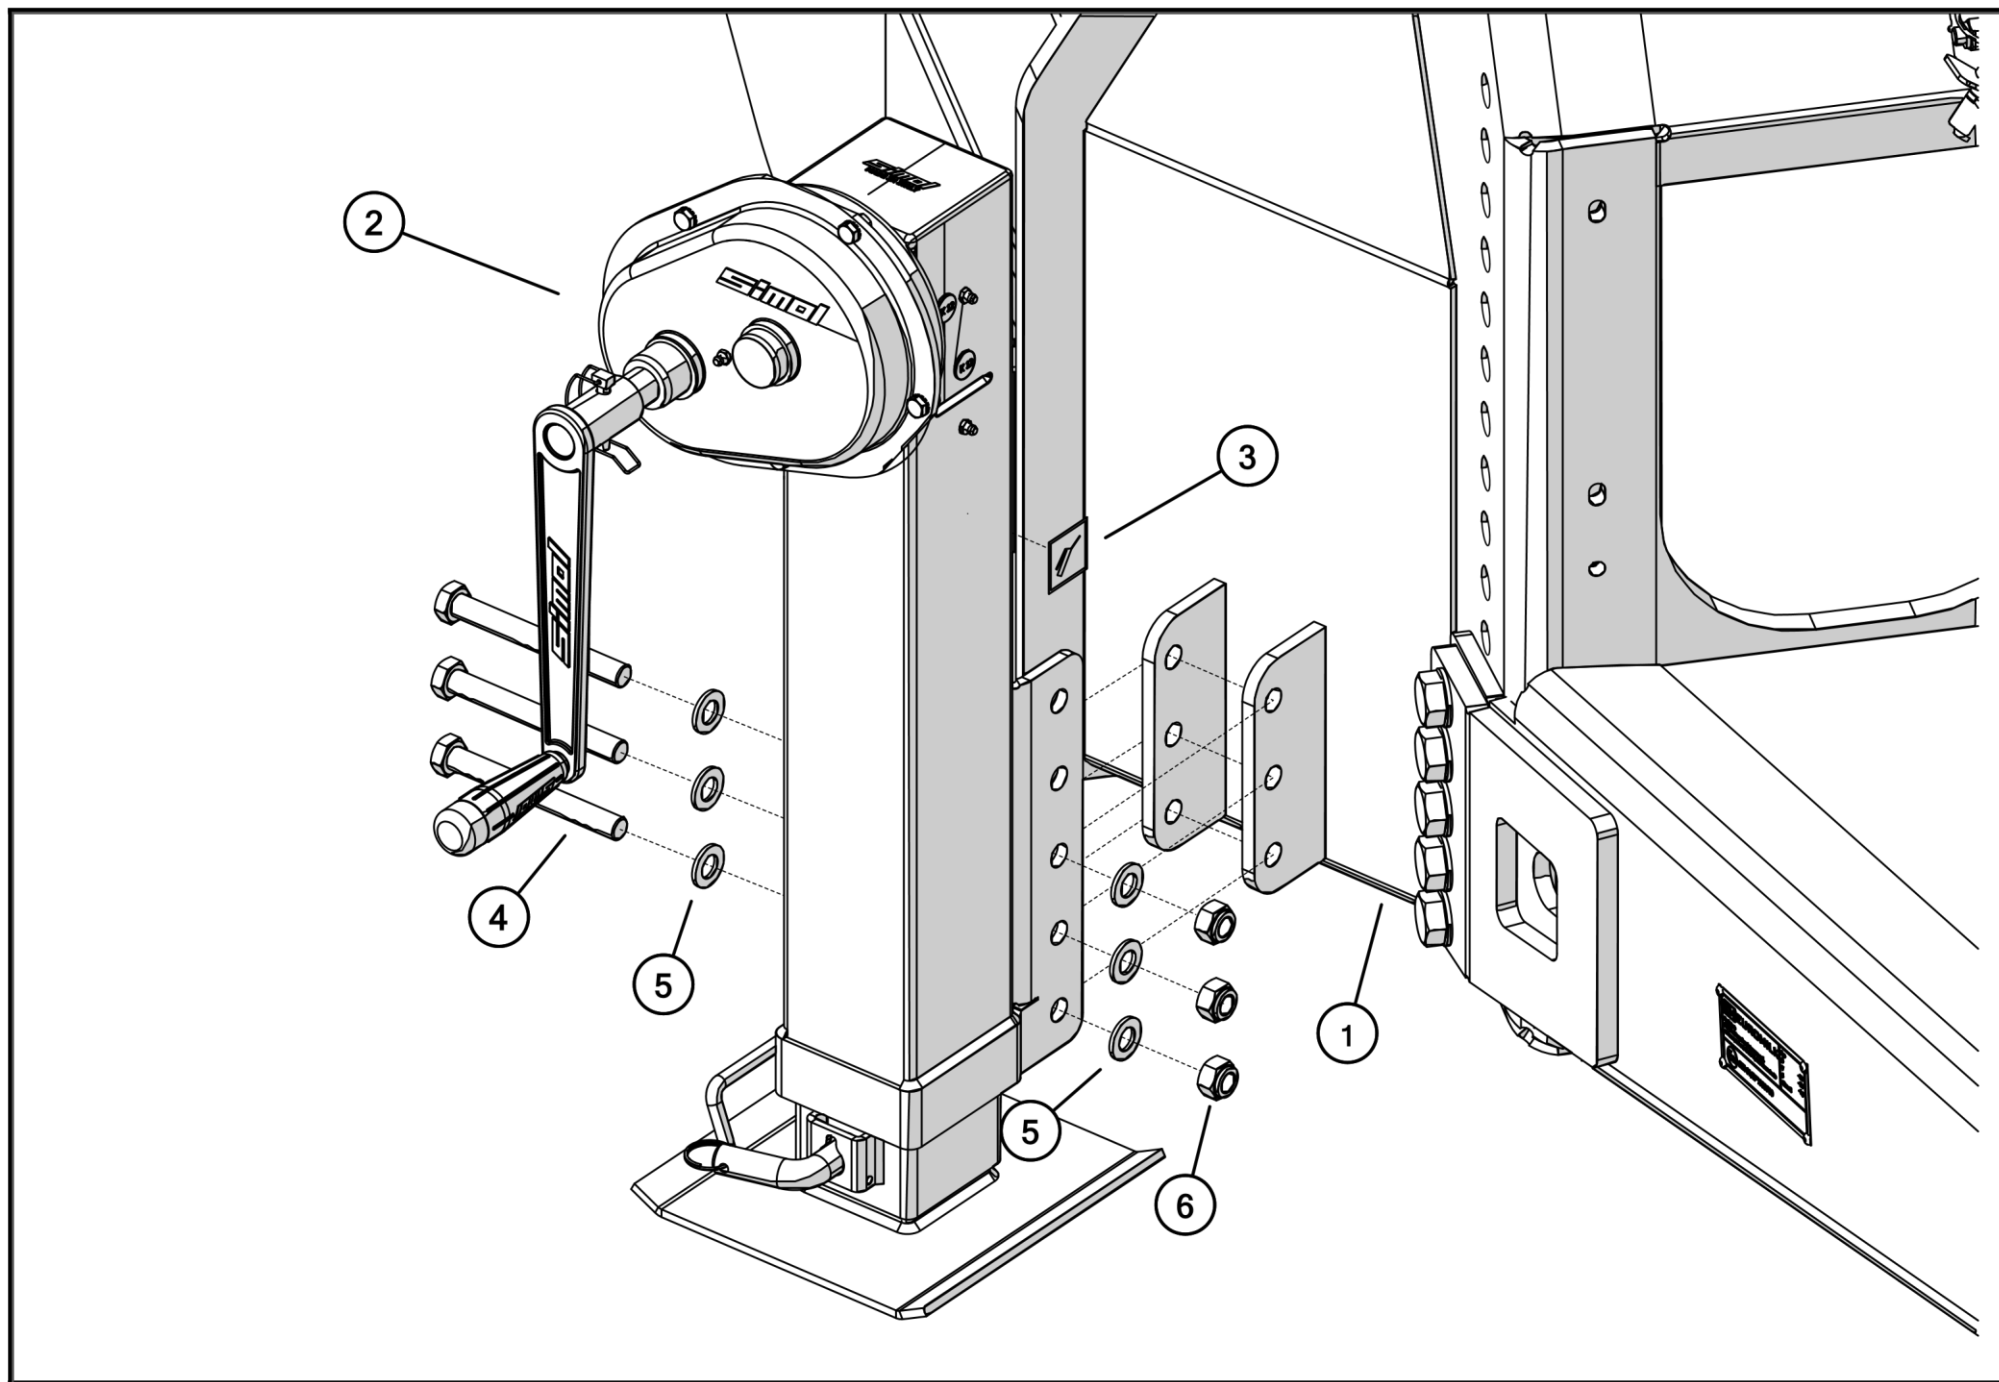


1.5. PLATFORM WITH INSPECTION LADDER

L.P.	DESCRIPTION	CODE	QUANTITY
1	FXX HD+ welded frame	EM-000531	1
2	Universal welded platform	EM-000355	1
3	Platform base	EM-000945	1
4	Welded ladder 4 steps	EM-007343	1
5	Cover for turret	EM-000354	1
6	Floor for turret	EM-007681	1
7	Turret fairing	EM-000353	1
8	Warning sign kit	120981	1
9	Flat head rivet 6x12 AL-AL ISO 15977	220030	14
10	Locking pin D-21mm d2-M12x1.75mm SW-12 d1-8	001694	1
11	Hex head bolt. M6x20-8.8 OC ISO 4017 PG	112033K	11
12	Six head screw. M10x35-8.8 OC ISO 4017 PG	112048K	6
13	Screw with head six. M10x40-10.9 OC ISO 4017 PG	112512K	4
14	Hex head bolt. M12x40-8.8 OC ISO 4017 PG	112059	2
15	Washer 6 OC 200HV ISO 7089	112402K	22
16	Washer 10 OC 200HV ISO 7089	112404K	6
17	Augmented washer 10 OC 200HV ISO 7093	112405K	14
18	Washer 12 OC 200HV ISO 7089	112406K	4
19	Self-contained nut. M6 - 8 OC ISO 7040	112202K	11
20	Self-contained nut. M10 - 8 OC ISO 7040	112204K	10
21	Self-contricting nut m12 - 8 oc iso 7040 M12 - 8 OC ISO 7040	112205K	2

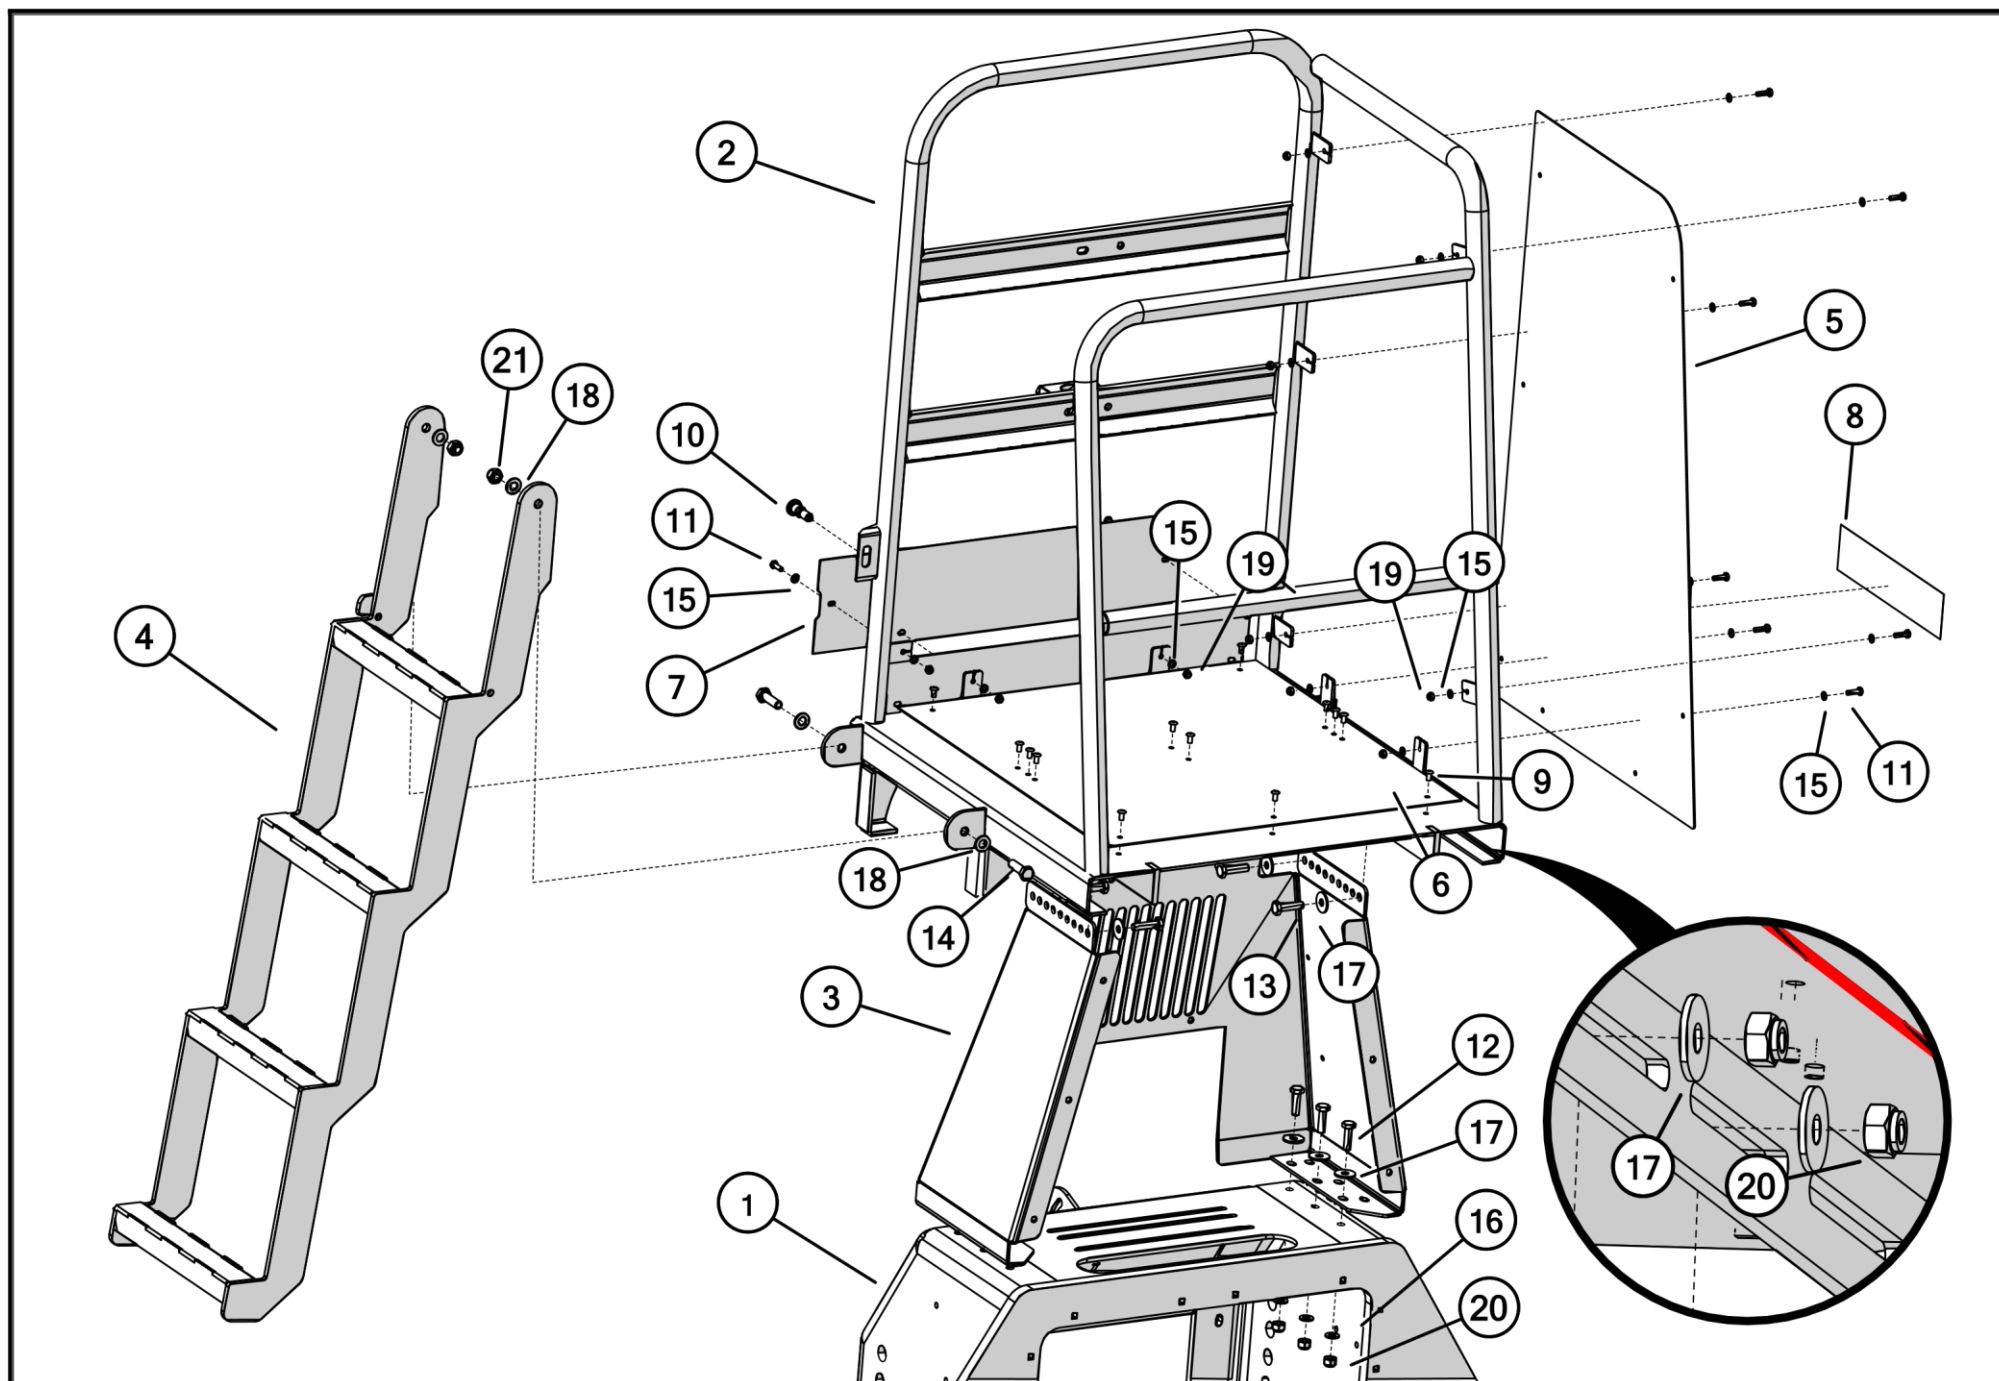


1.6. COUNTER KNIFE

L.P.	DESCRIPTION	CODE	QUANTITY
1	Welded FXX HD+ basket Bottom 2.55 Discharges 6 and 13	EM-011100	1
2	Counter knife	EM-000171	1
3	OC counter knife handle	EM-000163	1
4	Welded counter knife handle	EM-000167	1
5	4mm double-strand pin DIN 11024	110625K	1
6	Hex head bolt. M10x60-8.8 OC ISO 4014 NG	112108K	2
7	Six head screw. M20x90-8.8 OC ISO 4014 NG	112097K	1
8	Washer 10 OC 200HV ISO 7089	112404	2
9	Enlarged washer 10 OC 200HV ISO 7093	112405K	2
10	Washer 20 OC 200HV ISO 7089	112413K	2
11	Self-contained nut. M10 - 8 OC ISO 7040	112204K	2
12	Self-contained nut. M20 - 8 OC ISO 7040	112210K	1

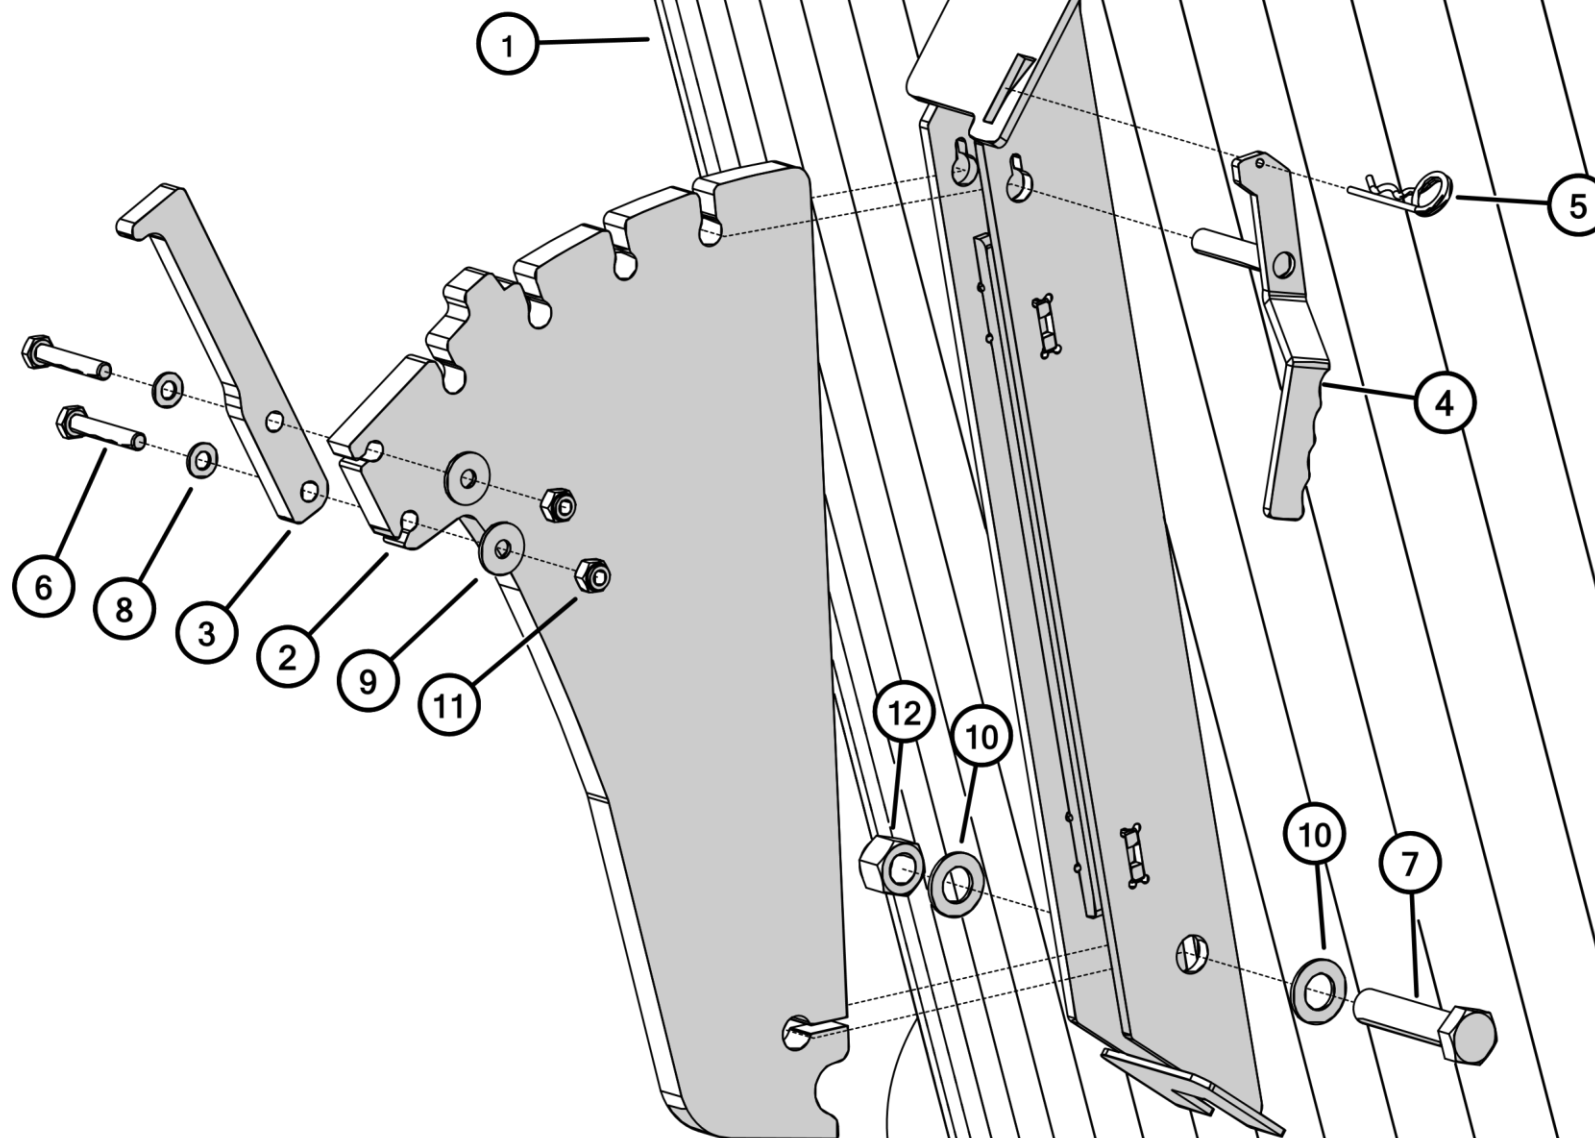


1.7. INSPECTION WINDOW

L.P.	DESCRIPTION	CODE	QUANTITY
1	Welded FXX HD+ basket Bottom 2.55 Discharges 6 and 13	EM-011100	1
2	Plexiglas 4 mm - 745x560 mm 2 sides UV 1.5*2.05	002546	1
3	Plexiglas mounting rivet	EM-003798	2
4	Plexiglass mounting rivet top and bottom	EM-004220	2
5	Sticker - Spinning worm GDW018B2FN tdc	120964	1
6	Underbolt M8x25-8.8 OC ISO 8677	112176K	8
7	Washer 8 OC 200HV ISO 7089	112403K	8
8	Self-counter nut. M8 - 8 Geomet ISO 7040	114203K	8

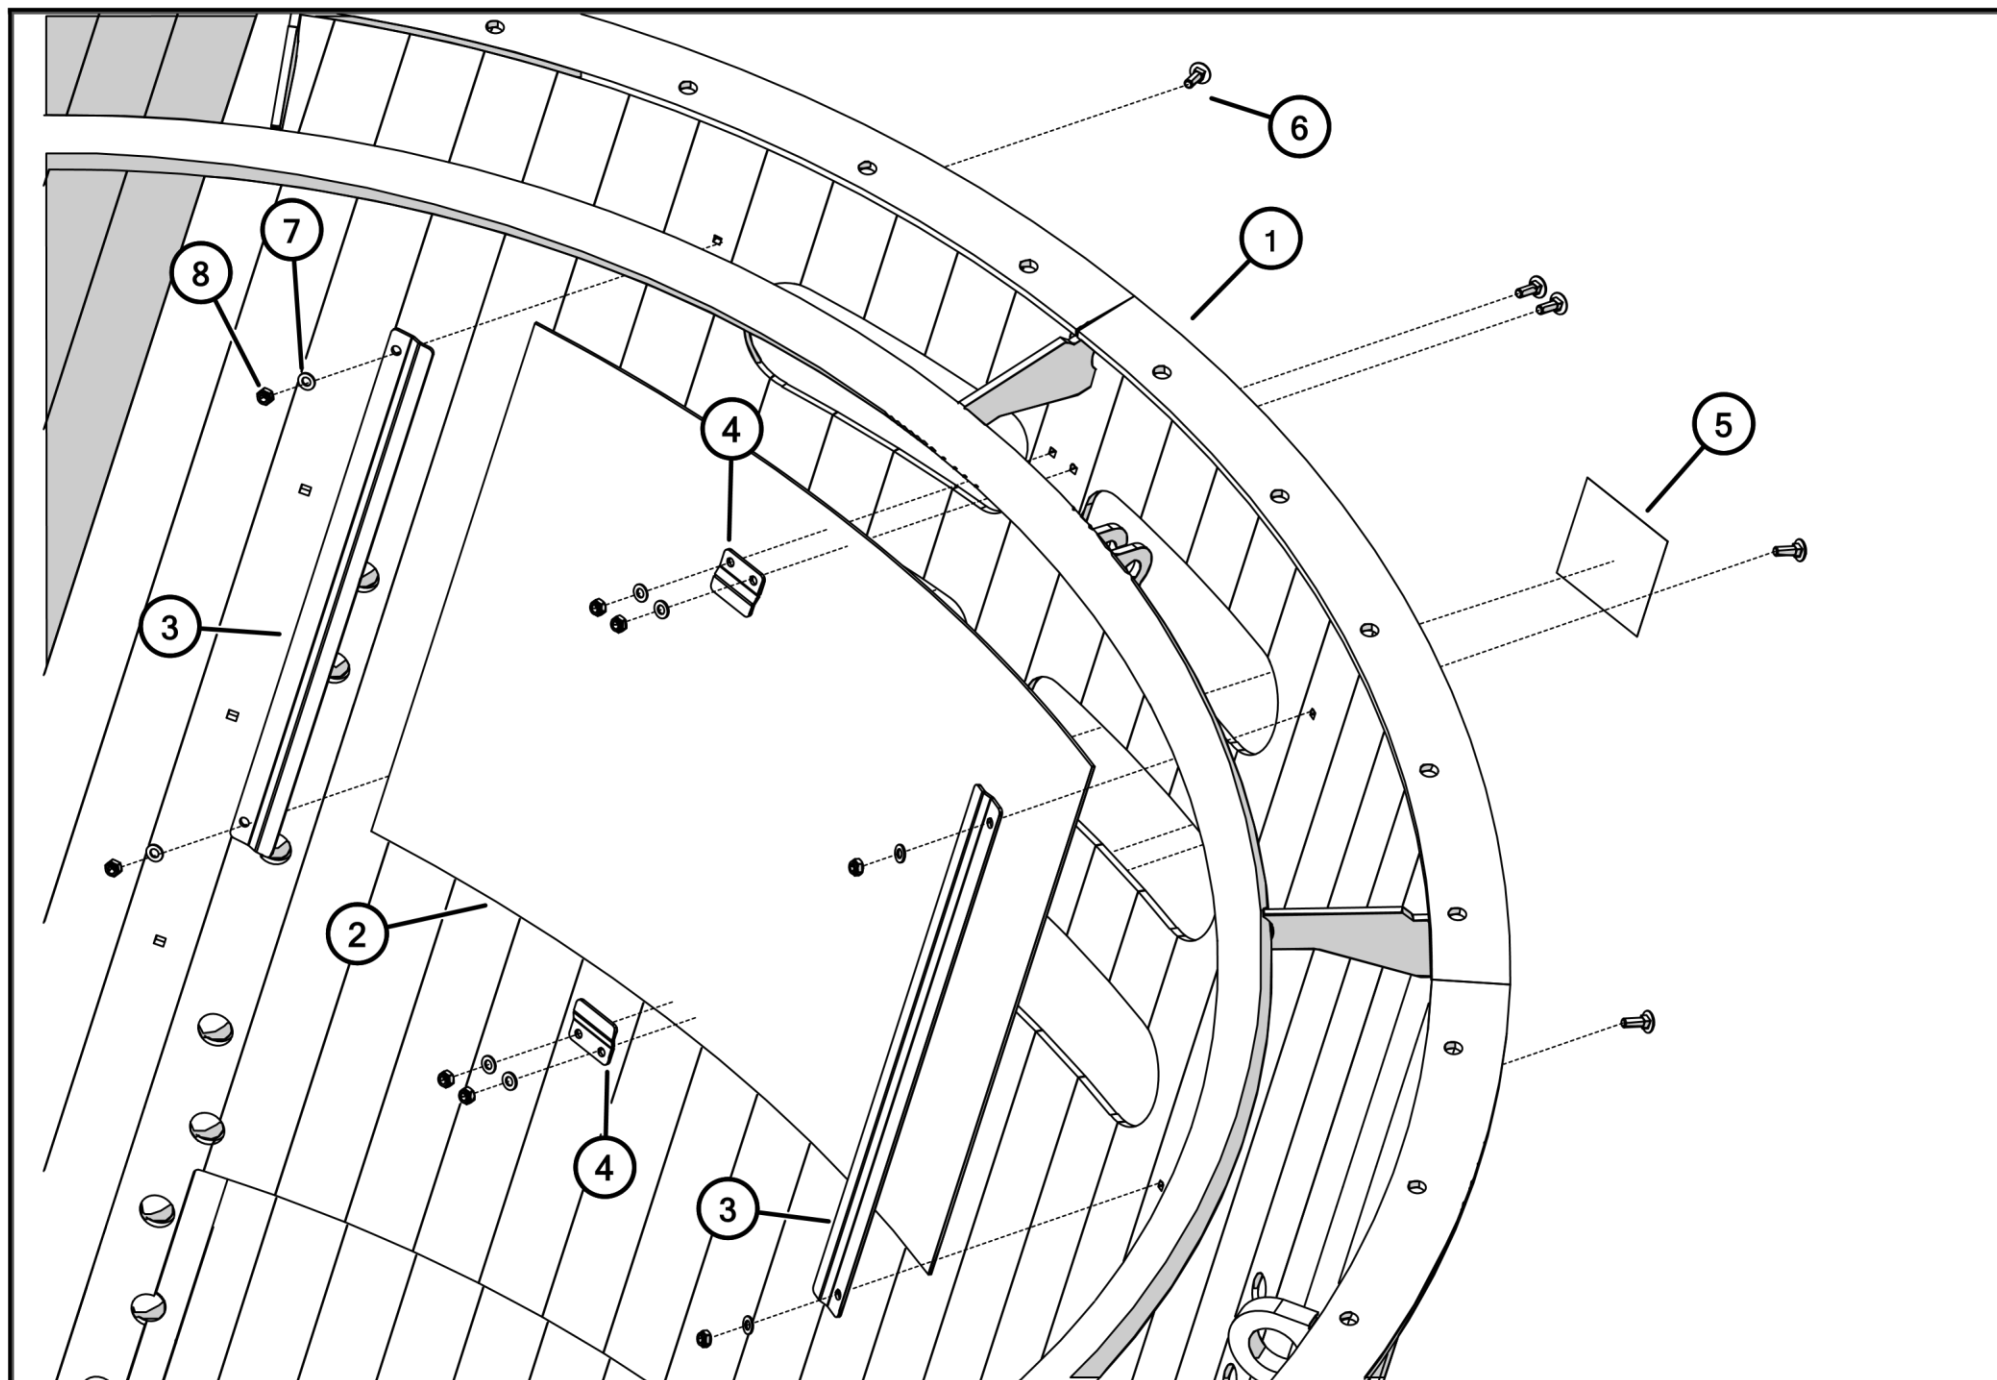

1.8. DISCHARGE WINDOW - FRONT


L.P.	DESCRIPTION	CODE	QUANTITY
1	Welded hopper FXX HD+ Bottom 2.55 Discharges 6 and 13	EM-011100	1
2	Front discharge flap Width 1.2 Bottom 2.55)	EM-008444	1
3	Hydraulic actuator UCJ458-50x28x700	110206	1
4	Short internal discharge guide (basket 8)	EM-000279	2
5	Short middle discharge guide (basket 8)	EM-000278	2
6	Spacer guide with right mounting	EM-000271	1
7	Spacer guide with left mounting	EM-000281	1
8	Short external discharge guide	EM-000277	2
9	Flanged screw M12x50-8.8 OC ISO 8677	112024K	24
10	Hex head screw M24x90-8.8 OC ISO 4014 NG	112083K	2
11	Washer 12 OC 200HV ISO 7089	112406K	24
12	Washer 24 OC 200HV ISO 7089	112416K	4
13	Self-locking nut M12 - 8 OC ISO 7040	112205K	24
14	Self-locking nut M24 - 8 OC ISO 7040	112211K	2

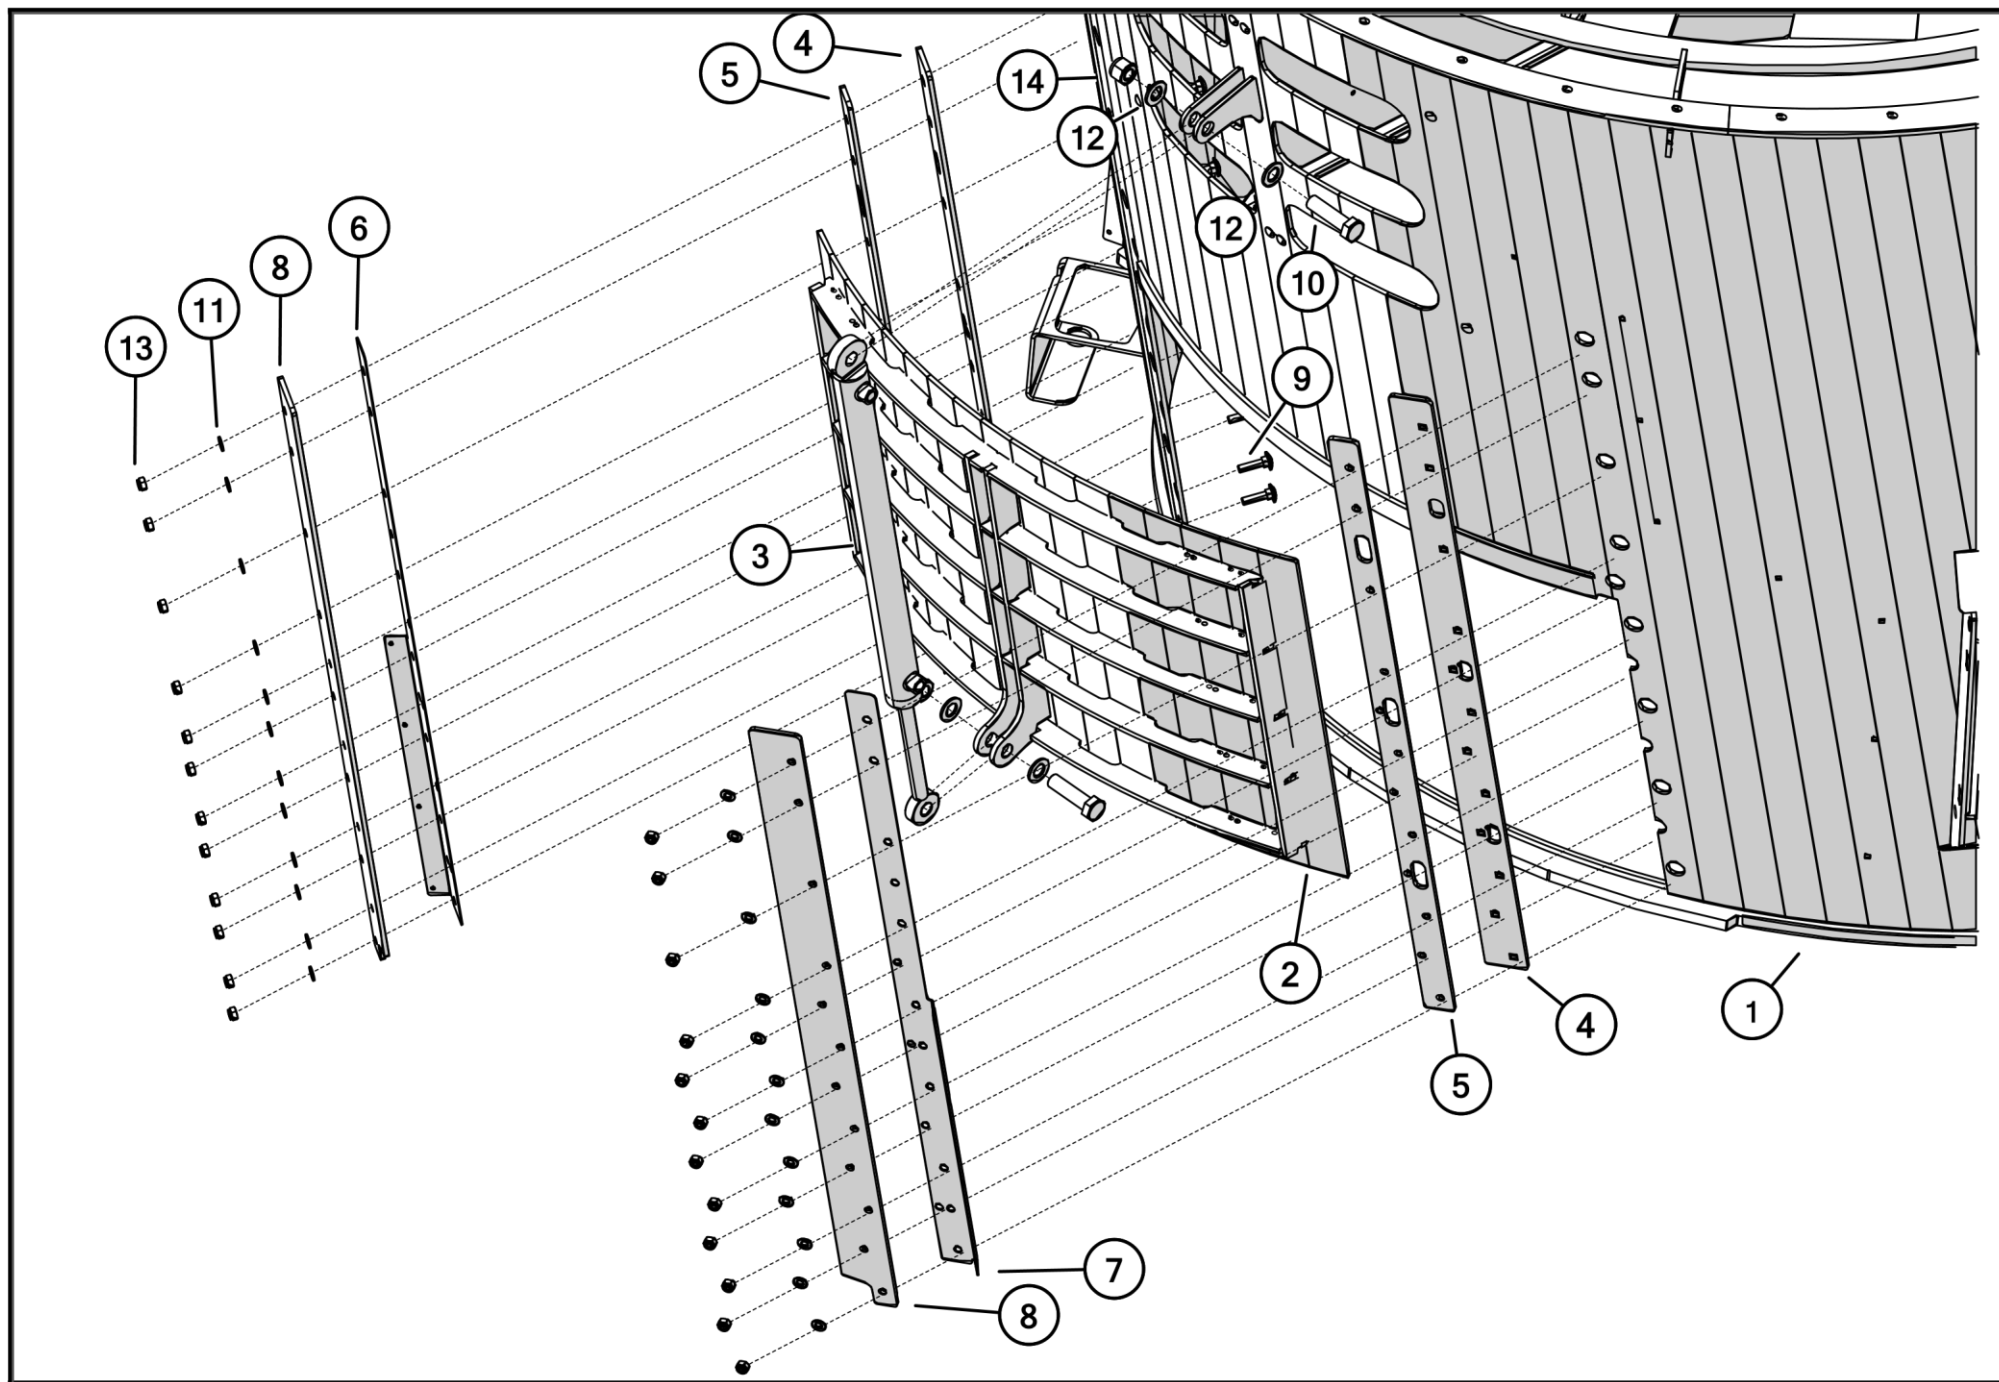

1.9. DISCHARGE WINDOW - REAR


1.9.1. ATTACHMENT TO THE CHAMBER

L.P.	DESCRIPTION	CODE	QUANTITY
1	Fully welded FXX HD+ basket Bottom 2.55 Discharges 6 and 13	EM-011100	1
2	Side discharge flap 0.9 m	EM-007567	1
3	Outer side discharge guide	EM-004870	2
4	Guide distance with fastening right	EM-000271	1
5	Guide rail distance with fastening left	EM-000281	1
6	Side sill	EM-009146	1
7	Side dump indicator strip front right	EM-011369	1
8	Side discharge tarpaulin mount right	EM-005207	1
9	Side discharge tarpaulin mount left	EM-005209	1
10	Side discharge arrow left	EM-011240	1
11	Shackle 6 mm to connect the chain	113509	1
12	Sump chain short OC 4 mm D-1 DIN 5685A	113501	1
13	Head bolt six. M6x25-8.8 OC ISO 4017 PG	112113K	2
14	Hex head bolt. M8x25-8.8 OC ISO 4017 PG	112037K	3
15	Bolt underscrew M12x50-8.8 OC ISO 8677	112024K	22
16	Washer 6 OC 200HV ISO 7089	112402K	4
17	Washer 8 Geomet 200HV ISO 7089	114403K	6
18	Washer 12 OC 200HV ISO 7089	112406K	22
19	Self-counter nut. M6 - 8 OC ISO 7040	112202K	2
20	Self-contricting nut. M8 - 8 OC ISO 7040	112203K	3
21	Self-contricting nut. M12 - 8 OC ISO 7040	112205K	22

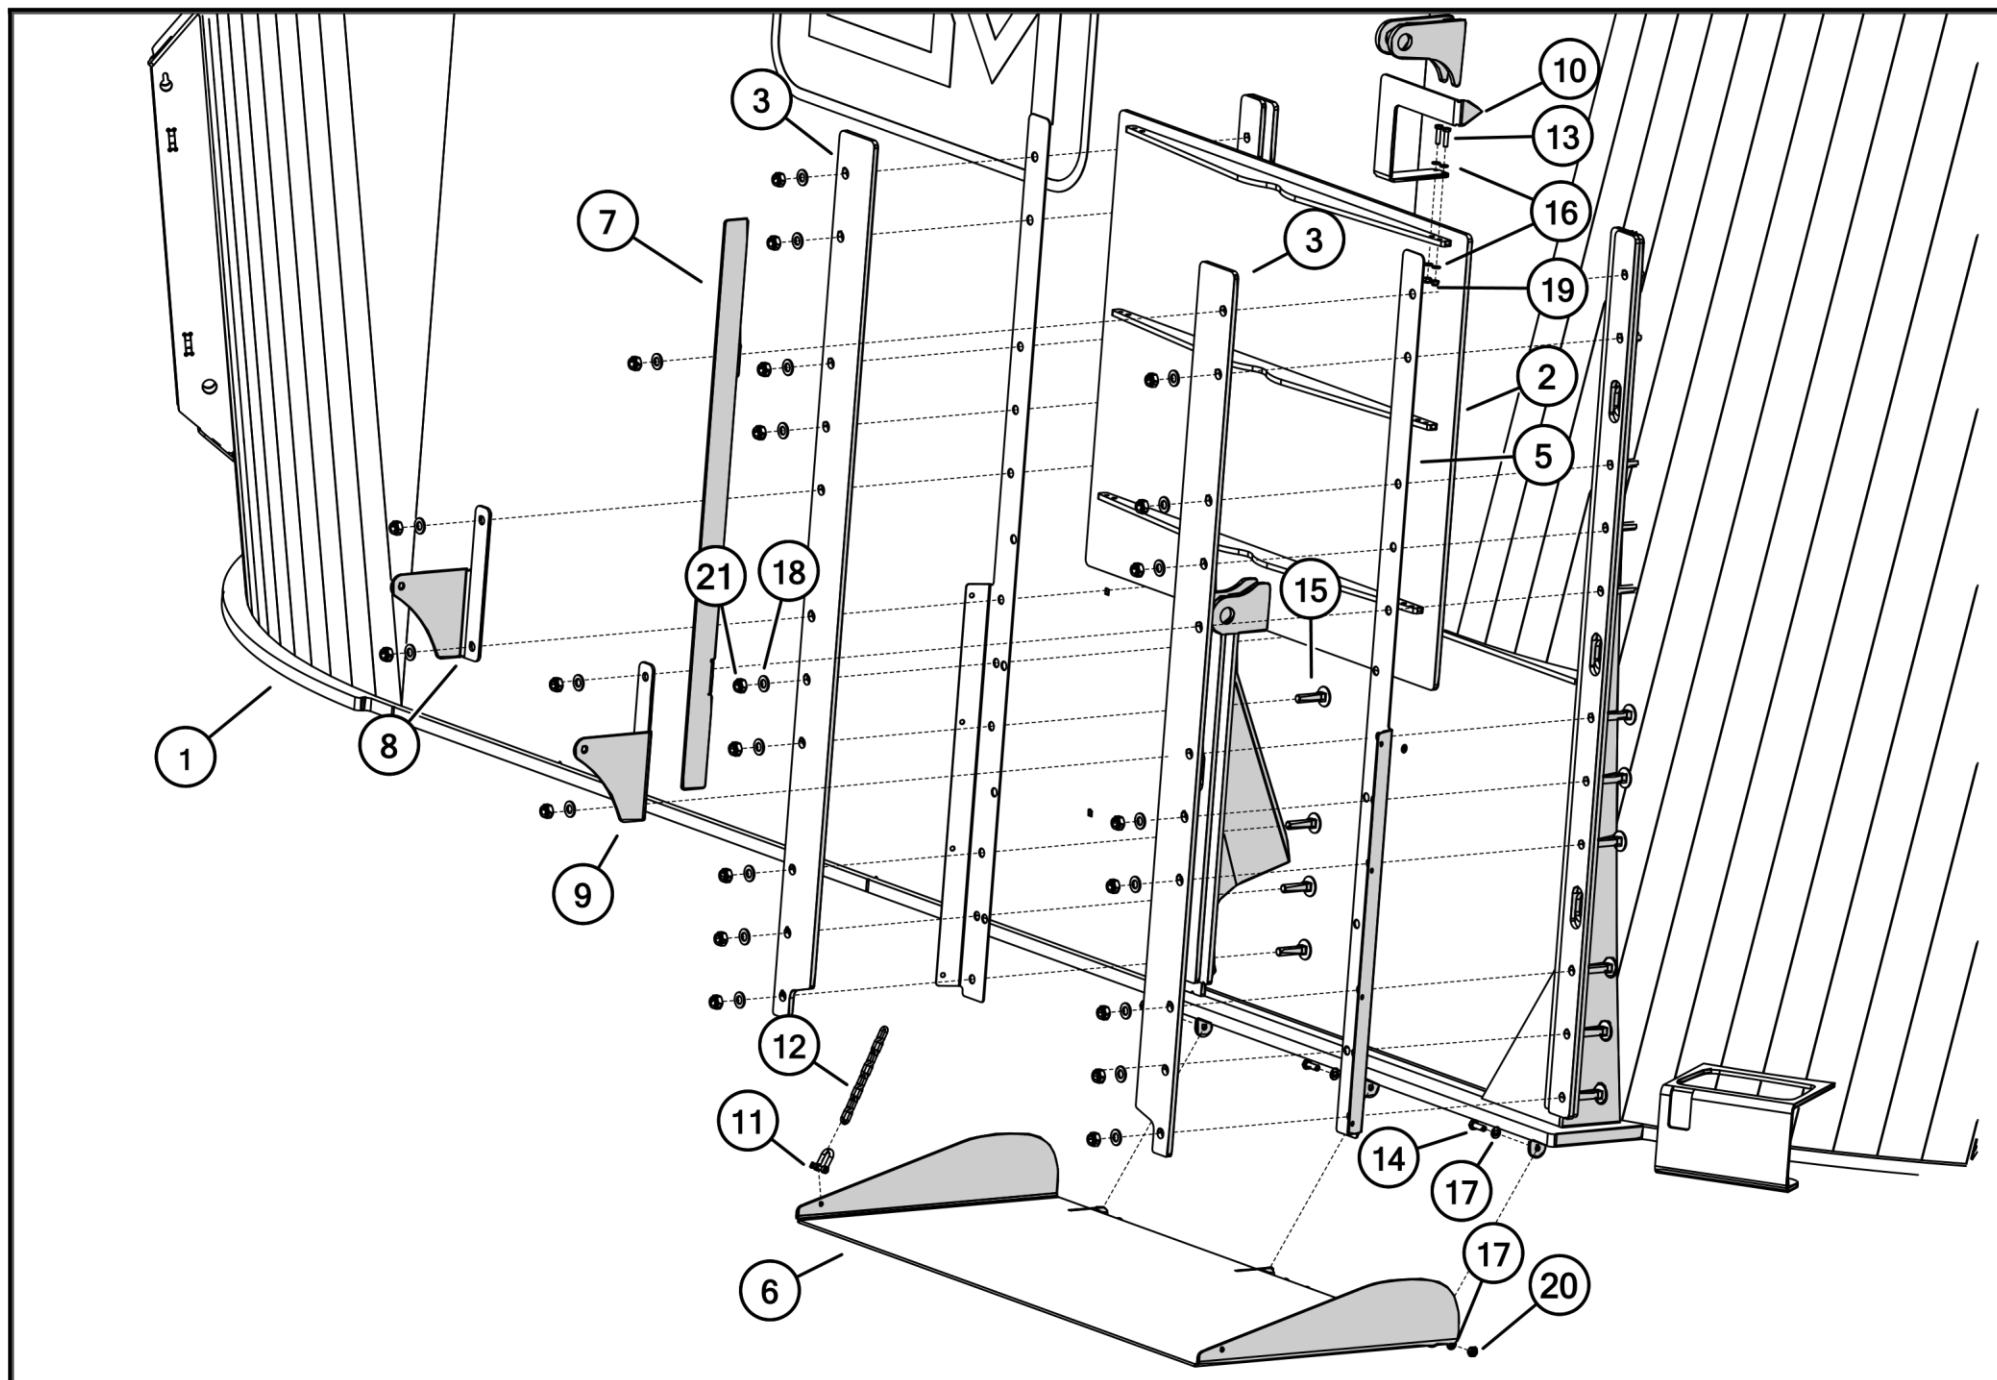


1.9.2. FIXING OF THE TARPAULIN

L.P.	DESCRIPTION	CODE	QUANTITY
1	Welded basket FXX HD+ Bottom 2,55 Discharges 6 and 13	EM-011100	1
2	Side hopper cover right	EM-005207	1
3	Tarpaulin cover mount left	EM-005209	1
4	Hydraulic cylinder UCJ458-50x28x700	110206	1
5	Cylinder lock plate	EM-007368	1
6	Claw pressure	EM-000459	2
7	Side dumping body	EM-005143	1
8	Lateral discharge tarpaulin clamp	EM-005227	1
9	Side discharge tarpaulin	150601	1
10	Six head bolt. M6x20-8.8 OC ISO 4017 PG	112033K	8
11	Jackscrew M6x20-8.8 OC ISO 8677	112002K	11
12	Hex head bolt. M6x25-8.8 OC ISO 4017 PG	112113K	2
13	Hex head bolt. M10x30-8.8 OC ISO 4017 PG	112047	2
14	Screw with six head. M24x120-12.9 OC ISO 4014 NG	112154	2
15	Washer 6 OC 200HV ISO 7089	112402K	29
16	Enlarged washer 6 OC 200HV ISO 7093	114430	2
17	Washer 10 OC 200HV ISO 7089	112404K	4
18	Washer 24 OC 200HV ISO 7089	112416K	4
19	Self-contained nut. M6 - 8 OC ISO 7040	112202K	21
20	Self-contained nut. M10 - 8 OC ISO 7040	112204K	2
21	Self-contricting nut. M24 - 8 OC ISO 7040	112211K	2
22	Hex nut M24 - 8 black ISO 4032	112246K	2

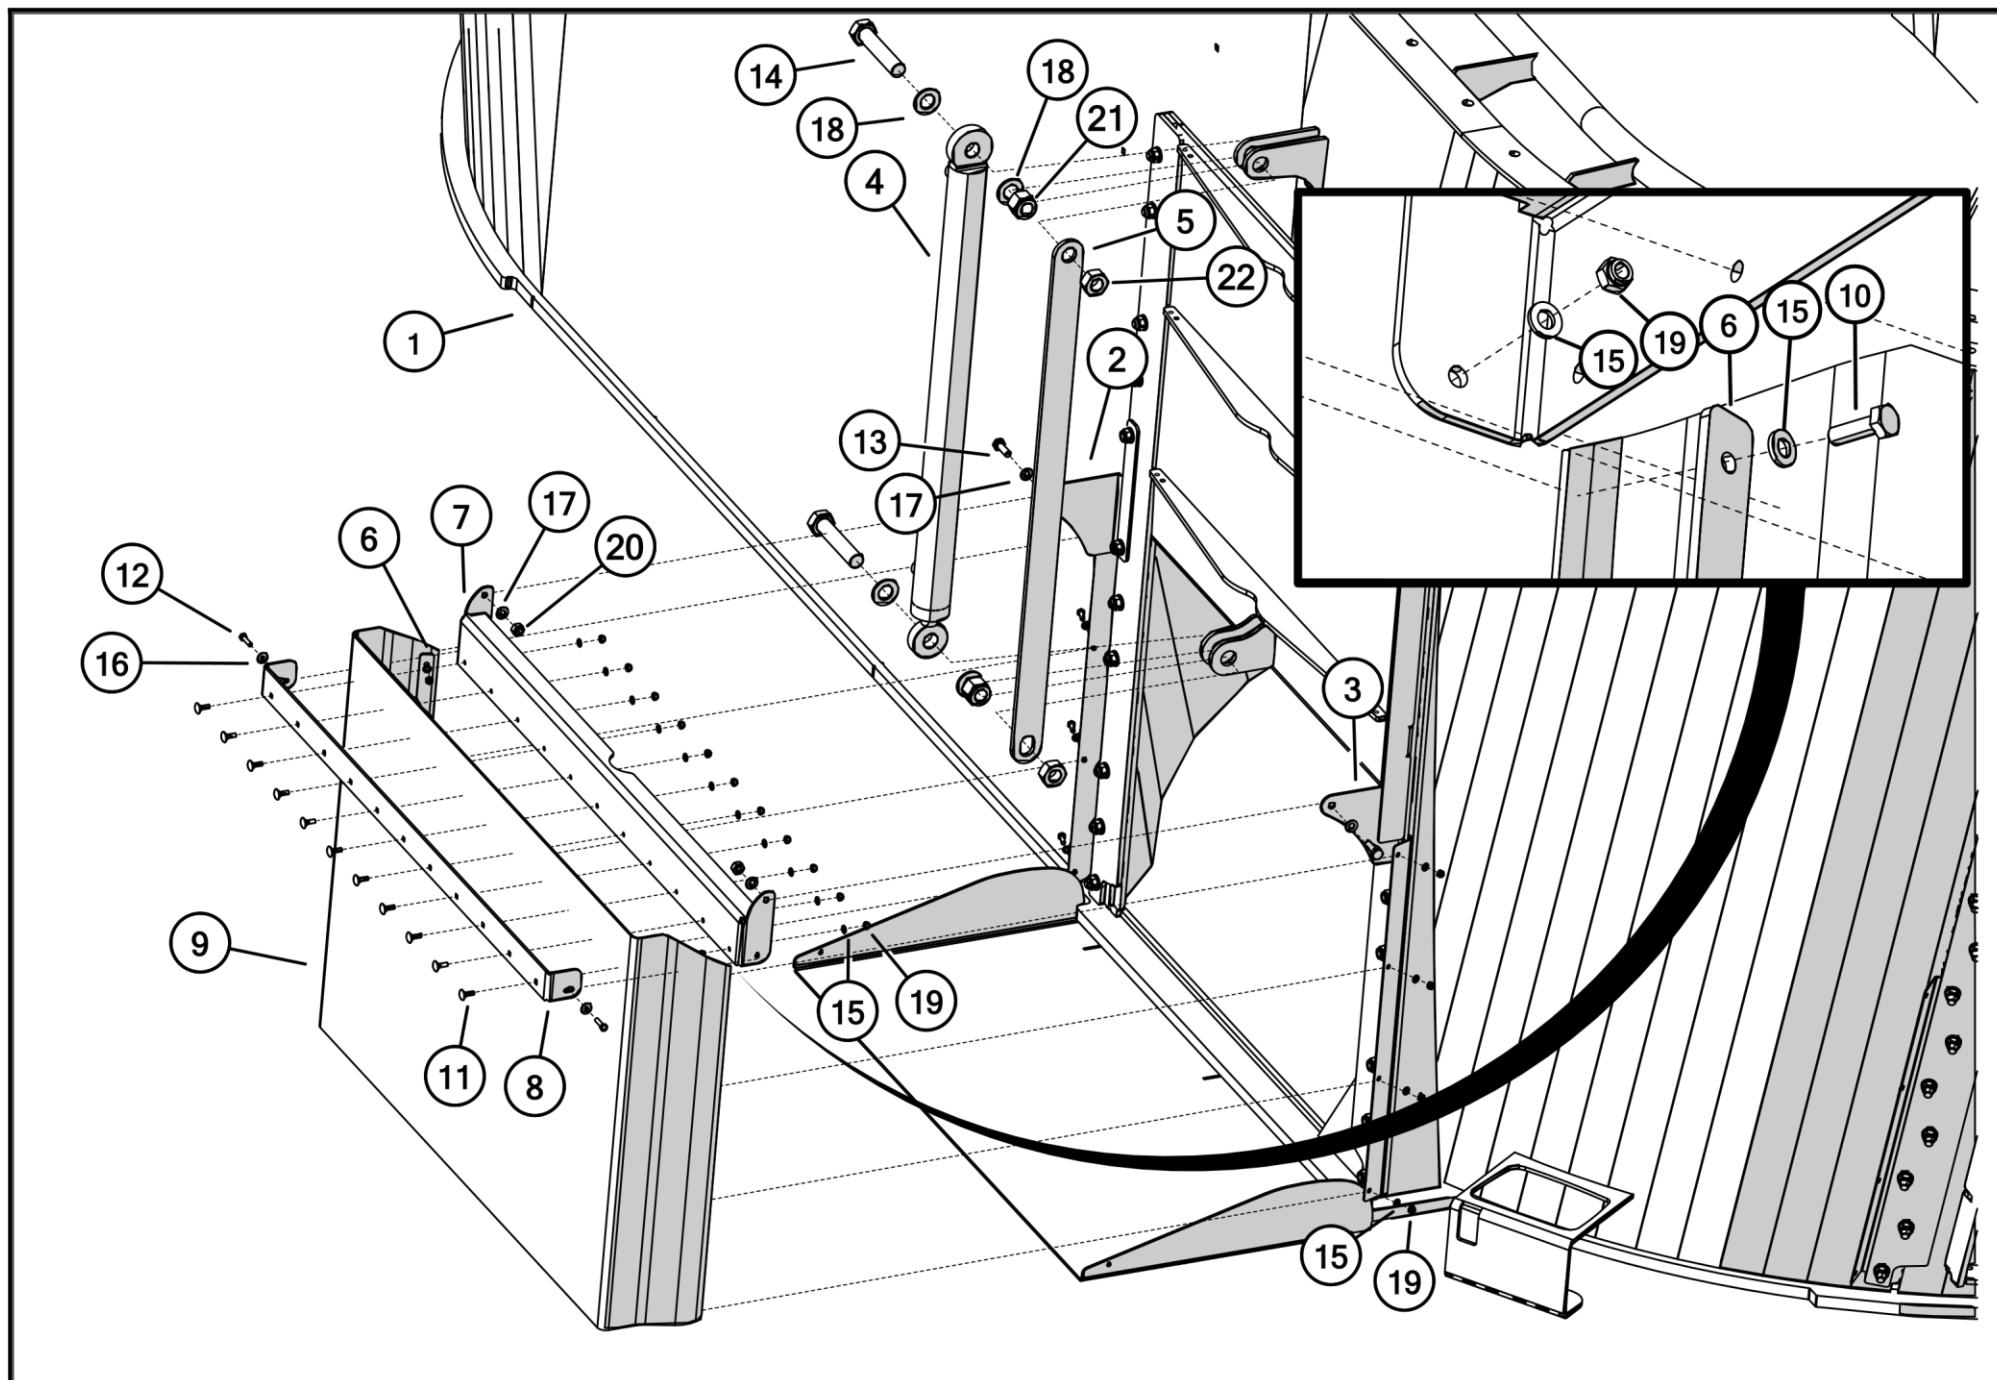

1.10. AUGER


L.P.	DESCRIPTION	CODE	QUANTITY
1	Welded Auger Bottom 2,55 20 Pawl	EM-002758	1
2	HD auger scraper knife	EM-005366	1
3	HD auger foot scraper knife	EM-005368	1
4	Skid pad for the first pressing	EM-000177	1
5	Feeder wagon knife small 90047 Fontana	110655	4
6	Feeder wagon knife 90032.21.01 PT Fontana / mws	115011	5
7	Knife pad small raw	EM-000176	4
8	Knife pad	EM-000161	5
9	SEKO star knife 90035.00.00 Fontana	300031	15
10	Subbolt M10x35-8.8 OC ISO 8677	112010K	15
11	Subbolt M10x40-8.8 OC ISO 8677	112011K	5
12	Six head bolt. M16x45-8.8 OC ISO 4017 PG	112072K	10
13	Bolt with undersink M16x65-8.8 OC NG ISO 8677	112021K	3
14	Bolt with undersink M16x70-8.8 OC NG ISO 8677	112026K	27
15	Washer 10 OC 200HV ISO 7089	112404K	20
16	Washer 16 OC 200HV ISO 7089	112410K	30
17	Washer 16 OC 200HV ISO 7093	112422K	10
18	Self-contained nut. M10 - 8 OC ISO 7040	112204K	20
19	Self-constricting nut. M16 - 8 OC ISO 7041	112207K	40

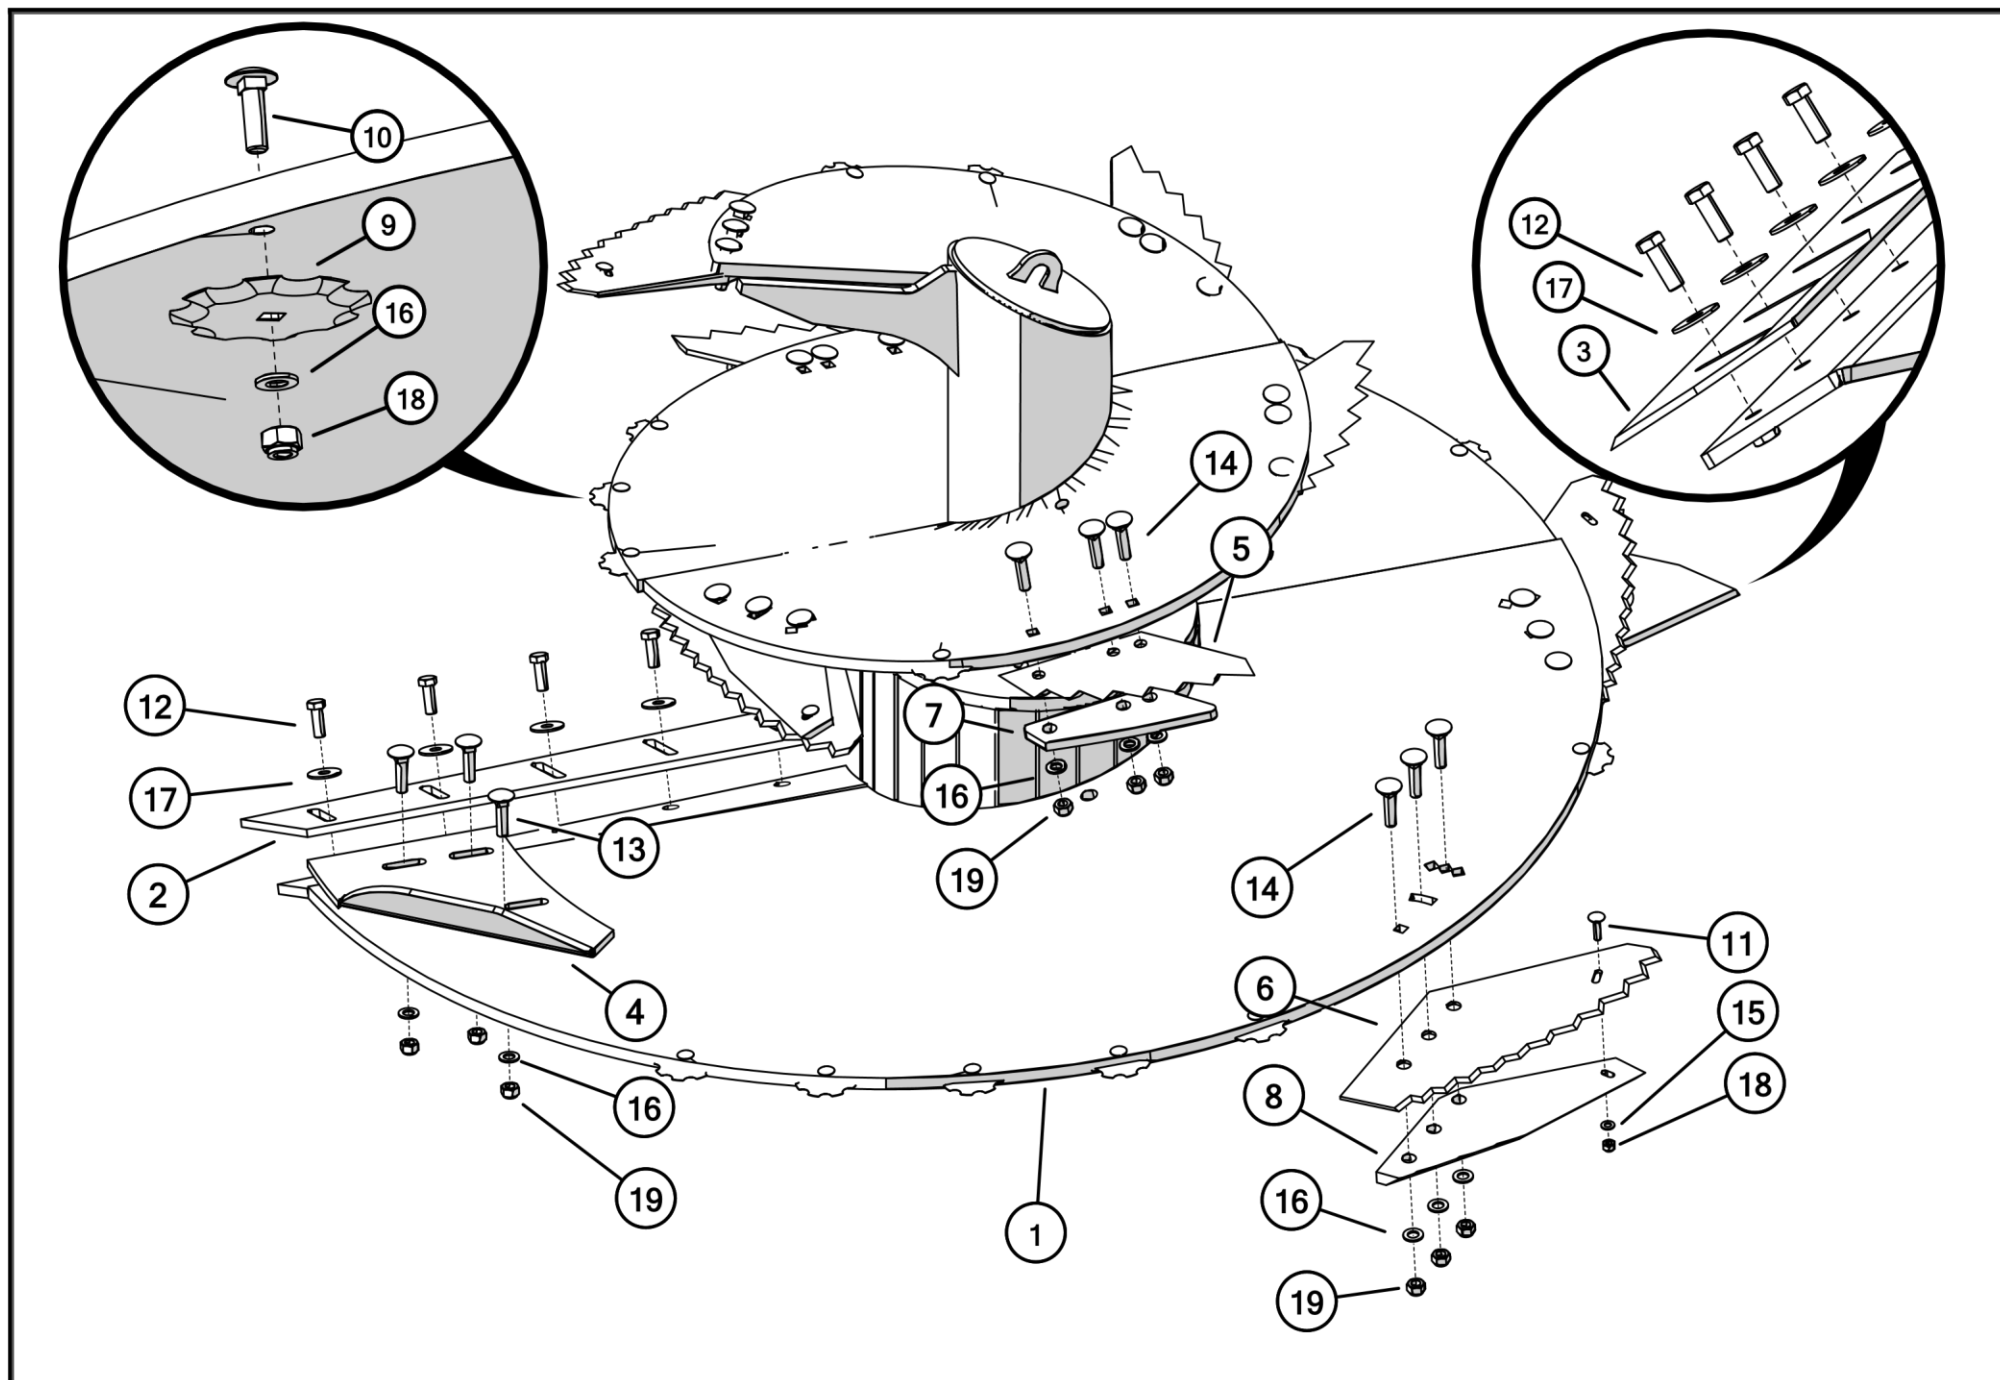

1.11. AUGER DRIVE UNIT


1.11.1. WOM SHAFT AND GEARBOX HOUSING

L.P.	DESCRIPTION	CODE	QUANTITY
1	C3A two-speed transmission	110022	1
2	B.P shaft 1240Nm L=1210,3500Nm CVJ 1.3/8 Z6-1.3/4Z20	115160	1
3	PTO shaft cover	110013	1
4	Gearbox housing lower	EM-000981	1
5	Top left gearbox housing	EM-000982	1
6	Top right gearbox housing	EM-000983	1
7	Head bolt six. M8x30-8.8 OC ISO 4017 PG	112038K	4
8	Hex head bolt. M10x35-8.8 OC ISO 4017 PG	112048K	9
9	Enlarged washer 8 OC 200HV ISO 7093	112421K	4
10	Enlarged washer 10 OC 200HV ISO 7093	112405K	9

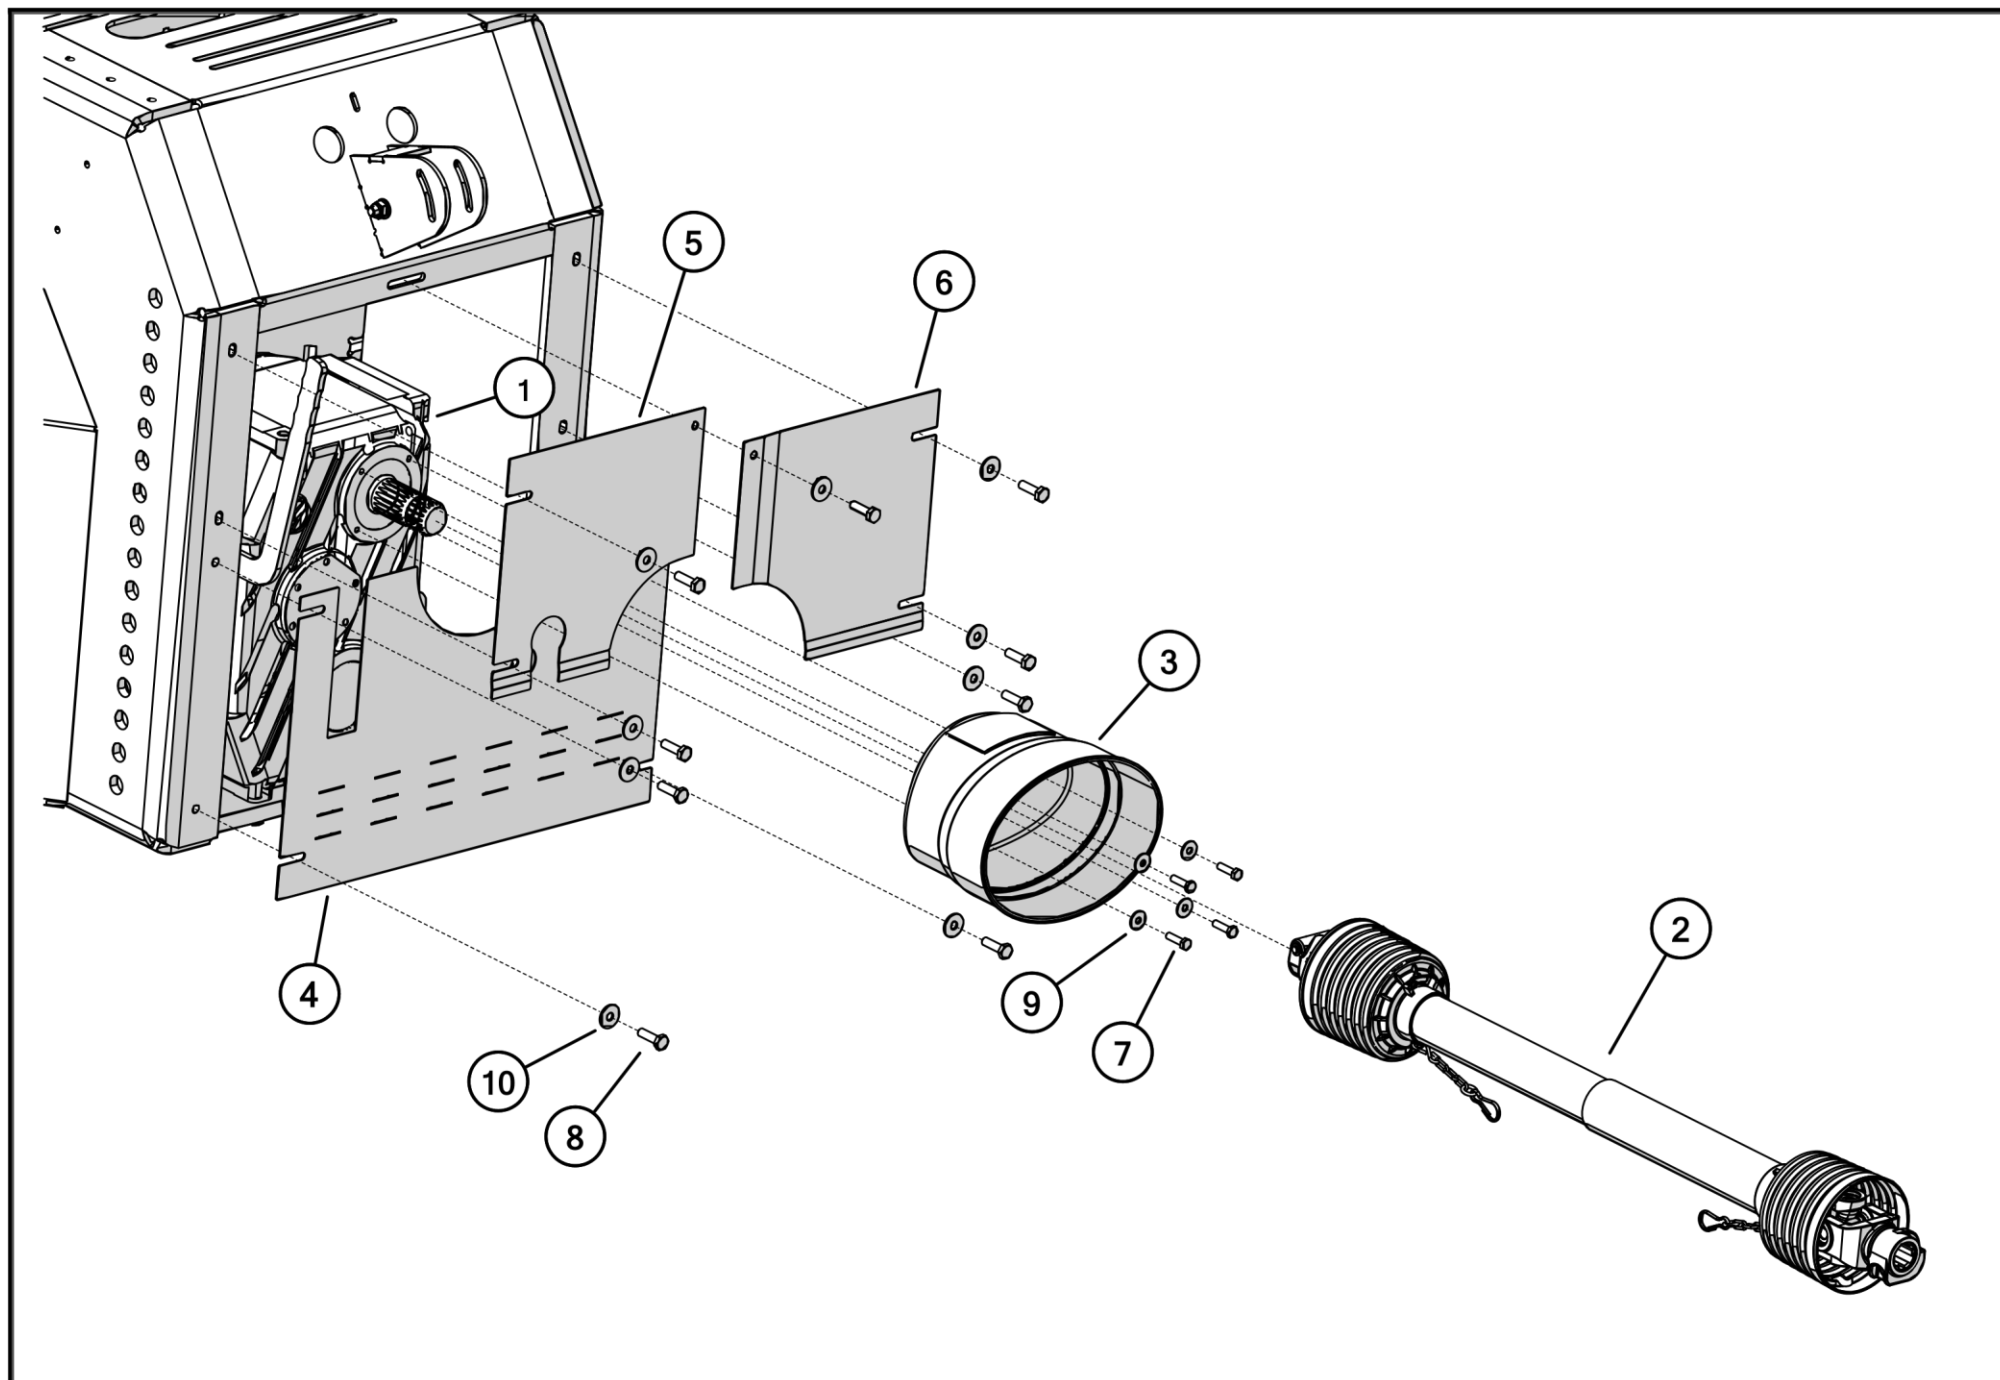


1.11.2. TWO-SPEED TRANSMISSION

L.P.	DESCRIPTION	CODE	QUANTITY
1	C3A quick ratio gearbox	110022	1
2	Shaft B.P 1240Nm L=1410mm 1.3/4 Z20 - 1.3/4 Z20	110807	1
3	Cable distributor for 4 sensors	110255	1
4	C3A gearbox lever	EM-008674	1
5	Six head screw. M8x30-8.8 OC ISO 4017 PG	112038K	2
6	Hex head bolt. M16x50-8.8 Geomet ISO 4014 NG	114073K	4
7	Nord Lock washer 16 enlarged 17x30.7x3.4 DIN 25201	112562	8
8	Washer 8 OC 200HV ISO 7089	112403K	4
9	Self-locking nut. M8 - 8 OC ISO 7040	112203K	2

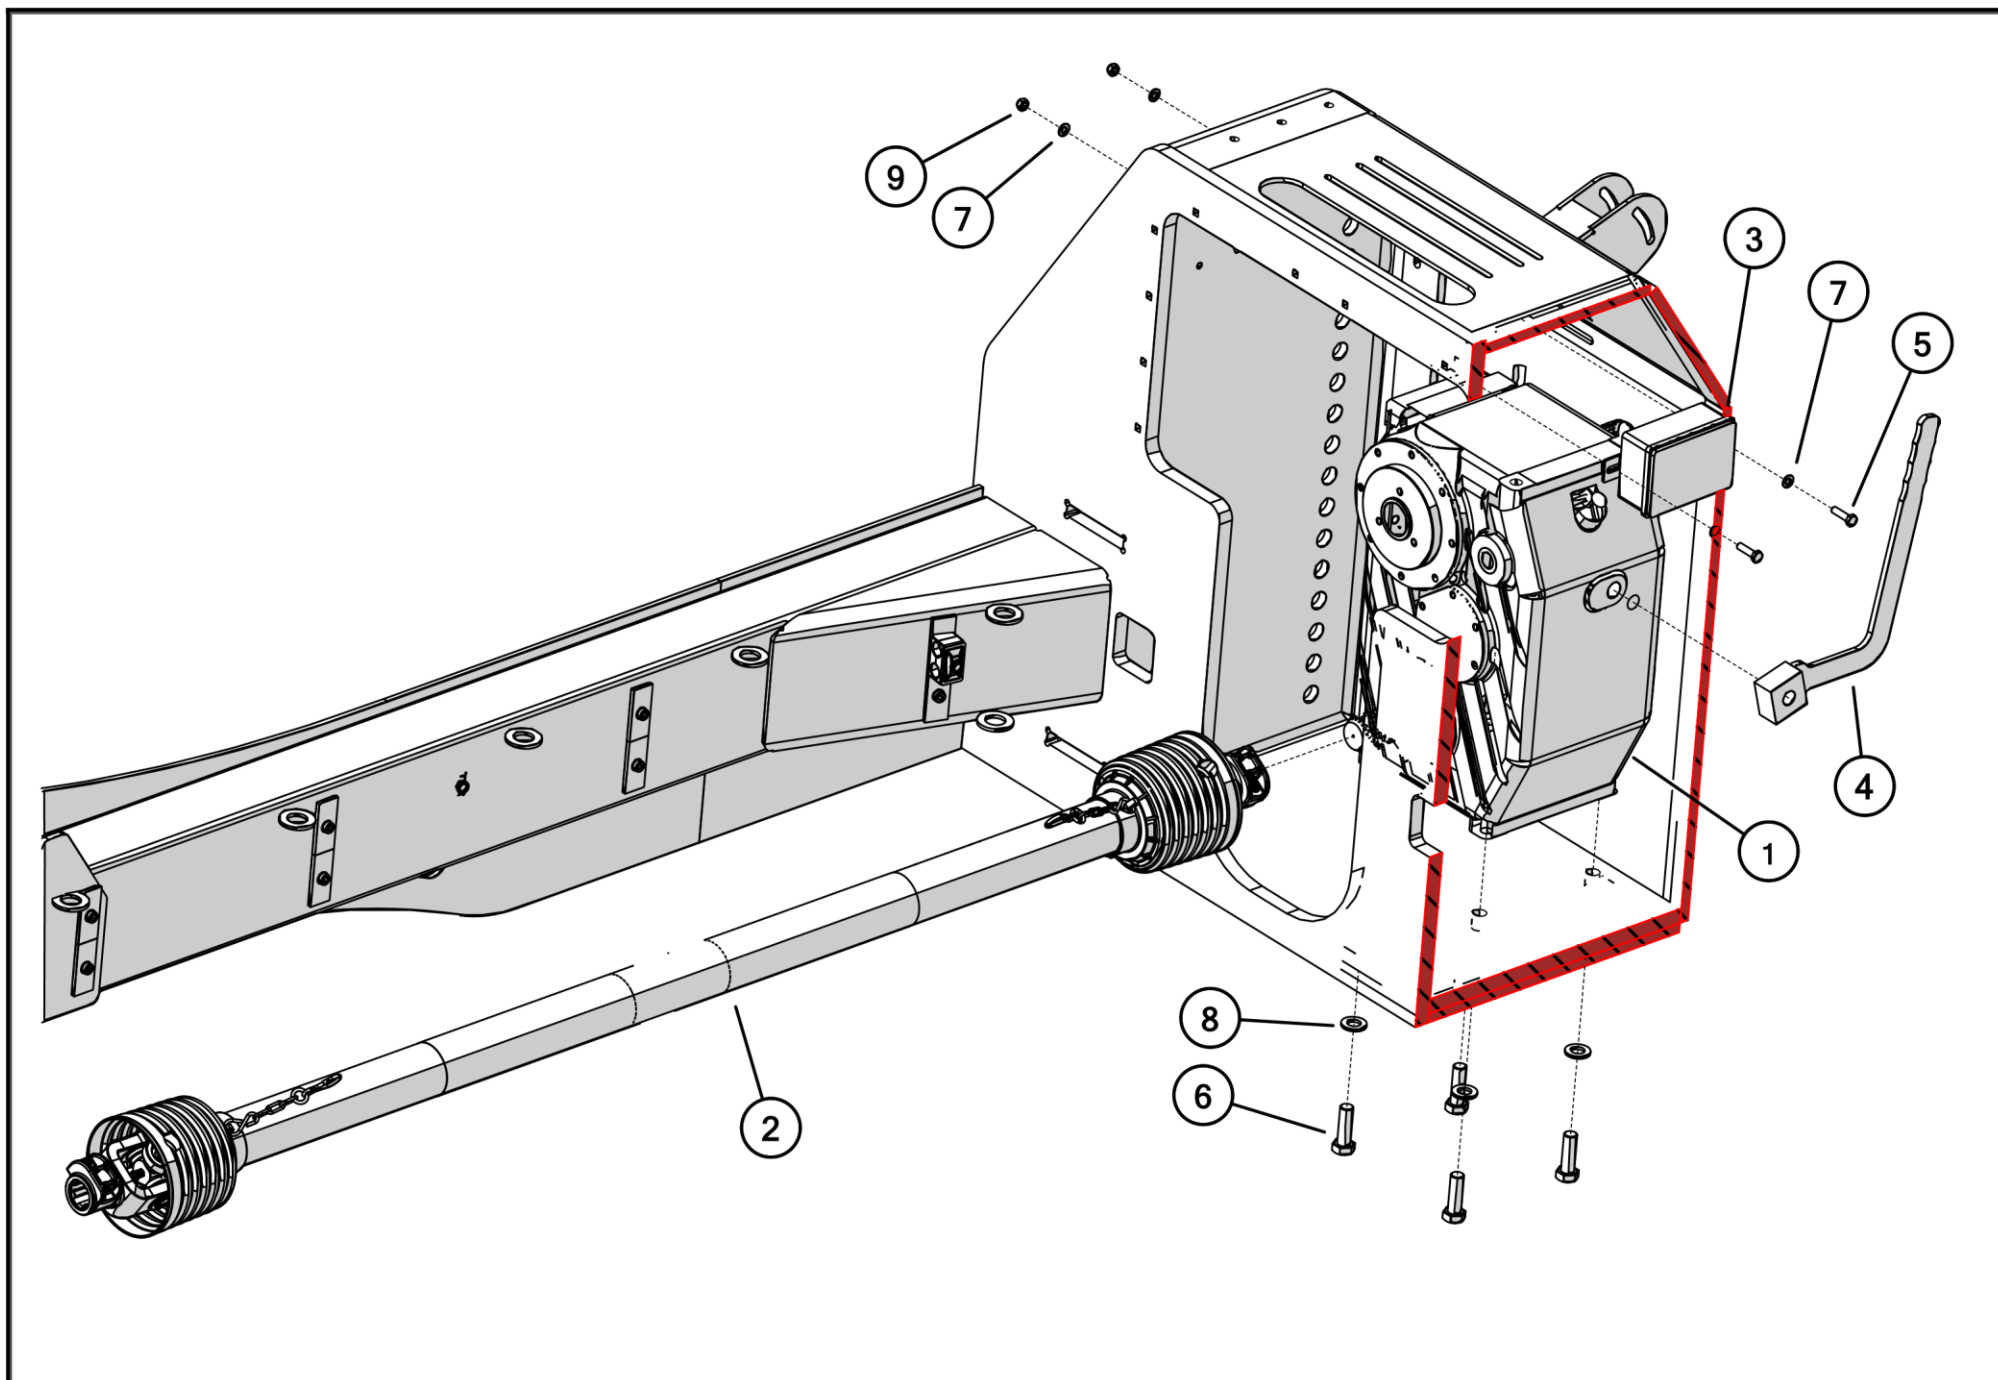


1.11.3. FRONT AUGER

L.P.	DESCRIPTION	CODE	QUANTITY
1	Welded basket FXX HD+ Bottom 2,55 Outlets 6 and 13	EM-011100	1
2	FXX HD+ auger Bottom 2,55 20	EM-010990	1
3	Shaft B.P 1240Nm L=1410mm 1.3/4 Z20 - 1.3/4 Z20	110807	2
4	Gearbox 4350-5717.004.8543 (2 shafts/free)	110012	1
5	Gearbox expansion tank	110441	1
6	Oil hose Fi=20 L=1500	110448	1
7	Oil hose Fi=8 L=2200	110449	1
8	DKR-90 DN20 G3/4 COMPACT fitting	110418	1
9	Coupling G3/4-G1/2	1110444	1
10	Gasket with rubber insert 21.54x28.58x2.5 - G1/2	110467	1
11	Worm clamp 20/32 W2 DIN 3017	113517K	2
12	Worm clamp 10/16 W2 DIN 3017	113519K	2
13	Hex head bolt. M16x80-8.8 OC ISO 4017 PG	112076	15
14	Hex head bolt. M16x1.5x100-10.9 OC ISO 4014 NG	112069K	12
15	Washer 16 Geomet 200HV ISO 7089	114407K	54
16	Self-contained nut. M16x1.5 - 8 OC ISO 7040	112208K	27

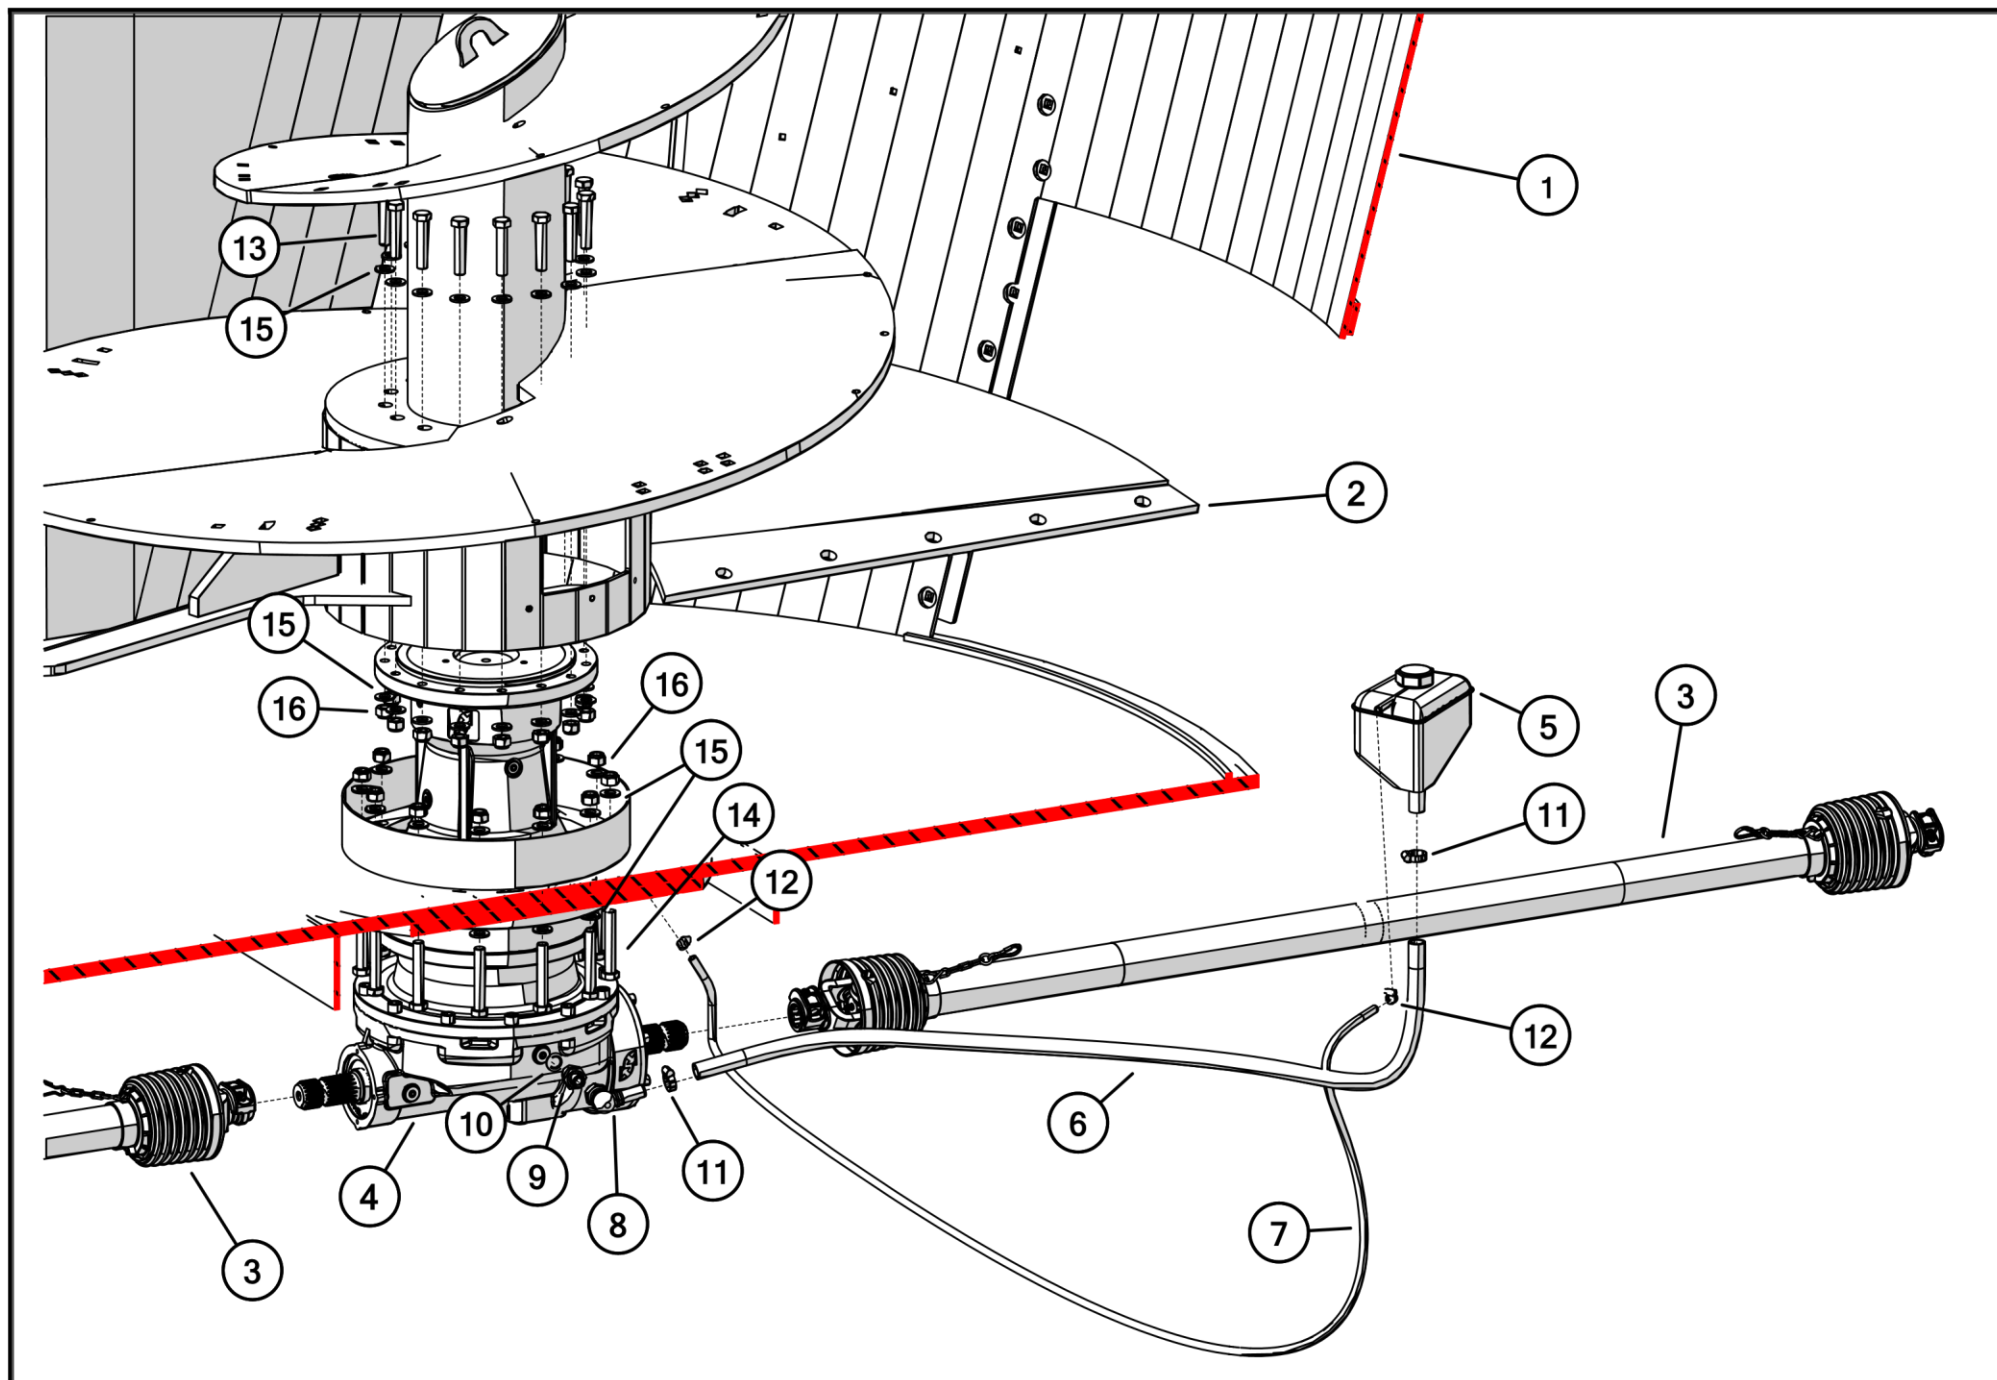

1.11.4. REAR AUGER


L.P.	DESCRIPTION	CODE	QUANTITY
1	Welded basket FXX HD+ Bottom 2,55 Outlets 6 and 13	EM-011100	1
2	FXX HD+ auger Bottom 2,55 20	EM-010990	1
3	Shaft B.P 1240Nm L=1410mm 1.3/4 Z20 - 1.3/4 Z20	110807	1
4	Gear 4350-5717.000.8581 (FXX-1 shaft) - free	110010	1
5	Gearbox compensation tank	110441	1
6	Oil hose Fi=20 L=1500	110448	1
7	Oil hose Fi=8 L=2200	110449	1
8	DKR-90 DN20 G3/4 COMPACT fitting	110418	1
9	Coupling G3/4-G1/2	1110444	1
10	Gasket with rubber insert 21.54x28.58x2.5 - G1/2	110467	1
11	Worm clamp 20/32 W2 DIN 3017	113517K	2
12	Worm clamp 10/16 W2 DIN 3017	113519K	2
13	Hex head bolt. M16x80-8.8 OC ISO 4017 PG	112076	15
14	Hex head bolt. M16x1.5x100-10.9 OC ISO 4014 NG	112069K	12
15	Washer 16 Geomet 200HV ISO 7089	114407K	54
16	Self-contained nut. M16x1.5 - 8 OC ISO 7040	112208K	27

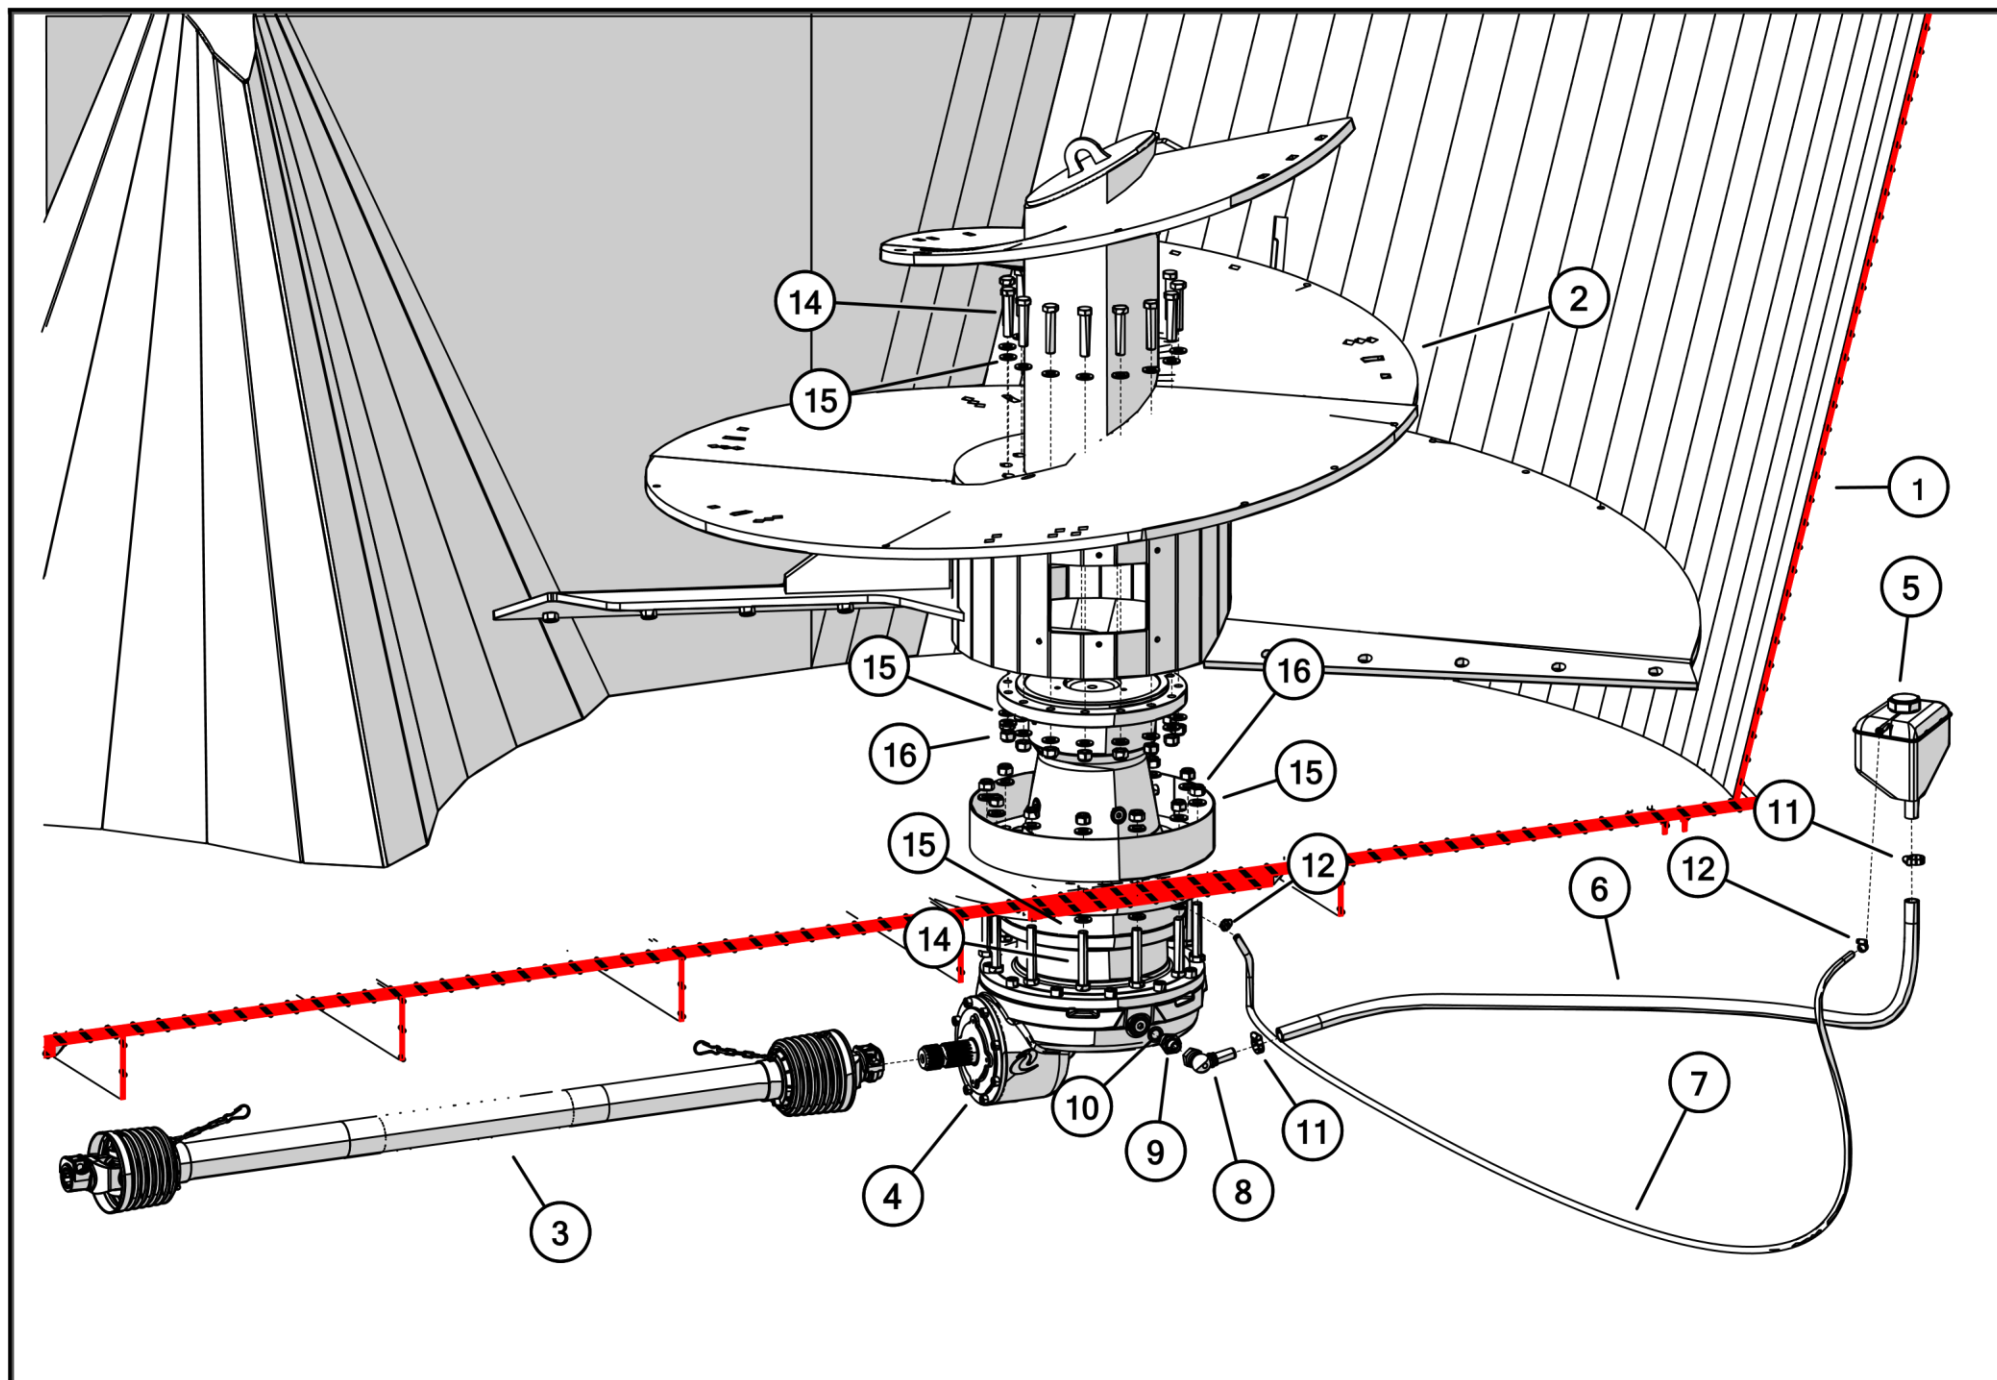

1.12. BELT WITH HOUSING


1.12.1. ATTACHMENT TO THE BASKET

L.P.	DESCRIPTION	CODE	QUANTITY
1	Welded FXX HD+ garbage can Bottom 2.55 Discharges 6 and 13	EM-011100	1
2	2500x900 strap with build-up	EM-005615	1
3	Screw with head six. M16x1.5x140-10.9 OC ISO 4014 NG	112568	2
4	Hex head bolt. M18x40-10.9 OC ISO 4017 PG	112140K	12
5	Washer 16 OC 200HV ISO 7089	112410	4
6	Enlarged washer 16 OC 200HV ISO 7093	112422K	16
7	Hex nut M16 - 8 OC ISO 4032	112237K	6

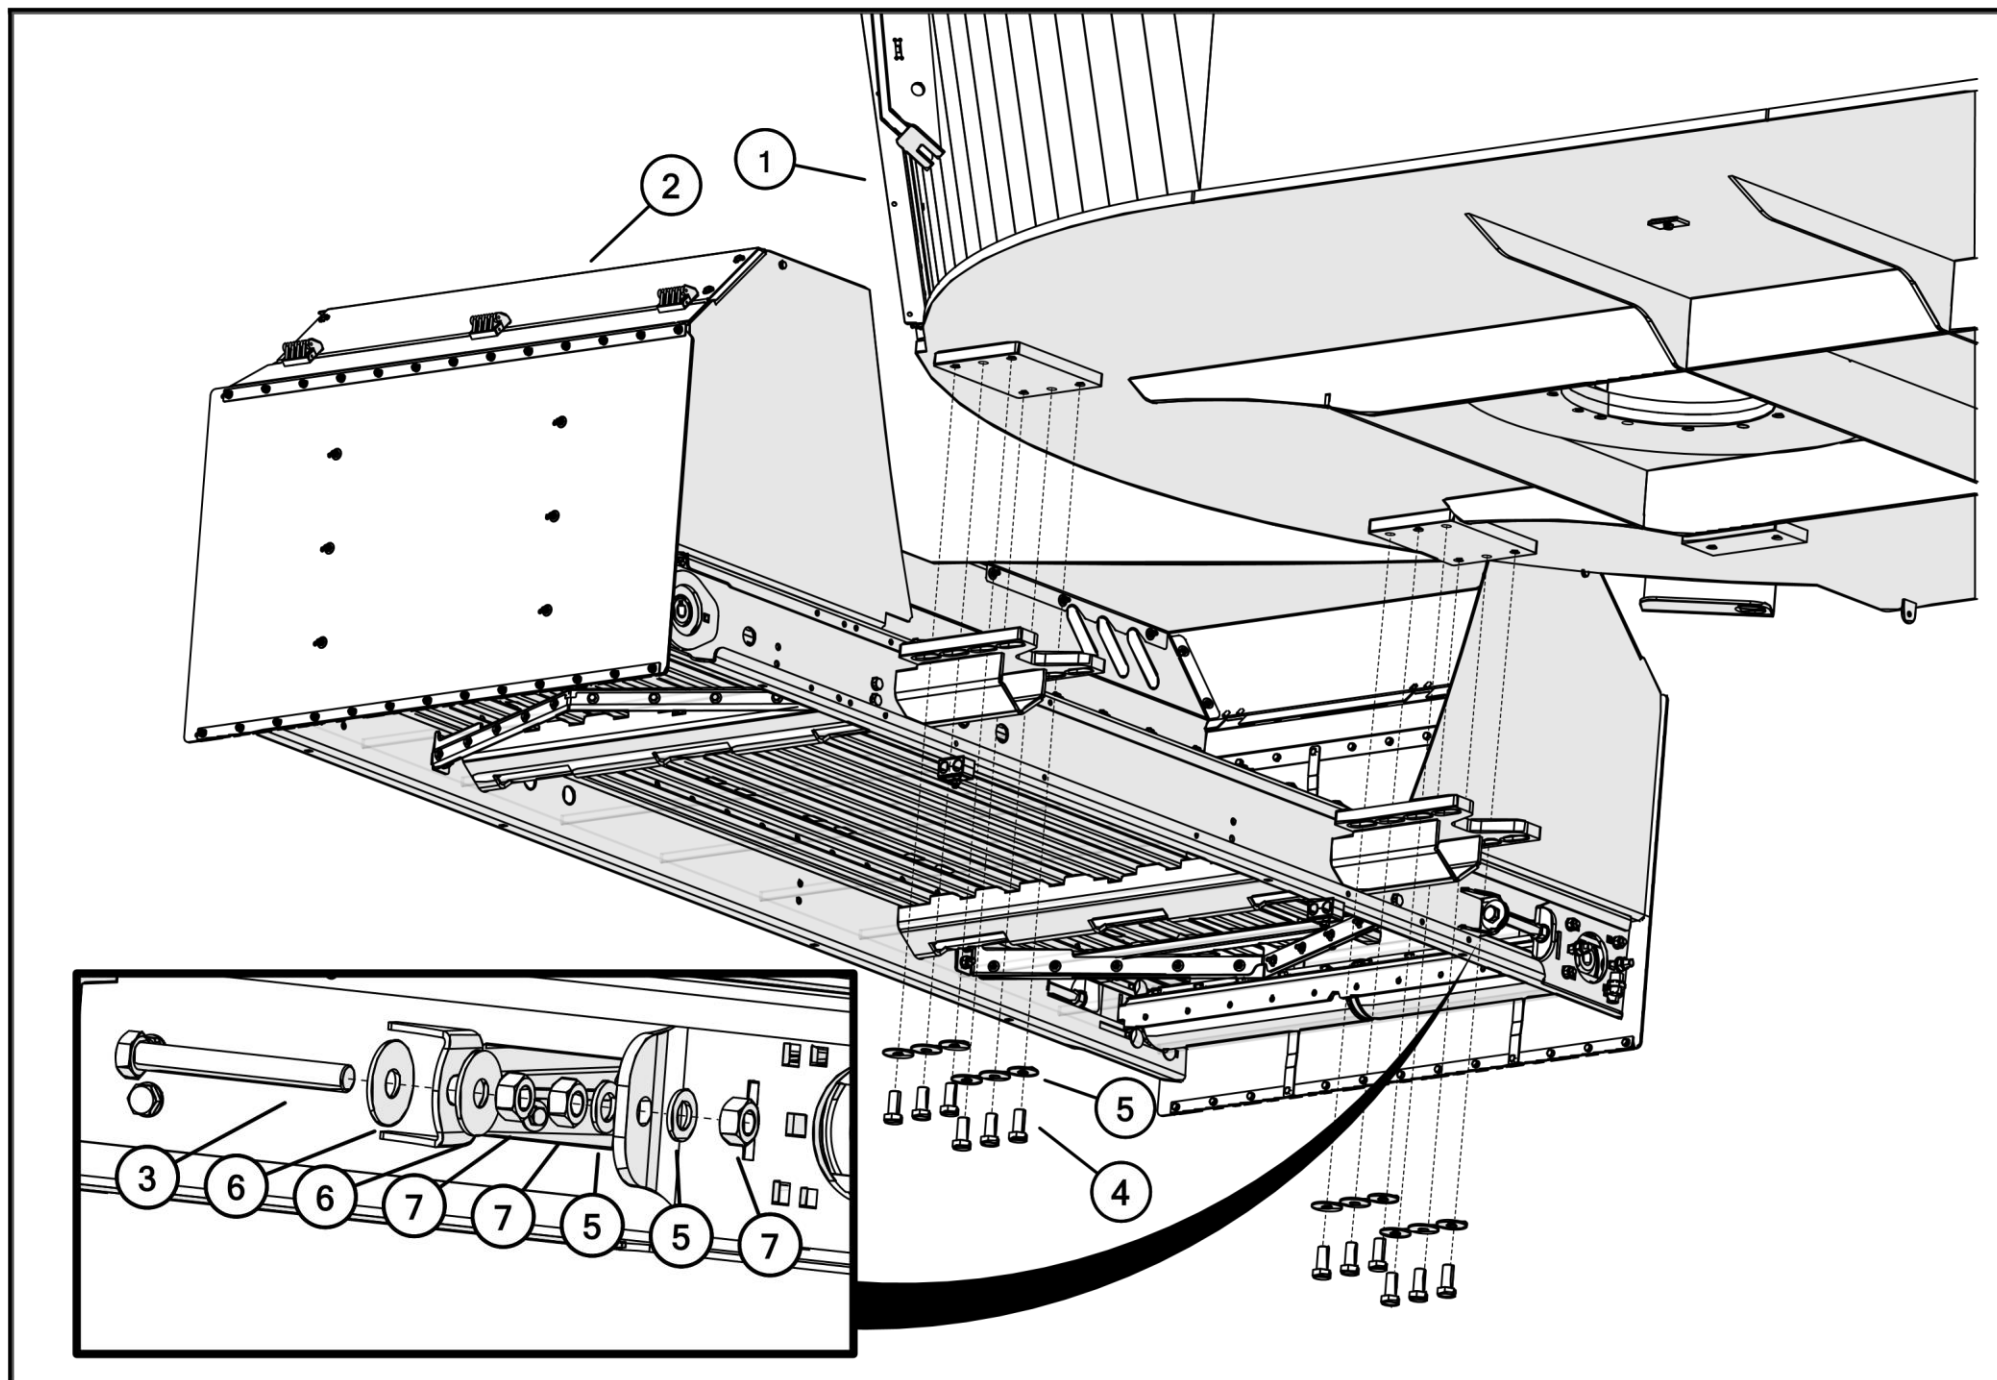


1.12.2. BELT FRAME

L.P.	DESCRIPTION	CODE	QUANTITY
1	Tape frame 2500x900 window 1.2 m	EM-005616	1
2	Tape P22-11 of 4940 x 900, T20 takers (2500x900)	110910	1
3	Belt roller 900 - under the hydromotor	EM-002480	2
4	Belt slide 900	EM-002478	1
5	MOTOR Gopart BMRY-80 P41 AIIY10-T10- RAL 7015	110504	2
6	Bearing with housing FY30 - UCF 206 FAG/Timken	110532	2
7	Belt seal 2.5 m	EM-001766	2
8	Conveyor belt L=2500	EM-007579	2
9	Belt sealing sheet clamp 2.5 m	EM-001768	2
10	Belt scraper 900	EM-002854	2
11	Belt scraper 900	EM-003317	2
12	Sealing sheet for belt scraper 900	EM-007586	2
13	Strap scraper clamp 900	EM-003248	2
14	Flat head rivet 5x10 AL-AL ISO 15977	003029K	28
15	Head bolt six. M6x25-8.8 OC ISO 4017 PG	112113K	20
16	Hex head bolt. M8x20-8.8 OC ISO 4017 PG	112036K	21
17	Screw with head six. M8x25-8.8 OC ISO 4017 PG	112037K	20
18	Hex head bolt. M10x30-8.8 OC ISO 4017 PG	112047	8
19	Bolt with undersink M10x30-8.8 OC ISO 8677	112017K	4
20	Bolt with undersink M12x50-8.8 OC ISO 8677	112024K	12
21	Washer 6 OC 200HV ISO 7093	112420K	40
22	Washer 8 OC 200HV ISO 7089	112403K	20
23	Washer 8 OC 200HV ISO 7093	112421K	41
24	Washer 10 OC 200HV ISO 7089	112404K	20
25	Washer 12 OC 200HV ISO 7089	112406K	12
26	Self-contained nut. M6 - 8 OC ISO 7040	112202K	20
27	Self-contained nut. M8 - 8 OC ISO 7040	112203K	20
28	Self-constricting nut. M10 - 8 OC ISO 7040	112204K	12
29	Self-constricting nut m12 - 8 oc iso 7040 M12 - 8 OC ISO 7040	112205K	12

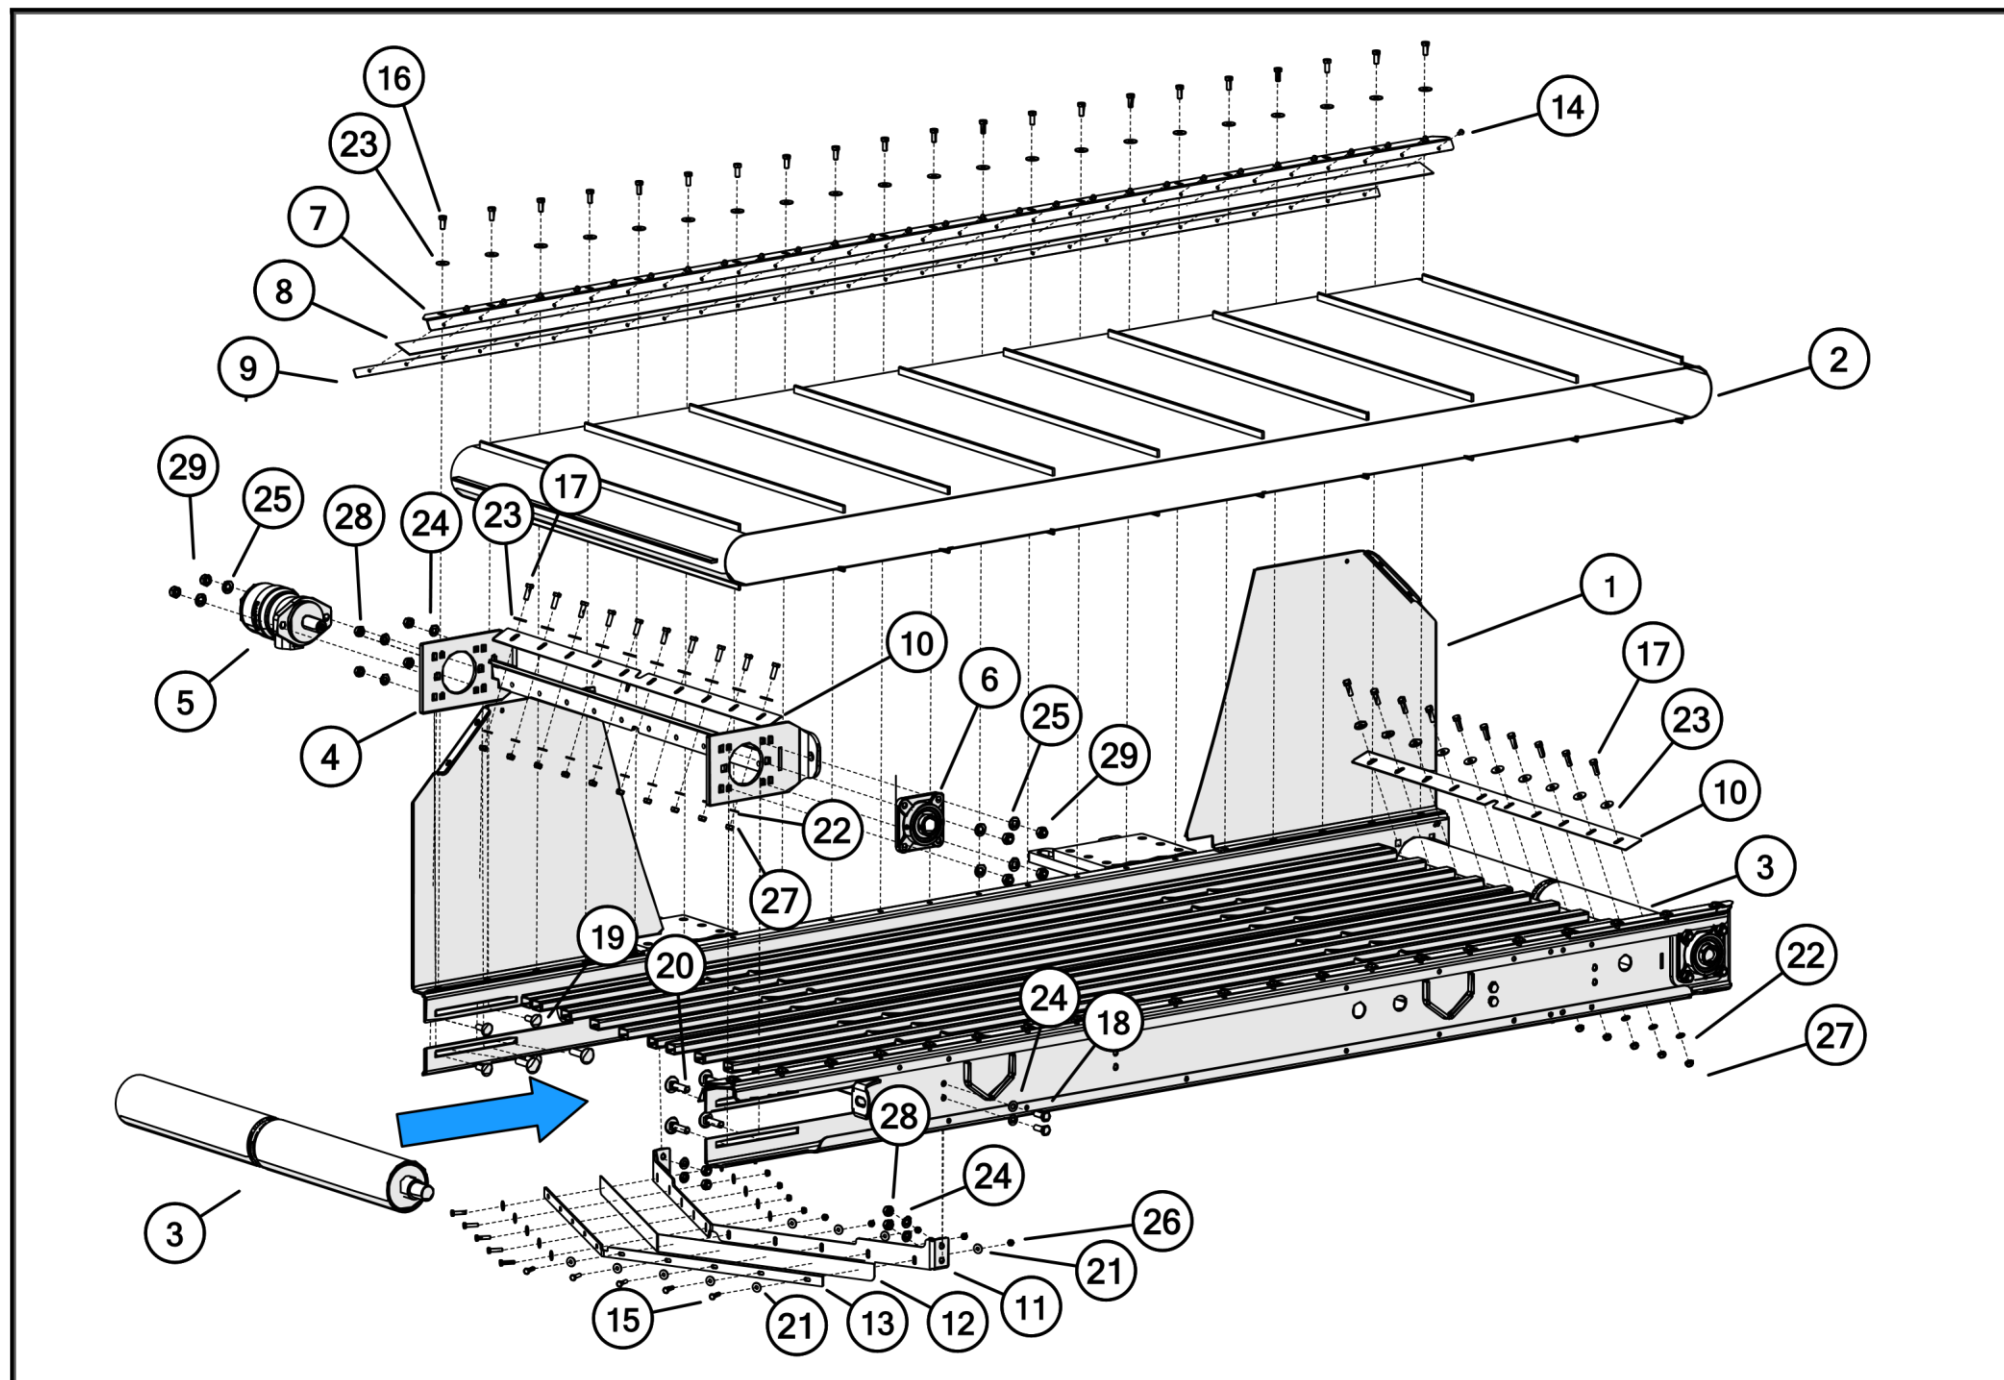


1.12.3. HOUSING FOR BELT

L.P.	DESCRIPTION	CODE	QUANTITY
1	Tape frame 2500x900 window 1.2 m	EM-005616	1
2	Tape face sheet 2500x900 - bevel 2019	EM-005160	1
3	Rubber belt body 900 1030x600	115214	2
4	Transverse belt body right 2019	EM-004218	1
5	Transverse tape body left 2019	EM-002966	1
6	Mounting of belt rubber 900 - right 2019	EM-005081	1
7	Strap rubber mount 900 - left 2019	EM-005404	1
8	Strap rubber mount 90 - 2019	EM-005090	2
9	Reinforcement strip	EM-005856	2
10	Hinge with threaded pins. A-54mm I-30mm M6x15mm	001698	6
11	Screw with head six. M6x20-8.8 OC ISO 4017 PG	112033K	80
12	Screw with head six. M8x20-8.8 OC ISO 4017 PG	112036K	21
13	Washer 6 OC 200HV ISO 7089	112402K	124
14	Enlarged washer 6 OC 200HV ISO 7093	112420K	36
15	Enlarged washer 8 OC 200HV ISO 7093	112421K	21
16	Self-contained nut. M6 - 8 OC ISO 7040	112202K	80

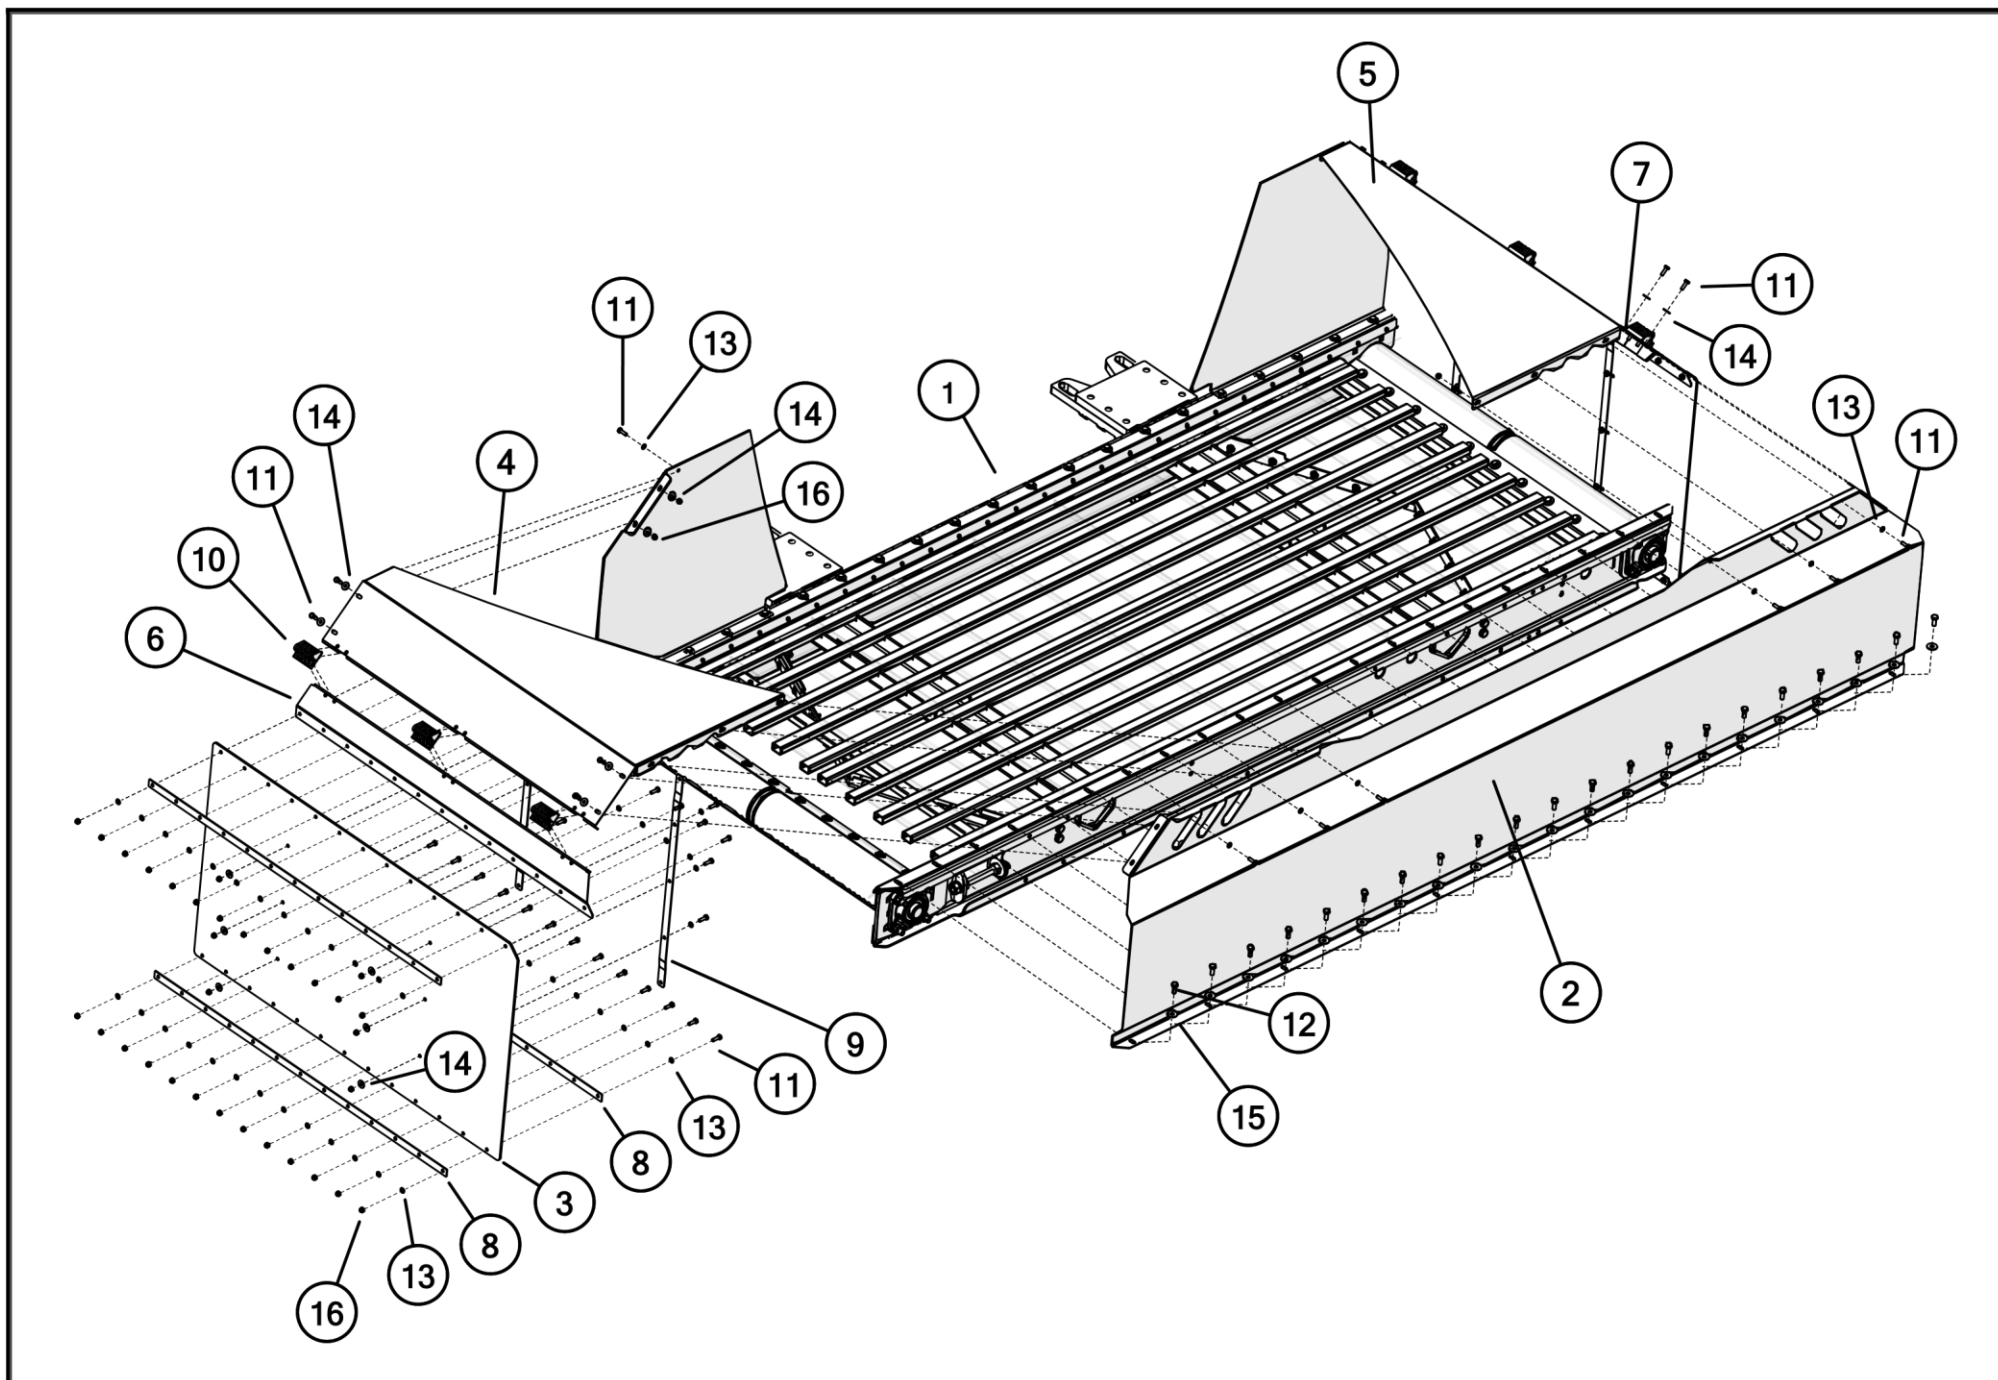


1.12.4. HYDRAULIC INSTALLATION

L.P.	DESCRIPTION	CODE	QUANTITY
1	MOTOR Gopart BMRY-80 P41 AIY10-T10- RAL 7015	110504	2
2	Spacer for hydromotor	EM-000899	1
3	VRFB 90 throttle/return valve	110526	1
4	Straight connector with gasket G1/2 - M18x1.5	118037	5
5	Adjustable angle coupling - 1 nut M18x1.5	118116	1
6	AB nut coupling M18x1.5 / G1/2" 12L 60'	117635	1
7	Underscrew M8x50-8.8 OC ISO 8677	112008K	2
8	Clamp 2x18mm - Bracket	110427	2
9	Clamp 2x16 / 2x18mm - Cap	110426	2
10	Self-locking nut. M8 - 8 OC ISO 7040	112203K	2
11	Conduit 2SC DN10 L=2350 A90 M18 - A90 M18		1
12	Conduit 2SC DN10 L=3000 A90 M18 - A M18		1
13	Conduit 2SC DN10 L=2700 A90 M18 - A M18		1

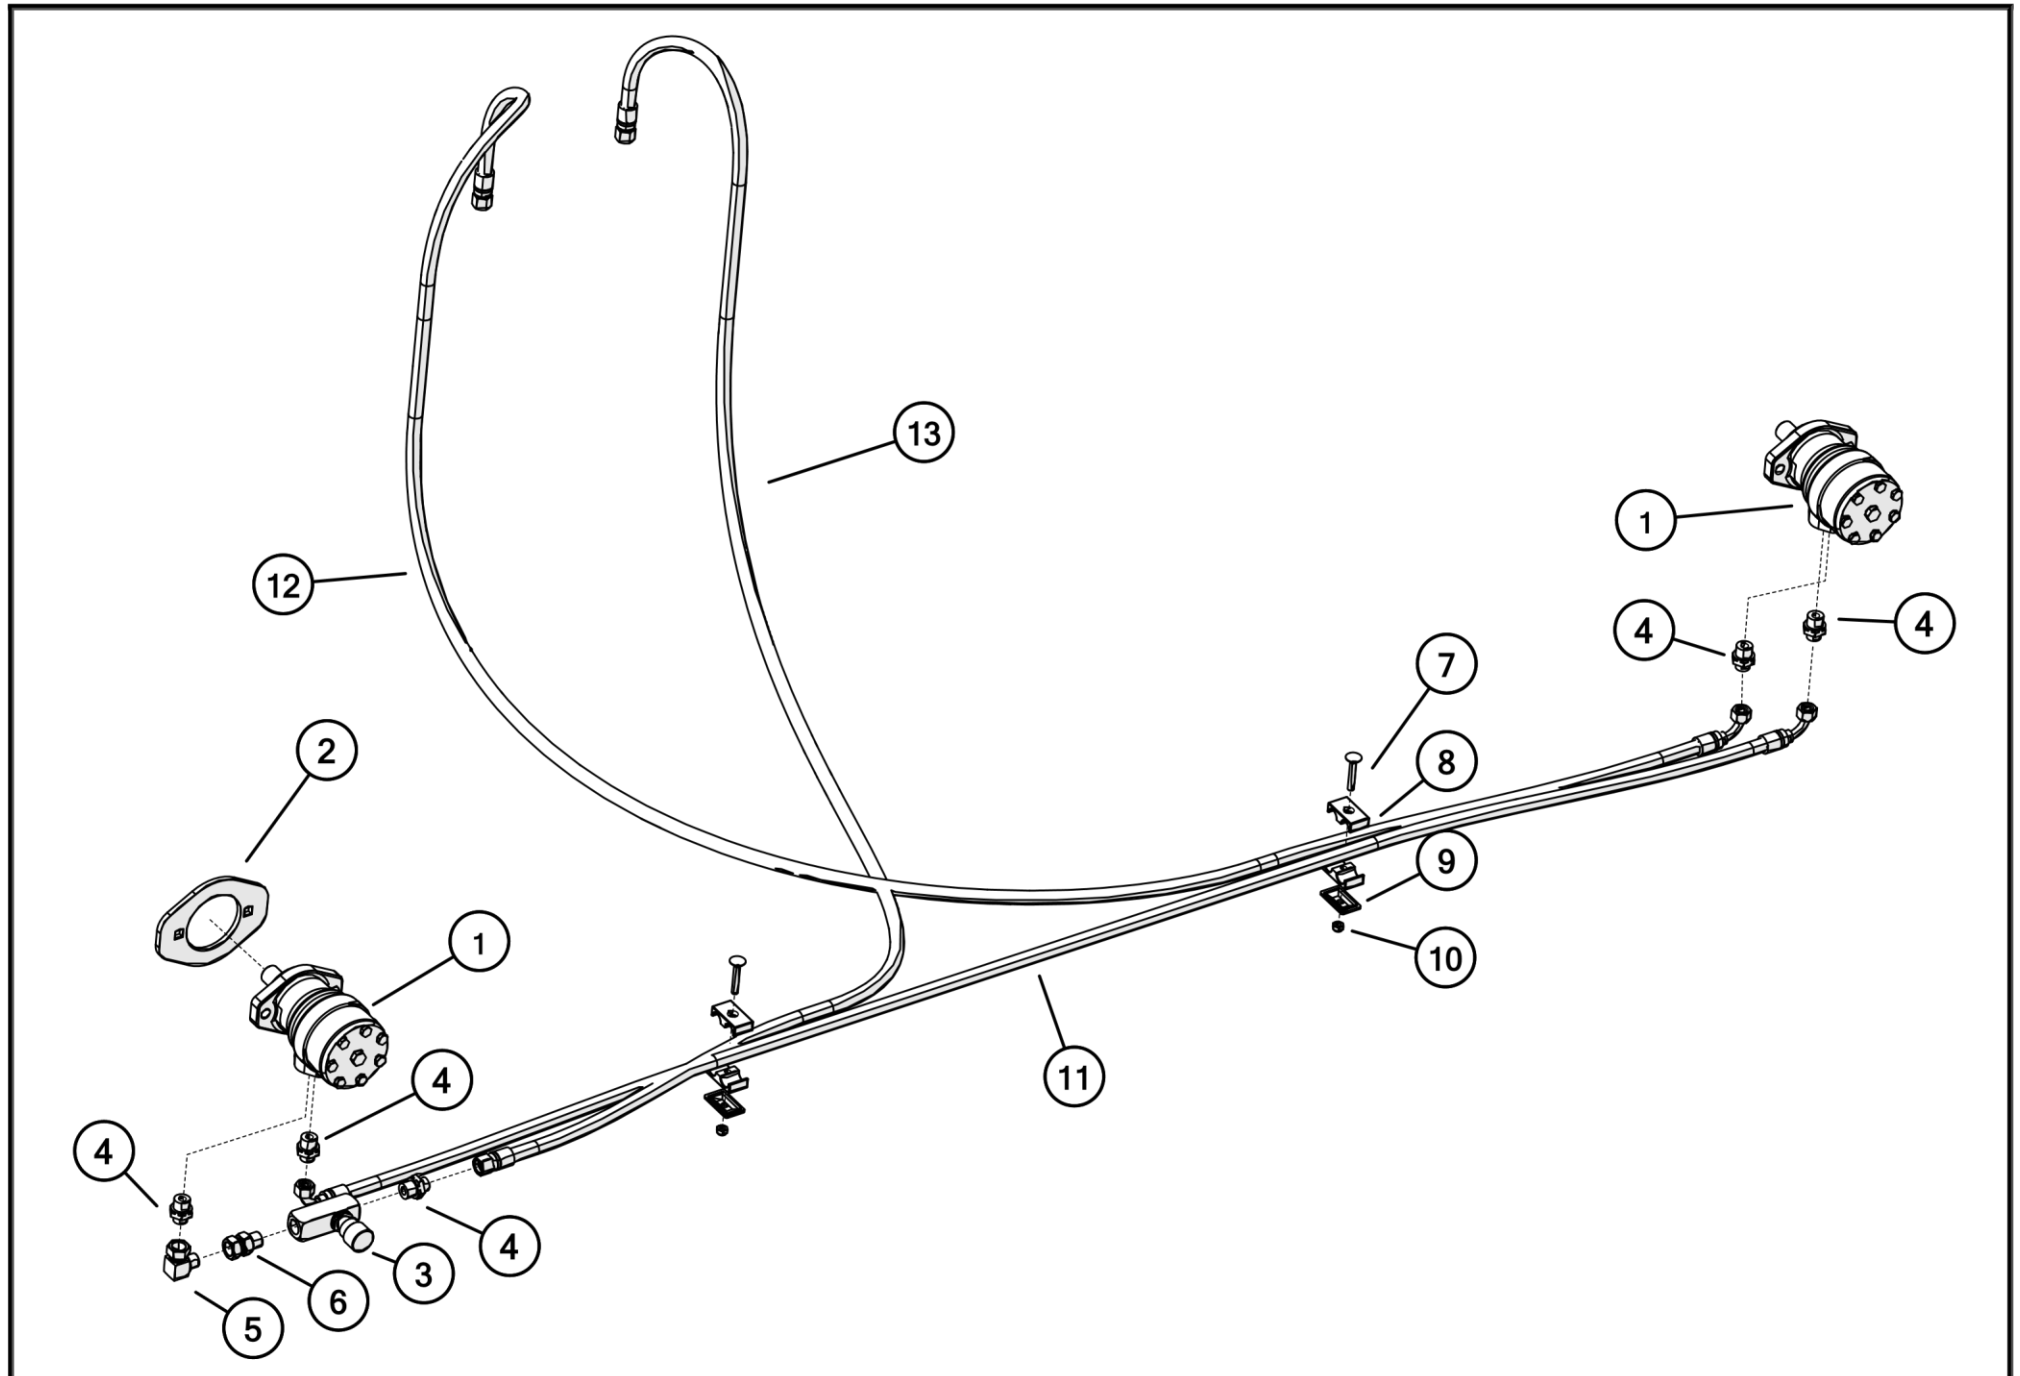


1.21. AXLE WITH WHEELS

L.P.	DESCRIPTION	CODE	QUANTITY
1	FXX HD+ welded frame	EM-000531	1
2	FXX HD+ 100x1800 braked axle	EM-010936	1
3	Wheel 435/50 R19.5 et 0	110164	2
4	Axle spacing of the feed truck	EM-009815	2
5	Head bolt six. M22x80-8.8 OC ISO 4014 NG	112153	8
6	Washer 22 OC 200HV ISO 7089	112414	36
7	Spring washer	110147	20
8	Self-locking nut. M22 - 8 OC ISO 7040	112212	28

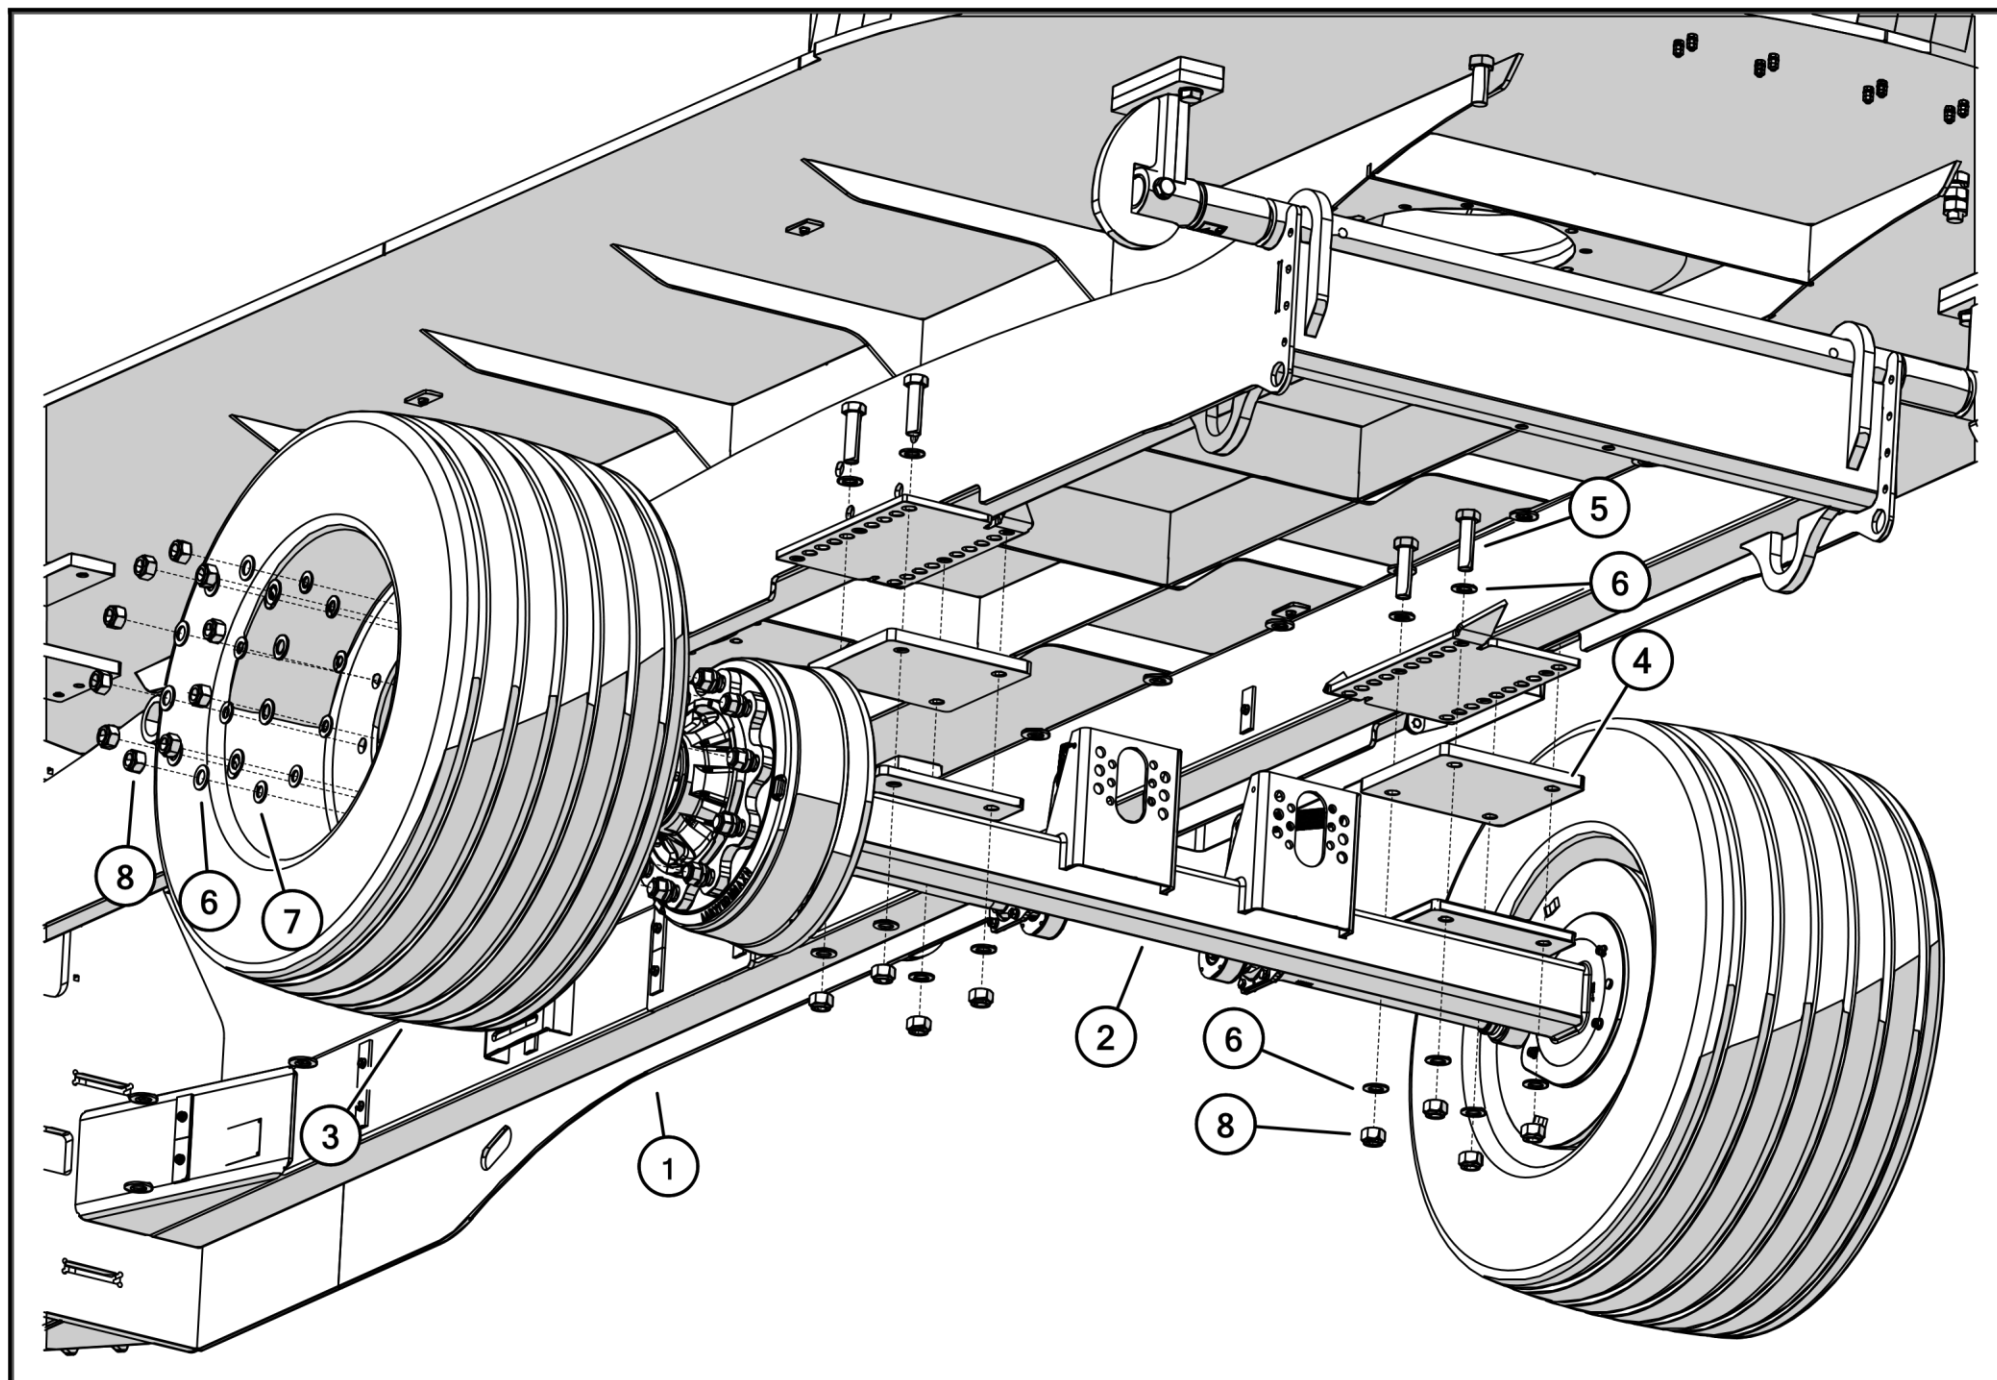


1.22.WEDGES

L.P.	DESCRIPTION	CODE	QUANTITY
1	Welded FXX HD+ basket Bottom 2.55 Displacements 6 and 13	EM-011100	1
2	Wedge hanger	110605	2
3	Steel wheel chock G36 1600 kg	110604	2
4	Washer 8 OC 200HV ISO 7089	112403	4
5	Hexagon nut M8 - 8 OC ISO 4032	112232K	8

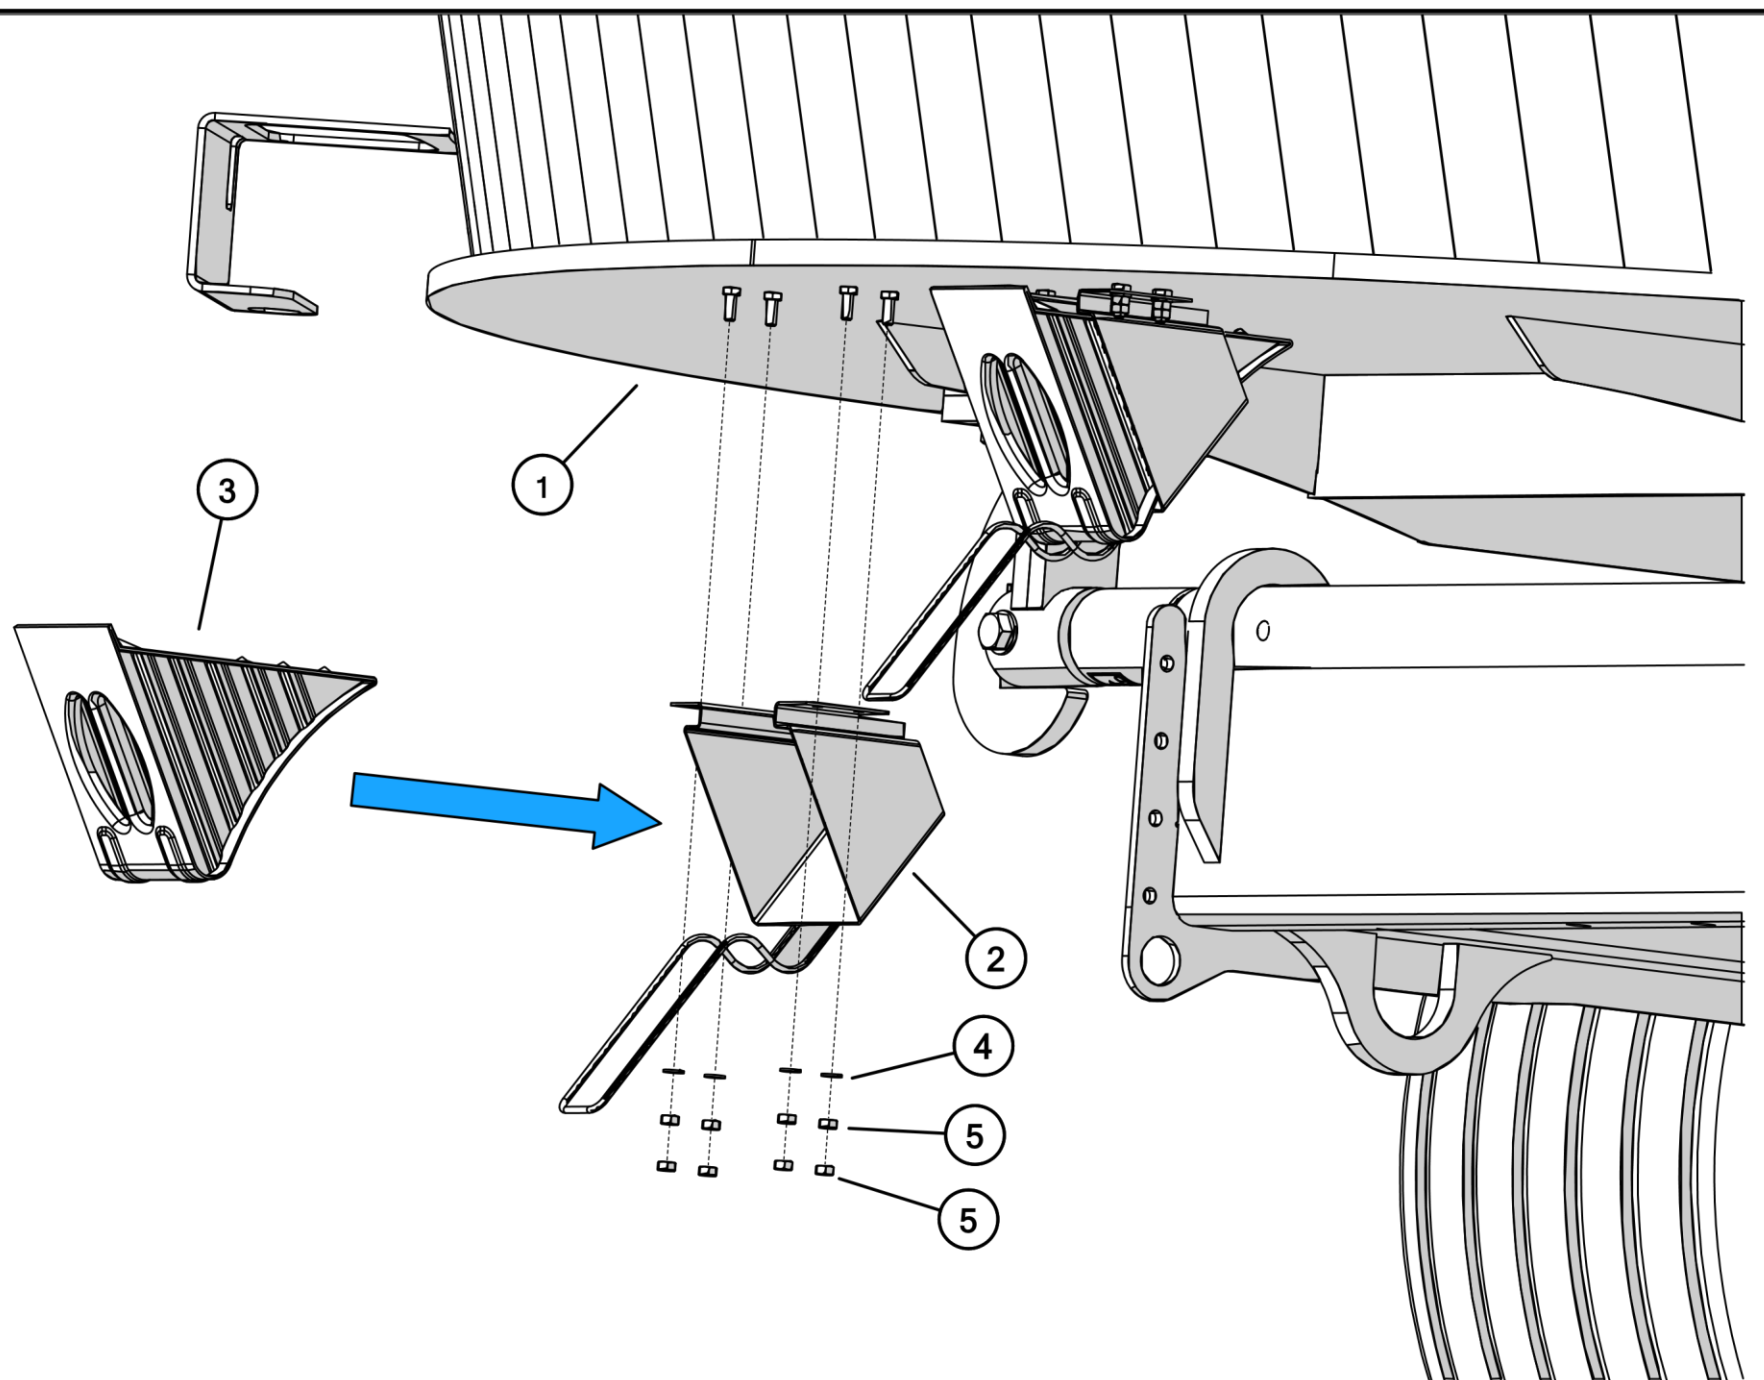


1.23. WEIGHT SENSOR

L.P.	DESCRIPTION	CODE	QUANTITY
1	FXX HD+ welded frame	EM-000531	1
2	Welded FXX HD+ basket Bottom 2.55 Outlets 6 and 13	EM-011100	1
3	Weight sensor Mobile Load Cell 54 mm	110252	1
4	Sensor support foot	EM-009788	1
5	Screw M18x100 OC 8.8 incomplete thread	112084K	1
6	Hex head screw M20x60-8.8 OC ISO 4014 NG	112090K	1
7	Washer 18 OC 200HV ISO 7089	112411K	2
8	Washer 20 OC 200HV ISO 7089	112413K	2
9	Self-contained nut. M18 - 8 OC ISO 7040	112209K	1

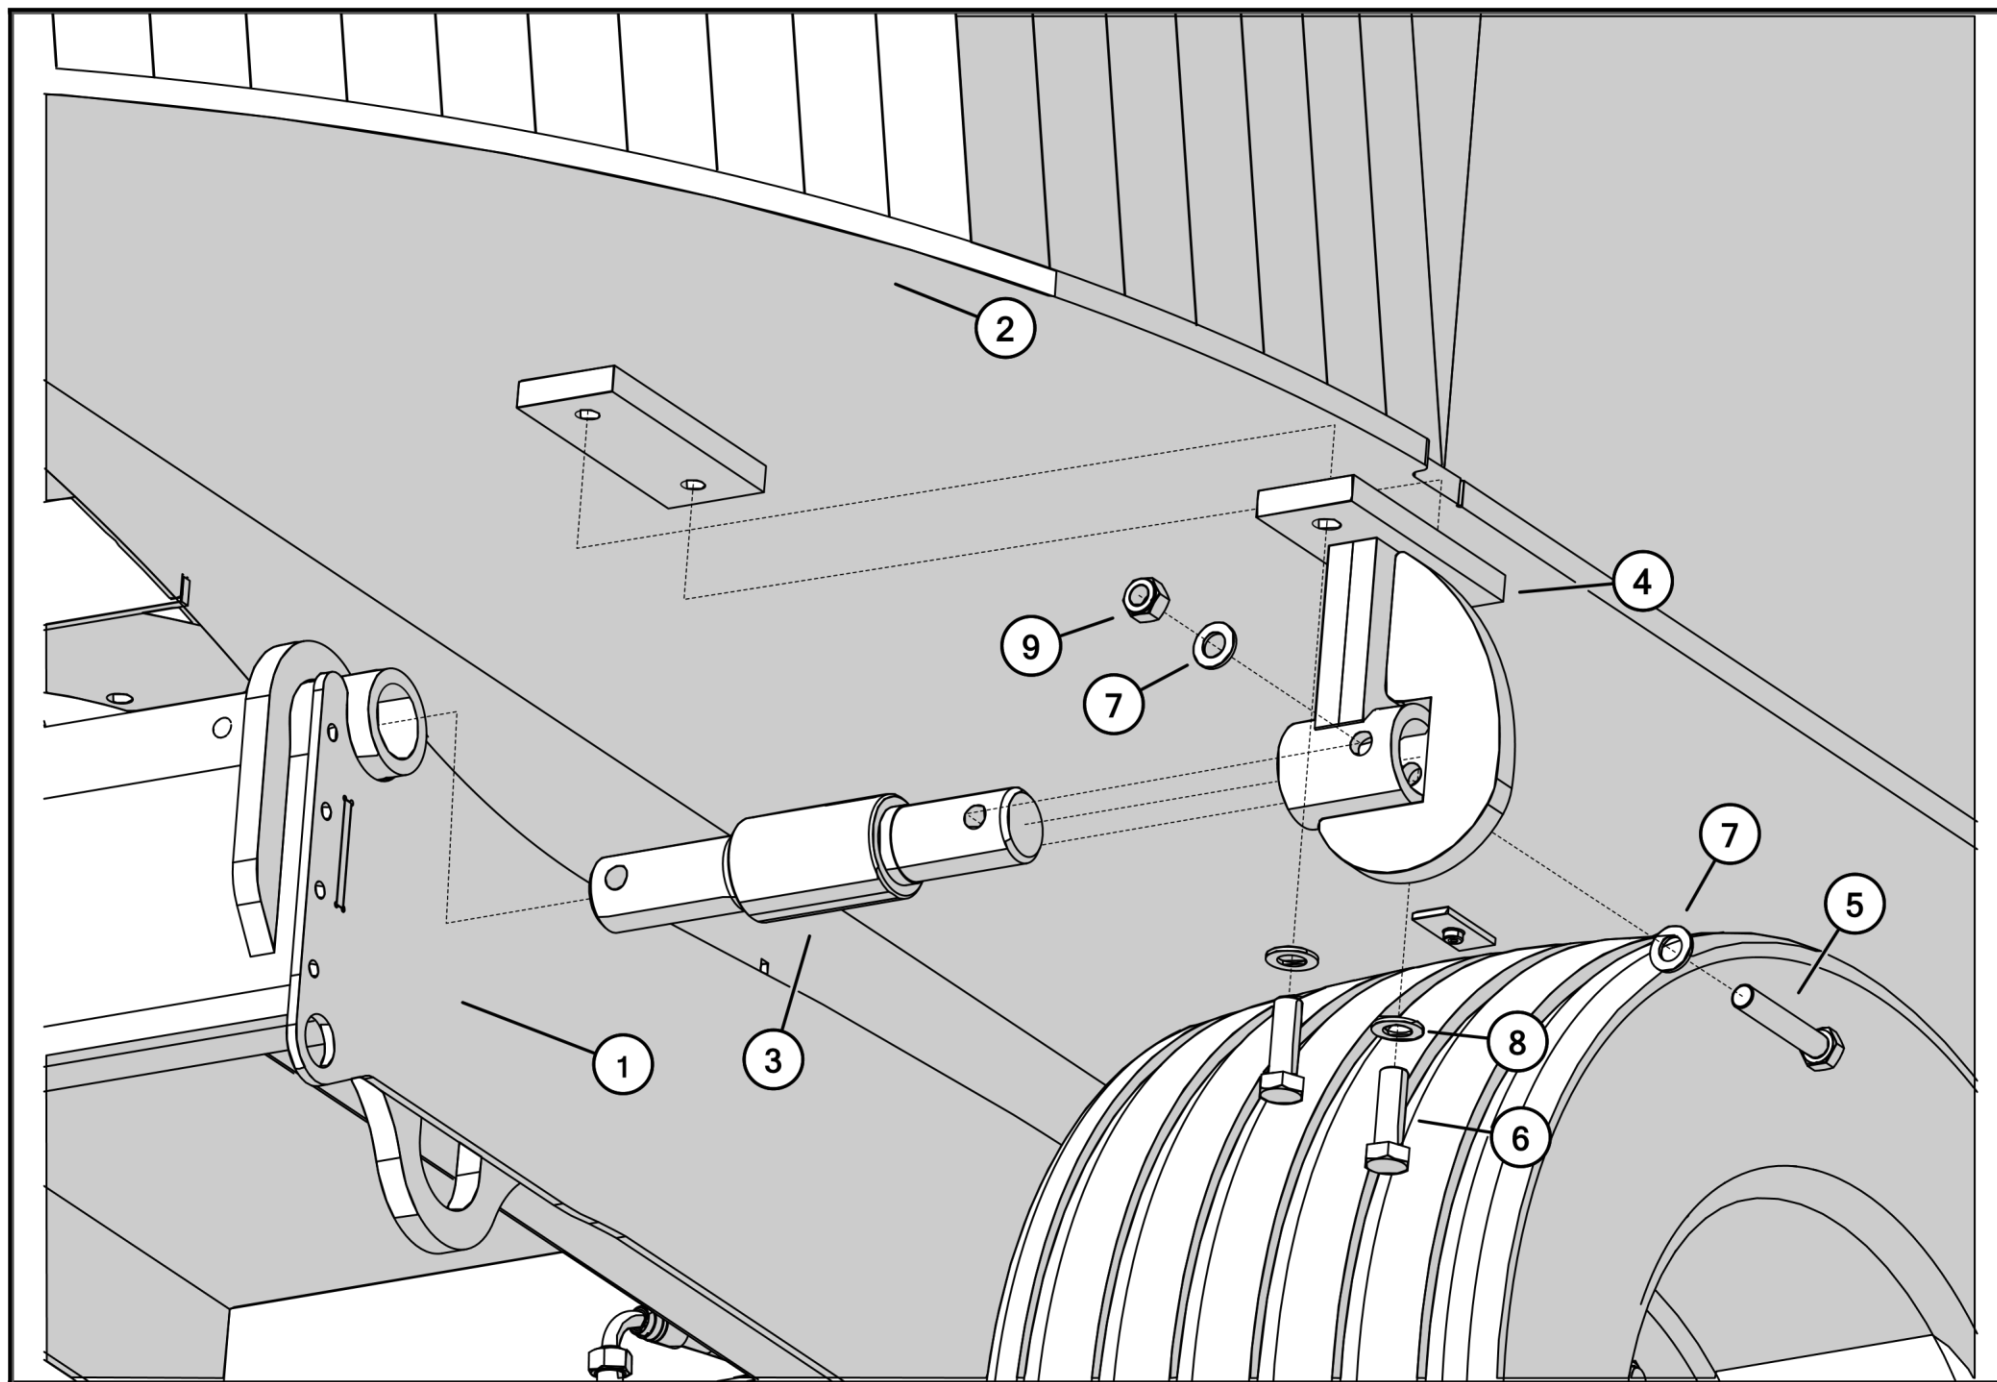

1.24.HYDRAULIC BRAKES

L.P.	DESCRIPTION	CODE	QUANTITY
1	FXX HD+ 100x1800 braked axle	EM-010936	1
2	Brake actuator with spring BCS25100X	110239	2
3	Brake cylinder mounting	EM-005487	2
4	Tee connector non-sym with 1 nut M22x1.5	118015	1
5	Straight connector with seal G3/8 - M22x1.5	118115	2
6	Straight connector with seal G1/2 - M22x1.5	118013	1
7	Quick coupling of sockets for brakes VF012GASF	110619	1
8	Hydraulic line 2SC DN12 L=600 nut M22 - nut M22		1
9	Hydraulic line 2SC DN10 L=7900 elbow M22 - nut M22		1
10	Six head bolt. M12x90 - 8.8 OC ISO 4014 NG	114062K	2
11	Hex head bolt. M16x40 - 8.8 OC ISO 4017 PG	112071K	4
12	Washer 12 OC 200HV ISO 7089	112406K	4
13	Washer 16 OC 200HV ISO 7089	112410K	8
14	Self-contained nut. M12 - 8 OC ISO 7040	112205K	2
15	Self-contained nut. M16 - 8 OC ISO 7040	112207K	4

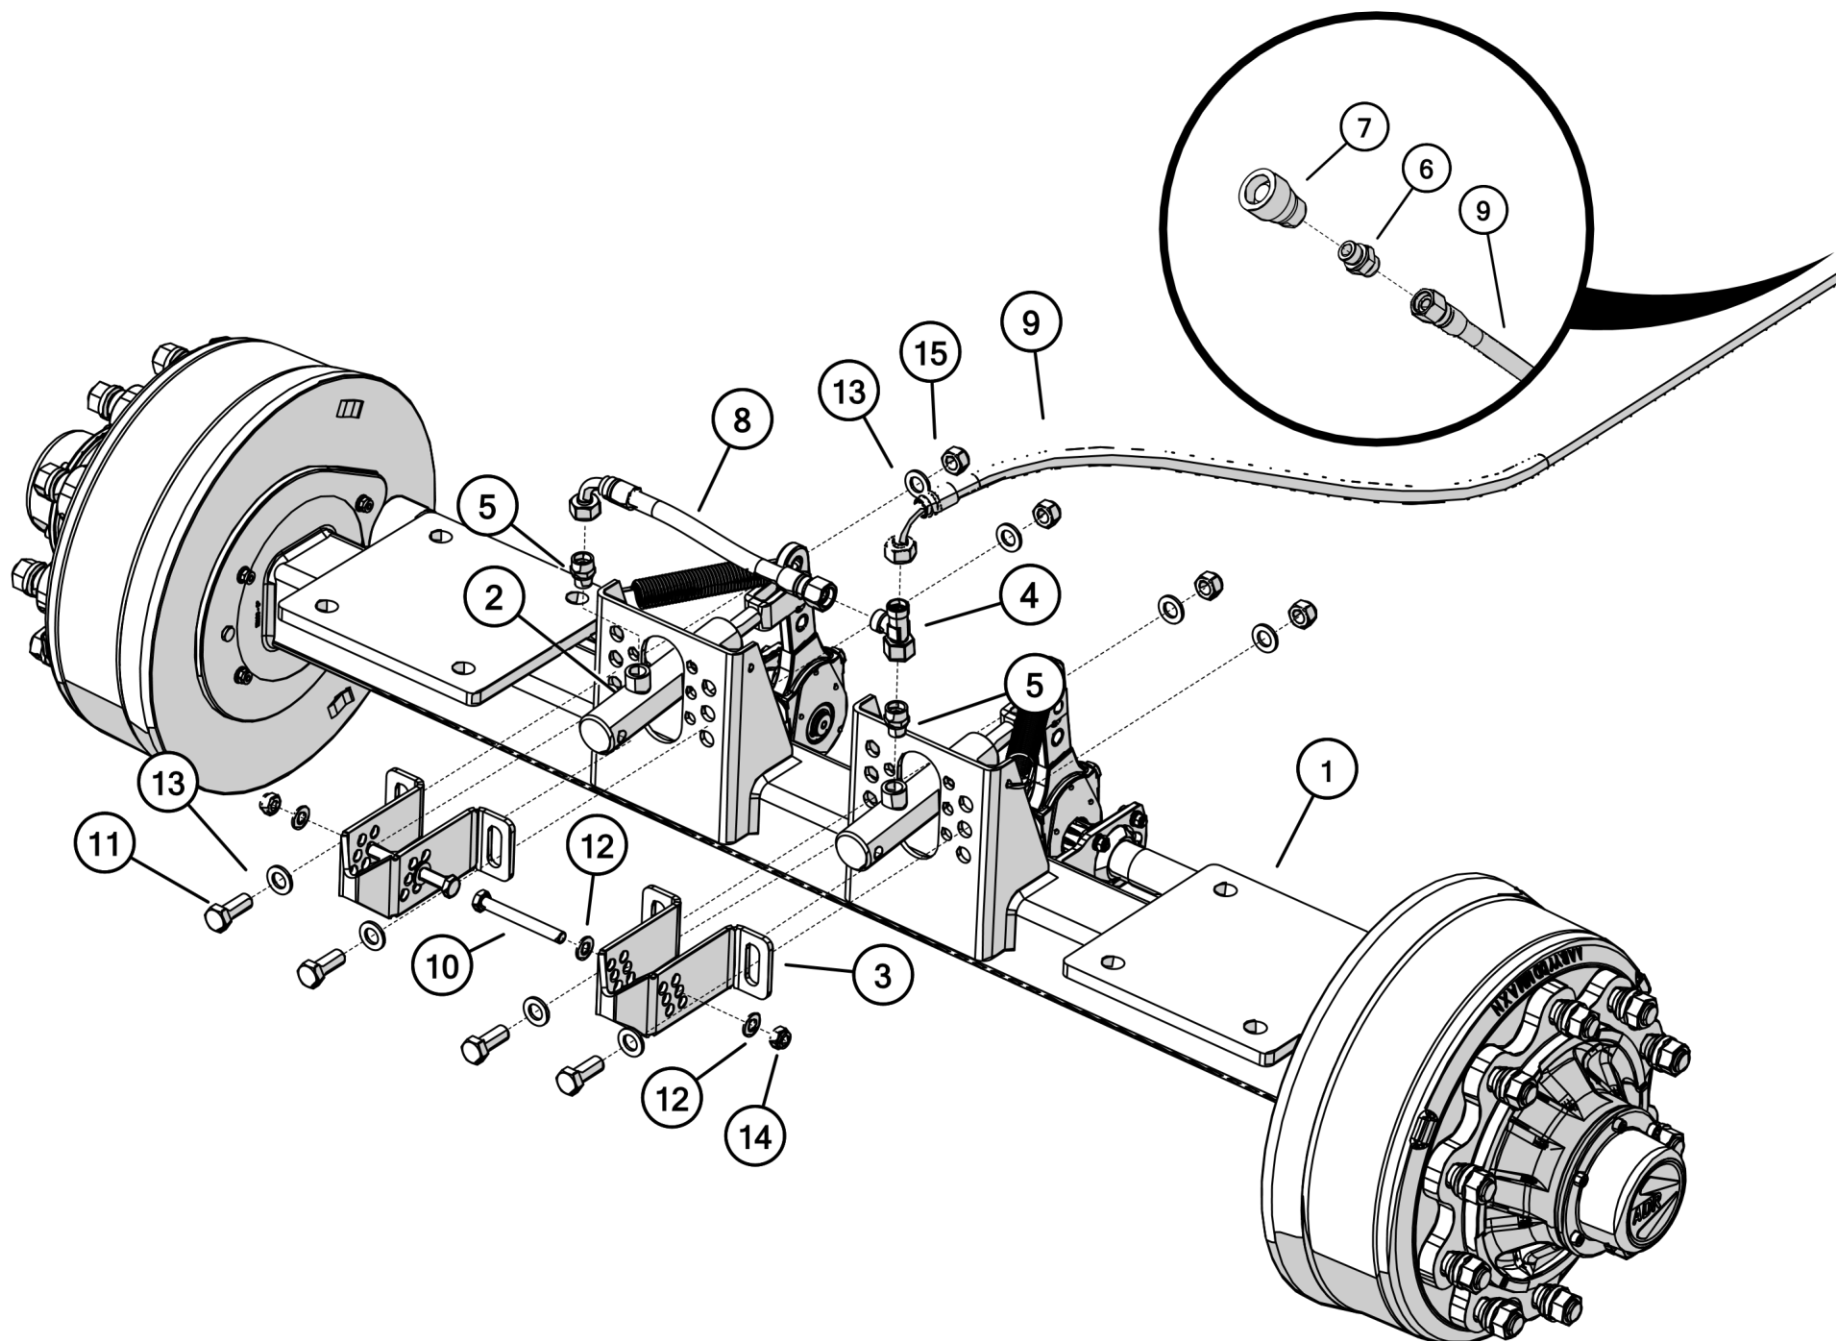

RINO

FXX 2200 HD +

HYDRAULIC
HOSES

2.

L.P.	DESCRIPTION	QUANTITY
1. HOSES TO THE ACTUATOR (WITHOUT DISTRIBUTOR)		
1.1.	Hydraulic line 2SC DN10 L=570 A90 M18 - A M18	2
2. HOSES FOR SIDE DUMP NO. 13		
2.1.	Hydraulic line 2SC DN10 L=5200 A90 M18 - A M18	1
2.2.	Hydraulic line 2SC DN10 L=5900 A90 M18 - A M18	1
3. FRONT DUMP HOSES NO. 6		
3.1.	Hydraulic line 2SC DN10 L=6300 A90 M18 - A M18	1
3.2.	Hydraulic line 2SC DN10 L=5400 A90 M18 - A M18	1
4. HYDRAULIC BELT LINES		
4.1.	Hydraulic line 2SC DN10 L=2350 A90 M18 - A90 M18	1
4.2.	Hydraulic line 2SC DN10 L=2700 A90 M18 - A M18	1
4.3.	Hydraulic line 2SC DN10 L=3000 A90 M18 - A M18	1
5. HOSES FROM THE DISTRIBUTOR TO THE TRACTOR		
5.1.	Hydraulic line 2SC DN10 L=2500 A M22 - A M22	6

NOTES

.....

.....

.....

.....

.....

.....

.....

.....

.....
